

Agreement No. CE 60/2017 (EP)

### Environmental Team for Tung Chung New Town Extension (East) -Design and Construction

**Monthly Environmental Monitoring & Audit Report** for March 2021

#### **ERM**

2509, 25/F One Harbourfront 18 Tak Fung Street Hunghom, Kowloon Hong Kong T: 2271 3000 F: 2723 5660 www.erm.com



# Agreement No. CE60/2017 (EP) Environmental Team for Tung Chung New Town Extension (East) – Design and Construction

Monthly Environmental Monitoring & Audit Report for March 2021

#### **Revision 1**

Document Code: 0445700\_Monthly EM&A March 2021\_v1.docx

## **Environmental Resources Management**

2509, 25/F, One Harbourfront 18 Tak Fung Street Hunghom, Kowloon Hong Kong

Telephone: (852) 2271 3000 Facsimile: (852) 2723 5660 E-mail: post.hk@erm.com http://www.erm.com

Client:		Droioot	No.		
Client:		Project	INO:		
Civil Eng	gineering and Development Department	04457	700		
Summary:		Date:			
			ril 2021		
		Approv			
		Applov	eu by.		
This document presents the Monthly EM&A Report for March 2021 for Environmental Team for Tung Chung New Town Extension (East) – Design and Construction (Agreement No. CE 60/2017			Lil.		
[EP]).		0 . 4 D . 1			
		_	A. Reid		
		Partne	er		
1	Monthly EM&A Report (for March 2021)	Var	RC/JT	CAR	14/4/21
Revision	Description	Ву	Checked	Approved	Date
This report has been prepared by Environmental Resources Management the trading name of 'ERM Hong-Kong, Limited', with all reasonable skill, care and diligence within the terms of the Contract with the client, incorporating our General Terms and Conditions of Business		Distribu	ıtion		BSI ~
and taking account of the resources devoted to it by agreement with the client.				AS 18001:2007 P. No. OHS 515956	
We disclaim any responsibility to the client and others in respect of any matters outside the scope of the above.		$\boxtimes$	Public		BSI
This report is confidential to the client and we accept no responsibility of whatsoever nature to third parties to whom this report, or any part thereof, is made known. Any such party relies on the report at their own risk.			Confidentia		9001 : 2008 ate No. FS 32515





#### **Tung Chung New Town Extension**

## **Environmental Certification Sheet for Environmental Permit No. EP-519/2016**

#### Reference Document/Plan

Document/Plan to be Certified: Monthly Environmental Monitoring & Audit Report for

March 2021 (Revision 1)

Date of Report: 14 April 2021

#### **Reference EP Condition**

Environmental Permit Condition: Condition 3.5

The Permit Holder shall submit 4 hard copies and 1 electronic copy of Monthly EM&A Reports for the construction stage of the Project to the Director, within 2 weeks after the end of the reporting month. The monthly EM&A Reports shall include an executive summary of all environmental audit results, together with actions taken in the event of non-compliance (exceedances) of the environmental quality performance limits (Action and Limit Levels), complaints received and emergency events relating to violation of environmental legislation (such as illegal dumping and landfilling). The submissions shall be certified by the ET Leader and verified by the IEC as having complied with the requirements as set out in the updated EM&A Manual before submission to the Director. Additional copies of the Monthly EM&A Reports shall be provided upon request by the Director.

#### **ET Certification**

I hereby certify that the above referenced document/plan complies with the above referenced condition of EP-519/2016

lue

Jovy Tam

Environmental Team Leader

Date:

14 April 2021



Your Ref.

By Post

Our Ref. 198377-0321

Date 14 April 2021

Sustainable Lantau Office Civil Engineering and Development Department 13/F, North Point Government Offices 333 Java Road, North Point Hong Kong

For the attention of Mr. S.K. LO / Mr. K.T. WO

Dear Sir.

Agreement No. CE 59/2017 (EP)

Independent Environmental Checker for Tung Chung New Town Extension – Investigation Monthly Environmental Monitoring & Audit Report for March 2021

We refer to the Monthly Environmental Monitoring & Audit Report for March 2021 for Tung Chung New Town Extension (East) dated 14 April 2021 and certified by the Environmental Team Leader on 14 April 2021. Please note the submission is hereby verified, in accordance with the requirement stipulated in Condition 3.5 of EP-519/2016.

Should you have any query, please feel free to contact the undersigned at 2608 7314 (chuawo@binnies.com) or our Ivan Ting at 9222 9490 (iec.tcnte@gmail.com).

Yours faithfully, for and on behalf of BINNIES HONG KONG LIMITED

MANUEL CHUA


INDEPENDENT ENVIRONMENTAL CHECKER

cc: ET Leader – ERM (Attn: Mr. Jovy Tam) [by Email: jovy.tam@erm.com] Project Manager / TCE – AECOM (Attn: Mr. Chris Cheung) [by Email: <a href="mailto:crec1@tce-aecom.com">crec1@tce-aecom.com</a>]



Binnies Hong Kong Limited 43/F, AIA Kowloon Tower, 100 How Ming Street, Kwun Tong, Kowloon, Hong Kong 賓尼斯工程顧問有限公司

+852 2601 3988











#### **CONTENTS**

	ABBREVIATIONS	1
	EXECUTIVE SUMMARY	1
1	INTRODUCTION	1
1.1	BACKGROUND	1
1.2	SCOPE OF THE EM&A REPORT	2
1.3	ORGANIZATION STRUCTURE	2
1.4	SUMMARY OF CONSTRUCTION WORKS	3
1.5	SUMMARY OF EM&A PROGRAMME REQUIREMENTS	5
1.6	STATUS OF STATUTORY ENVIRONMENTAL COMPLIANCE WITH THE	
	Environmental Permit	7
1.7	STATUS OF OTHER STATUTORY ENVIRONMENTAL REQUIREMENTS	7
2	EM&A RESULTS FOR TUNG CHUNG EAST	8
2.1	AIR QUALITY	8
2.2	Noise Monitoring	9
2.3	WATER QUALITY MONITORING	12
2.4	SOFT SHORE ECOLOGICAL MONITORING	15
2.5	EM&A SITE INSPECTION	15
2.6	Waste Management Status	19
2.7	IMPLEMENTATION STATUS OF ENVIRONMENTAL MITIGATION MEASURES	20
2.8	SUMMARY OF EXCEEDANCES OF THE ENVIRONMENTAL QUALITY PERFORMA	NCE
	LIMIT	20
2.9	SUMMARY OF COMPLAINTS, NOTIFICATION OF SUMMONS AND SUCCESSFUL	
	PROSECUTIONS	20
3	FUTURE KEY ISSUES	23
3.1	CONSTRUCTION PROGRAMME FOR THE COMING MONTH	23
3.2	MONITORING SCHEDULE FOR THE COMING MONTH	25
4	CONCLUSION AND RECOMMENDATION	26

#### **ANNEXES**

ANNEX A	PROJECT ORGANISATION
ANNEX B	ENVIRONMENTAL MITIGATION IMPLEMENTATION SCHEDULE
ANNEX C	STATUS OF SUBMISSIONS AND IMPLEMENTATION STATUS OF MITIGATION MEASURES UNDER EP
ANNEX D	STATUS OF STATUTORY ENVIRONMENTAL REQUIREMENTS
ANNEX E	AIR QUALITY
ANNEX E1	CALIBRATION CERTIFICATES
ANNEX E2	MONITORING SCHEDULE
ANNEX E3	MONITORING RESULTS
ANNEX E4	EVENT AND ACTION PLAN
ANNEX F	NOISE
ANNEX F1	CALIBRATION CERTIFICATES
ANNEX F2	MONITORING SCHEDULE
ANNEX F3	MONITORING RESULTS
ANNEX F4	EVENT AND ACTION PLAN
ANNEX G	WATER QUALITY
ANNEX G1	CALIBRATION CERTIFICATES
ANNEX G2	MONITORING SCHEDULE
ANNEX G3	MONITORING RESULTS
ANNEX G4	EVENT AND ACTION PLAN
ANNEX H	SOFT SHORE ECOLOGY
ANNEX H1	MONITORING SCHEDULE
ANNEX H2	MONITORING RESULTS
ANNEX H3	EVENT AND ACTION PLAN
ANNEX I	CUMULATIVE STATISTICS ON EXCEEDANCES, ENVIRONMENTAL
	COMPLAINTS, NOTIFICATION OF SUMMONS AND STATUS OF
	PROSECUTIONS

ANNEX J MONITORING SCHEDULE FOR THE NEXT REPORTING PERIOD

#### **ABBREVIATIONS**

C&D	Construction and Demolition
CAP	Contamination Assessment Plan
CEDD	Civil Engineering and Development Department
CWD	Chinese White Dolphin
DCM	Deep Cement Mixing
DO	Dissolved Oxygen
EIA	Environmental Impact Assessment
EIAO	Environmental Impact Assessment Ordinance
EIS	Ecologically Important Stream
EM&A	Environmental Monitoring and Audit
EP	Environmental Permit
EPD	Environmental Protection Department
ER	Engineer's Representative
ERM	ERM-Hong Kong, Limited
ET	Environmental Team
HVS	High Volume Sampler
IEC	Independent Environmental Checker
PDA	Planned Development Area
PME	Powered Mechanical Equipment
QPME	Quality Powered Mechanical Equipment
RAP	Remediation Action Plan
RR	Remediation Report
RTTM	Real Time Tracking and Monitoring
SS	Suspended Solid
TCB	Tung Chung Bay
TCE	Tung Chung East
TCNTE	Tung Chung New Town Extension
TCW	Tung Chung West
The Project	Tung Chung New Town Extension (East)
THW	Tai Ho Wan
TSP	Total Suspended Particulate
	Updated Environmental Monitoring and Audit Manual
Updated	for Tung Chung New Town Extension prepared by ERM
EM&A Manual	under Agreement No. CE 60/2017 (EP) and deposited to
	EPD under Environmental Permit No. EP-519/2016

#### **EXECUTIVE SUMMARY**

Tung Chung New Town Extension (TCNTE) is one of the major initiatives under the Government's multi-pronged approach to increase land supply to meet Hong Kong's medium- to long-term needs for housing, economic and social developments. The Environmental Impact Assessment (EIA) Report for TCNTE (Register No. AEIAR-196/2016) was approved on 8 April 2016 and the Environmental Permit (EP) No. EP-519/2016, covering the construction and operation of TCNTE, was granted on 9 August 2016. The EIA Report and EP cover both Tung Chung East (TCE) and Tung Chung West (TCW). ERM-Hong Kong, Limited (ERM) is commissioned to undertake the role of Environmental Team (ET) for the construction and operation of TCE Project ("the Project") in accordance with the requirements specified in the EP, Updated Environmental Monitoring and Audit (EM&A) Manual, EIA Report of the TCNTE project and other relevant statutory requirements. The construction of the Project commenced on 9 July 2018.

This is the Monthly EM&A report presenting the EM&A works carried out during the period from 1 to 31 March 2021 for the Project in accordance with the Updated EM&A Manual.

A summary of monitoring and audit activities conducted in the reporting period is listed below:

Air Quality Monitoring 6 sessions

Noise Monitoring 6 sessions

Water Quality Monitoring 14 sessions

Soft Shore Ecological Monitoring 1 session

Environmental Site Inspection 4 sessions

Environmental Management Meeting 1 session

Environmental auditing works, including weekly site inspections of construction works conducted by the ET, audit of works vessels, audit of implementation of Dolphin Watching Plan, Works Vessel Travel Route Plan, Silt Curtain Deployment Plan, Spill Response Plan and Waste Management Plan were conducted in the reporting period. Based on the audit results and the observation for the reporting period, environmental pollution control and mitigation measures for the Project were properly implemented.

#### Breaches of Action and Limit Levels for Air Quality

No exceedance of Action and Limit Levels was recorded for construction air quality monitoring in the reporting period.

#### **Breaches of Action and Limit Levels for Noise**

No exceedance of Limit Levels was recorded for construction noise monitoring in the reporting period. However, five (5) Action Level were triggered from five (5) environmental complaints related to noise nuisance in the reporting period. Investigations were conducted for the exceedances in accordance with the Event and Action Plan.

#### Breaches of Action and Limit Levels for Water Quality

Dissolved Oxygen (DO) and Suspended Solids (SS) exceedances were recorded during the reporting period. Relevant investigations and follow-up actions were conducted according to the EM&A programme. The exceedances were considered not related to this Project after investigations.

#### **Soft Shore Ecological Monitoring**

Based on the impact monitoring conducted during the reporting period, there was no evidence showing any significant difference in intertidal communities when compared against the data obtained during baseline monitoring. The ET will continue to observe the change in density or the distribution pattern of horseshoe crab, seagrass and intertidal soft shore communities taking into account natural fluctuation in respect of the occurrence and distribution pattern.

#### **Environmental Complaints, Non-compliance & Summons**

There was no notification of summons or prosecution recorded in the reporting period.

Six (6) environmental complaints were received in the reporting period. Investigations were conducted for the environmental complaints in accordance with the complaint handling process as stated in the Complaint Management Plan.

#### **Reporting Change**

There was no reporting change in the reporting period.

#### **Key Issues For The Coming Month**

Potential environmental impacts arising from the upcoming construction activities in the next reporting period of April 2021 are mainly associated with dust emission, noise from barge and plant operation during normal working hours and restricted hours, elevation in SS due to sediment loss from laying of sand blanket and marine filling works, disturbance to Chinese White Dolphin (CWD) during marine works, handling and storage of C&D materials generated from construction activities, efficiency of wastewater and drainage management. The ET will keep track on the construction works to confirm compliance of environmental requirements and the proper implementation of all necessary mitigation measures. The ET will also recommend to the

ey issues for t	S		

#### 1 INTRODUCTION

#### 1.1 BACKGROUND

Tung Chung New Town Extension (TCNTE) is one of the major initiatives under the Government's multi-pronged approach to increase land supply to meet Hong Kong's medium- to long-term needs for housing, economic and social developments. The Environmental Impact Assessment (EIA) Report for TCNTE (Register No. AEIAR-196/2016) was approved on 8 April 2016 and the Environmental Permit (EP) No. EP-519/2016, covering the construction and operation of TCNTE, was granted on 9 August 2016. The EIA Report and EP cover both Tung Chung East (TCE) and Tung Chung West (TCW).

ERM-Hong Kong, Limited (ERM) is commissioned to undertake the role of Environmental Team (ET) for the construction and operation of TCE Project ("the Project") in accordance with the requirements specified in the EP, Updated Environmental Monitoring and Audit (EM&A) Manual <sup>(1)</sup>, EIA Report of the TCNTE project <sup>(2)</sup> and other relevant statutory requirements.

The TCE Project ("the Project") comprises the following elements:

- 1. Reclamation of the seabed by a non-dredged method at TCE to form a total of about 130 hectares of land;
- 2. Construction of about 4.9 kilometers of seawalls, with an eco-shoreline, three drainage box culvert outfalls, three circulation drains and a seawater intake at TCE;
- 3. Provision of infrastructure for Tung Chung Area 58, including construction of a single two-lane road with a footpath and the associated utility works;
- 4. Site formation works at TCW;
- 5. Construction of the River Park including a visitor centre at TCW;
- 6. Construction of proposed open space;
- 7. Construction of sustainable urban drainage systems at TCW;
- 8. Construction of roads, footpaths, cycle tracks and the associated junction / road improvement works;
- 9. Engineering infrastructure works covering drainage, sewerage, waterworks (including a fresh water service reservoir, a salt water service

ERM (2018a). Updated Environmental Monitoring and Audit Manual for Tung Chung New Town Extension.
 Deposited to EPD under EP-519/2016

<sup>(2)</sup> Arup (2015). Environmental Impact Assessment Report for Tung Chung New Town Extension. Deposited to EPD under Register No. AEIAR-196/2016

reservoir and a salt water pumping station), common utility tunnels and landscaping works; and

10. Implementation of environmental mitigation measures and environmental monitoring and audit programme for the works.

The location of the Project, including the associated infrastructure works, is shown in *Figure 1.1*. The construction and the reclamation related marine works of the Project commenced on 9 and 13 July 2018, respectively.

#### 1.2 Scope of the EM&A Report

This is the Monthly EM&A Report for the Project which summarises the key findings of the EM&A programme during the reporting period from 1 to 31 March 2021 for the construction works.

#### 1.3 Organization Structure

The organization structure of the Project is shown in *Annex A*. The key personnel contact names and contact details are summarized in *Table 1.1* below.


Table 1.1 Contact Information of Key Personnel

Party	Position	Name	Telephone
Civil Engineering and	Senior Engineer	Lo Siu Keung	2231 4426
Development	Marine Conservation	Wo King Tai	3894 9707
Department	Officer		
Engineer's Representative	Principal Resident Engineer	Frankie Fan	3894 9403
(ER) (AECOM Asia Company	Chief Resident Engineer	Chris Cheung	3894 9604
Limited)	Resident Engineer	Nelson Ling	3894 9647
	Senior Inspector of Works	C K Liu	3894 9733
Environmental Team	ET Leader	Jovy Tam	3894 9507
(ET) (ERM-Hong Kong, Limited)	Deputy ET Leader	Kelvin So	3894 9504
Independent	IEC	Manuel Chua	3894 9501
Environmental Checker (IEC) (Binnies Hong Kong Limited)	Deputy IEC	Ivan Ting	3894 9502
Contractor (Contract No.	0	Keith Tse	3903 1503
NL/2017/03 TCNTE - Reclamation and	Construction Team Leader	Lee Wai Man	3903 1520
Advance Works)	Environmental Officer	Issac Wong	9850 0989

Party	Position	Name	Telephone
(Build King - SCT Joint	24-hour Complaint	-	9862 2910
Venture)	Hotline		

#### 1.4 SUMMARY OF CONSTRUCTION WORKS

As informed by the Contractor, details of the major works carried out in this reporting period are listed below:

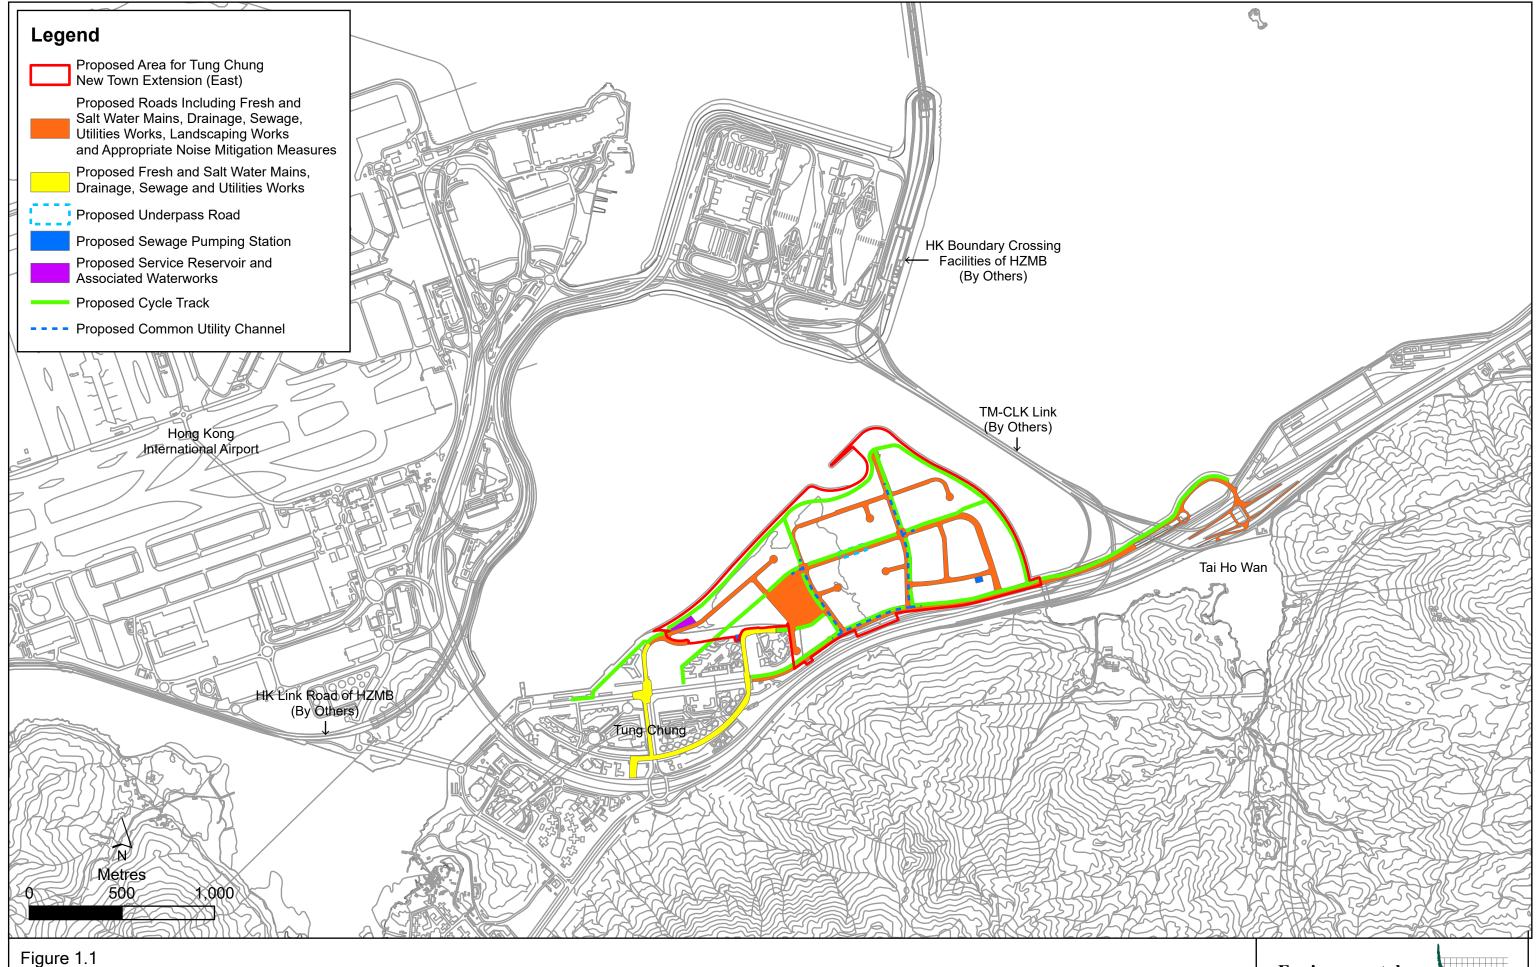

Location of the Tung Chung New Town Extensions (East) and its Associated Infrastructure Works

Environmental Resources Management



Table 1.2 Major Activities in the Reporting Period

Activities	Key Issues	Key Mitigation Measures
<ul> <li>Land-based Works</li> <li>Ground investigation works</li> <li>Land DCM works and jet grouting</li> <li>Placing of sorted public fill</li> <li>Installation of prefabricated vertical drains</li> <li>U-channel construction</li> </ul>	<ul> <li>Dust emission</li> <li>Handling and storage of C&amp;D materials generated from construction activities</li> <li>Noise from plant operation</li> <li>Emission of dark smoke from PMEs</li> <li>Efficiency of wastewater and drainage management</li> </ul>	<ul> <li>Good site practices</li> <li>Regular water spraying on stockpiles, unpaved haul road and land filling area</li> <li>Provide tarpaulin sheets coverage on stockpiles</li> <li>Sorting and reuse of C&amp;D materials as far as practicable</li> <li>Use of QPME and noise barrier/acoustic mat</li> <li>Regular maintenance of PMEs</li> <li>Implementation of wastewater and drainage management</li> </ul>
<ul> <li>Marine-based Works</li> <li>Laying of geotextile and sand blanket for reclamation works and DCM works</li> <li>Marine-based instruments monitoring works</li> <li>Placing of sorted public fill</li> <li>DCM works</li> <li>Seawall construction</li> </ul>	<ul> <li>Elevation in impact on Water Quality due to sediment loss from sand blanket laying and marine filling works</li> <li>Potential surface runoff</li> <li>Potential filling material drop from barges</li> <li>Disturbance to Chinese White Dolphin</li> <li>Noise from marine vessels and plant operation during normal working hours or restricted hours</li> <li>Dust emission during storage and transfer of sand/ sorted public fill</li> <li>Emission of dark smoke from marine vessel</li> </ul>	<ul> <li>Provision of perimeter silt curtain</li> <li>Provision of a leading seawall of at least 200m before marine filling works</li> <li>Regular cleaning of accumulated sand/fill materials at the edge of the barges</li> <li>Implementation of Dolphin Watching for the marine-based works</li> <li>Strictly follow requirement under CNP for the use of PMEs and works within restricted period</li> <li>Use of acoustic mat and other noise mitigation measures when necessary</li> <li>Regular maintenance of engines and mechanical equipment</li> </ul>

The environmental mitigation implementation schedule is presented in Annex B.

#### 1.5 SUMMARY OF EM&A PROGRAMME REQUIREMENTS

The status for all environmental aspects are presented in *Table 1.3*. The EM&A requirements remained unchanged during the reporting period.

Table 1.3 Summary of Status for the Environmental Aspects under the Updated EM&A Manual

Parameters	Status
Air Quality	
Baseline Monitoring	The results of baseline air quality monitoring for TCE were reported in Baseline Monitoring Report and submitted to EPD under EP Condition 3.4
Impact Monitoring	On-going for TCE, monitoring conducted three times every six days
<b>Noise</b> Baseline Monitoring	The results of baseline noise monitoring for TCE were reported in Baseline Monitoring Report and submitted to EPD under EP Condition 3.4
Impact Monitoring	On-going for TCE, monitoring conducted once per week
Impact Monitoring for Road Traffic Noise during Operational Phase	To be conducted during operational phase
Fixed Noise Commissioning Test	To be implemented by the Contractor before operation of TCNTE
<b>Water Quality</b> Baseline Monitoring	The results of baseline water quality monitoring for TCE were reported in Baseline Monitoring Report and submitted to EPD under EP Condition 3.4
Impact Monitoring	On-going for TCE, monitoring conducted three times per week
<b>Waste Management</b> Waste Monitoring	On-going
Land Contamination Contamination Assessment Plan (CAP), Remediation Action Plan (RAP) and Remediation Report (RR)	Pending environmental site investigation and lab testing works for TCW
<b>Ecology</b> Monitoring for Compensation Woodland	To be conducted when compensation woodland are planted
Monitoring for Emergent Plant inside the future River Park	To be conducted in the future River Park
Monitoring for Translocated Amphibians of Conservation Importance	To be conducted after translocation

Parameters	Status
Monitoring for Preserved/Transplanted Plant Species of Conservation Importance	To be conducted after preservation/ transplantation
Monitoring for Tung Chung Stream EIS and Wong Lung Hang EIS	To be conducted under TCW
Eco-shoreline Monitoring	To be conducted when eco-shoreline at TCE PDA and Road P1 is built
Tung Chung Bay and Tai Ho Wan Baseline Monitoring	The results of baseline soft shore ecological monitoring at Tung Chung Bay and Tai Ho Wan were reported in Baseline Monitoring Report and submitted to EPD under EP Condition 3.4
Tung Chung Bay and Tai Ho Wan Impact Monitoring	On-going for TCE, monitoring conducted quarterly
<b>Landscape and Visual</b> Baseline Monitoring	The results of baseline landscape and visual monitoring were reported in Baseline Monitoring Report and submitted to EPD under EP Condition 3.4
Site Environmental Audit Regular Site Inspection	On-going
Dolphin Watching Plan implementation measures	Under implementation by the Contractor
Works Vessel Travel Route Plan implementation measures	Under implementation by the Contractor
Silt Curtain Deployment Plan implementation measures	Under implementation by the Contractor
Spill Response Plan implementation measures	Under implementation by the Contractor
Waste Management Plan implementation measures	Under implementation by the Contractor
Complaint Hotline and Email Channel	Under implementation by the Contractor
Environmental Log Book	On-going On-going

Taking into account the construction works, impact monitoring of air quality, noise, water quality, soft shore ecological monitoring and waste management were carried out in the reporting period. The monitoring schedule of air quality, noise, water quality monitoring and soft shore ecological monitoring are provided in *Annex E2*, *Annex F2*, *Annex G2* and *Annex H1*, respectively.

The EM&A programme also involved environmental site inspections and related auditing conducted by the ET for checking the implementation of the required environmental mitigation measures recommended in the approved EIA Report and relevant EP submissions, including Dolphin Watching Plan,

Works Vessel Travel Route Plan, Silt Curtain Deployment Plan, Spill Response Plan and Waste Management Plan.

To promote the environmental awareness and enhance the environmental performance of the contractors, environmental trainings and regular environmental management meetings were conducted during the reporting period, which are summarized as below:

- One (1) environmental management committee meeting was held with the Contractor, ER, ET, IEC and CEDD on 18 March 2021; and
- Environmental toolbox trainings on Works Vessel Travel Route Plan, chemical handling, GPS/AIS system, light pollution, Construction Noise Permit, response to chemical spill, noise control and dust control on 3, 5, 8, 12, 17, 23, 24 and 31 March 2021.

## 1.6 STATUS OF STATUTORY ENVIRONMENTAL COMPLIANCE WITH THE ENVIRONMENTAL PERMIT

The status of statutory environmental compliance with the EP conditions under the EIAO, submission status under the EP and implementation status of mitigation measures are presented in *Annex C*.

#### 1.7 STATUS OF OTHER STATUTORY ENVIRONMENTAL REQUIREMENTS

The environmental licenses and permits, including environmental permit, waste discharge license, registration as chemical waste producer and construction noise permit, which were valid in the reporting period are presented in *Annex D*. No non-compliance with environmental statutory requirements was recorded.

#### 2 EM&A RESULTS FOR TUNG CHUNG EAST

The EM&A programme for the Project required environmental monitoring for air quality, noise, water quality and marine ecology as well as environmental site inspections for air quality, noise, water quality, waste management, marine ecology and landscape and visual impacts. The EM&A requirements and related findings for each component are summarized in the following sections.

#### 2.1 AIR QUALITY

#### 2.1.1 Monitoring Requirements and Equipment

According to the Updated EM&A Manual of the Project, impact air quality monitoring in terms of 1-hour Total Suspended Particulate (TSP) was conducted three (3) times every six (6) days when the highest dust impact was expected. The Action and Limit Levels of the air quality monitoring is provided in *Table 2.1* below.

Table 2.1 Action and Limit Levels for 1-hour TSP

Location	<b>Action Level,</b> μg/m <sup>3</sup>	Limit Level, μg/m <sup>3</sup>	
Monitoring station for Tung	279	500	
Chung East	279	300	

Portable direct reading dust meters were used to measure 1-hour TSP levels in undertaking the air quality monitoring for the Project. The proposed use of portable direct reading dust meters was submitted to IEC and obtained agreement from the IEC as stated in Section 5.5 of the Updated EM&A Manual. With the use of direct reading dust meter, it can allow prompt and direct results for the EM&A reporting and the implementation of the event and action plan. The portable direct reading dust meter would be calibrated every year against High Volume Sampler (HVS) to check the validity and accuracy of the results measured by direct reading method.

The monitoring location and equipment used in the impact air quality monitoring programme are summarized in *Table 2.2* and illustrated in *Figure 2.1*. Copies of the calibration certificates for the equipment are presented in *Annex E1*, which showed that the portable direct reading dust meter is capable of providing comparable results with that provided by a HVS.

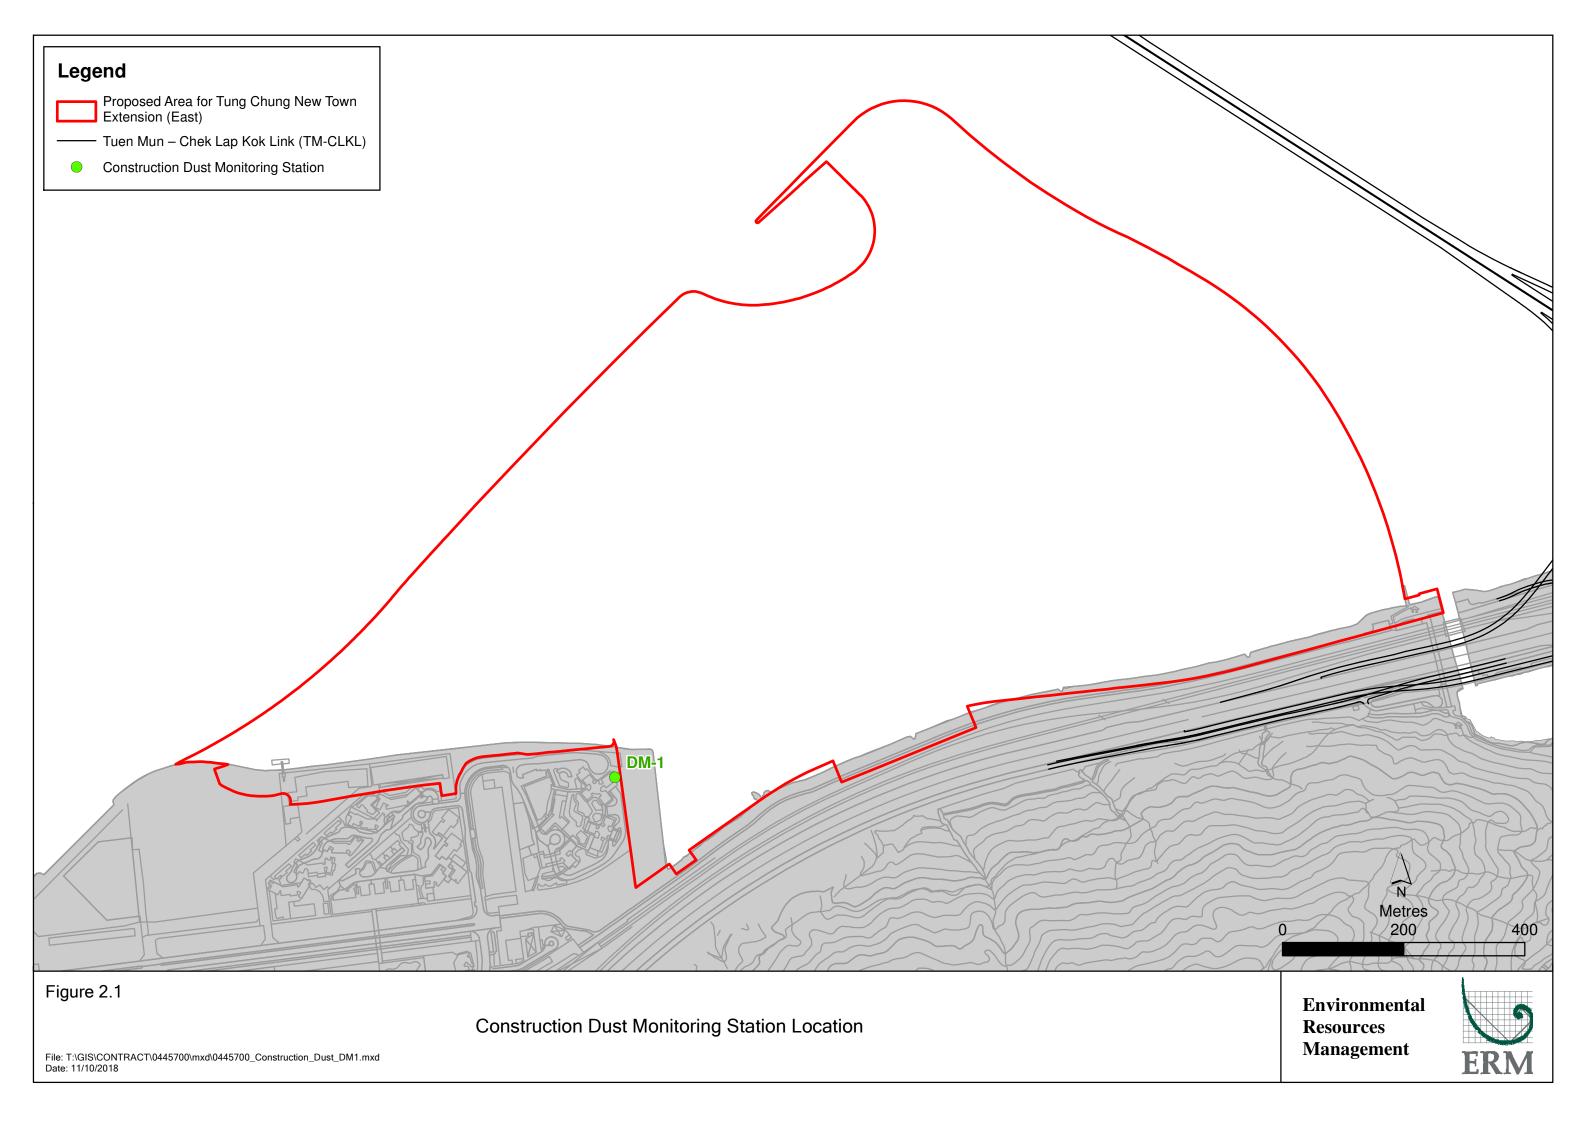


Table 2.2 Air Quality Monitoring Details

Monitoring Station	Location	Parameter	Frequency and Duration	Monitoring Dates	Equipment
DM-1	Tung Chung	1-hour TSP	Three times	1, 6, 12, 18, 24	1-hour TSP
	Area 56 -		per six days	and 30 March	Dust Meter
	Ying Tung		during the	2021	SIBATA LD-
	Estate		construction		3B (S/N:
			period of the		436553)
			Project		

#### Remark

It should be noted that impact monitoring at other construction dust monitoring locations at TCE as stated in the Updated EM&A Manual will commence after the flat intake (for Monitoring Stations DM-2, DM-3 and DM-4).

#### 2.1.2 Monitoring Schedule for the Reporting Month

The schedule for air quality monitoring during the reporting period is provided in *Annex E2*.

#### 2.1.3 Results and Observations

The monitoring results for 1-hour TSP are summarized in *Table 2.3*. The monitoring data and the graphical presentation are provided in *Annex E3*.

Table 2.3 Summary of 1-hour TSP Monitoring Results in the Reporting Period

Monitoring Station	Average (μg/m³)	Range (µg/m³)	Action Level (μg/m³)	Limit Level (μg/m³)
DM-1	49	26-66	279	500

The dust sources in the reporting period included haul road traffic, unloading of sand/fill material, filling works and operation of marine vessels under the Project.

No exceedance of Action and Limit Levels was recorded for construction air quality monitoring in the reporting period. No action was thus required to be undertaken in accordance with the Event and Action Plan presented in *Annex E4*.

#### 2.2 Noise Monitoring

#### 2.2.1 Monitoring Requirements and Equipment

According to the Updated EM&A Manual of the Project, impact noise monitoring was conducted once per week during the construction phase of the Project. The Action and Limit Level for construction noise of the Project is provided in *Table 2.4* below.

Table 2.4 Action and Limit Levels for Construction Noise

Time Period	Action Level	Limit Level
0700 - 1900 hours on normal	When one documented	75 AB(A) *
weekdays	complaint is received	75 dB(A) *

#### Notes:

Limit level is exceeded when  $L_{eq} \ge 75$  dB(A). If works are to be carried out during restricted hours, the conditions stipulated in the construction noise permit issued by the Noise Control Authority have to be followed.

Noise monitoring was performed using sound level meter at the designated monitoring stations NMS-CA-1A (1) (2) and NMS-CA-4 (*Figure 2.2; Table 2.5*) in accordance with the requirements stipulated in the Updated EM&A Manual. Acoustic calibrator was deployed to check the sound level meters at a known sound pressure level. Details of the deployed equipment are provided in *Table 2.5*. Copies of the calibration certificates for the equipment are presented in *Annex F1*.

<sup>\*</sup> Reduce to 70 dB (A) for schools and 65 dB (A) during school examination periods.

Impact monitoring at monitoring station NMS-CA-1A commenced on 19 September 2018 in view of the close vicinity of the construction works near the residential area at Century Link.

<sup>(2)</sup> Due to land handover issue, NMS-CA-1A was relocated to Ying Hong Road which is located 60m away from the original location. Proposal on the relocation of NMS-CA-1A was approved by IEC on 23 November 2018. Noise monitoring at the relocated location commenced since 24 November 2018.

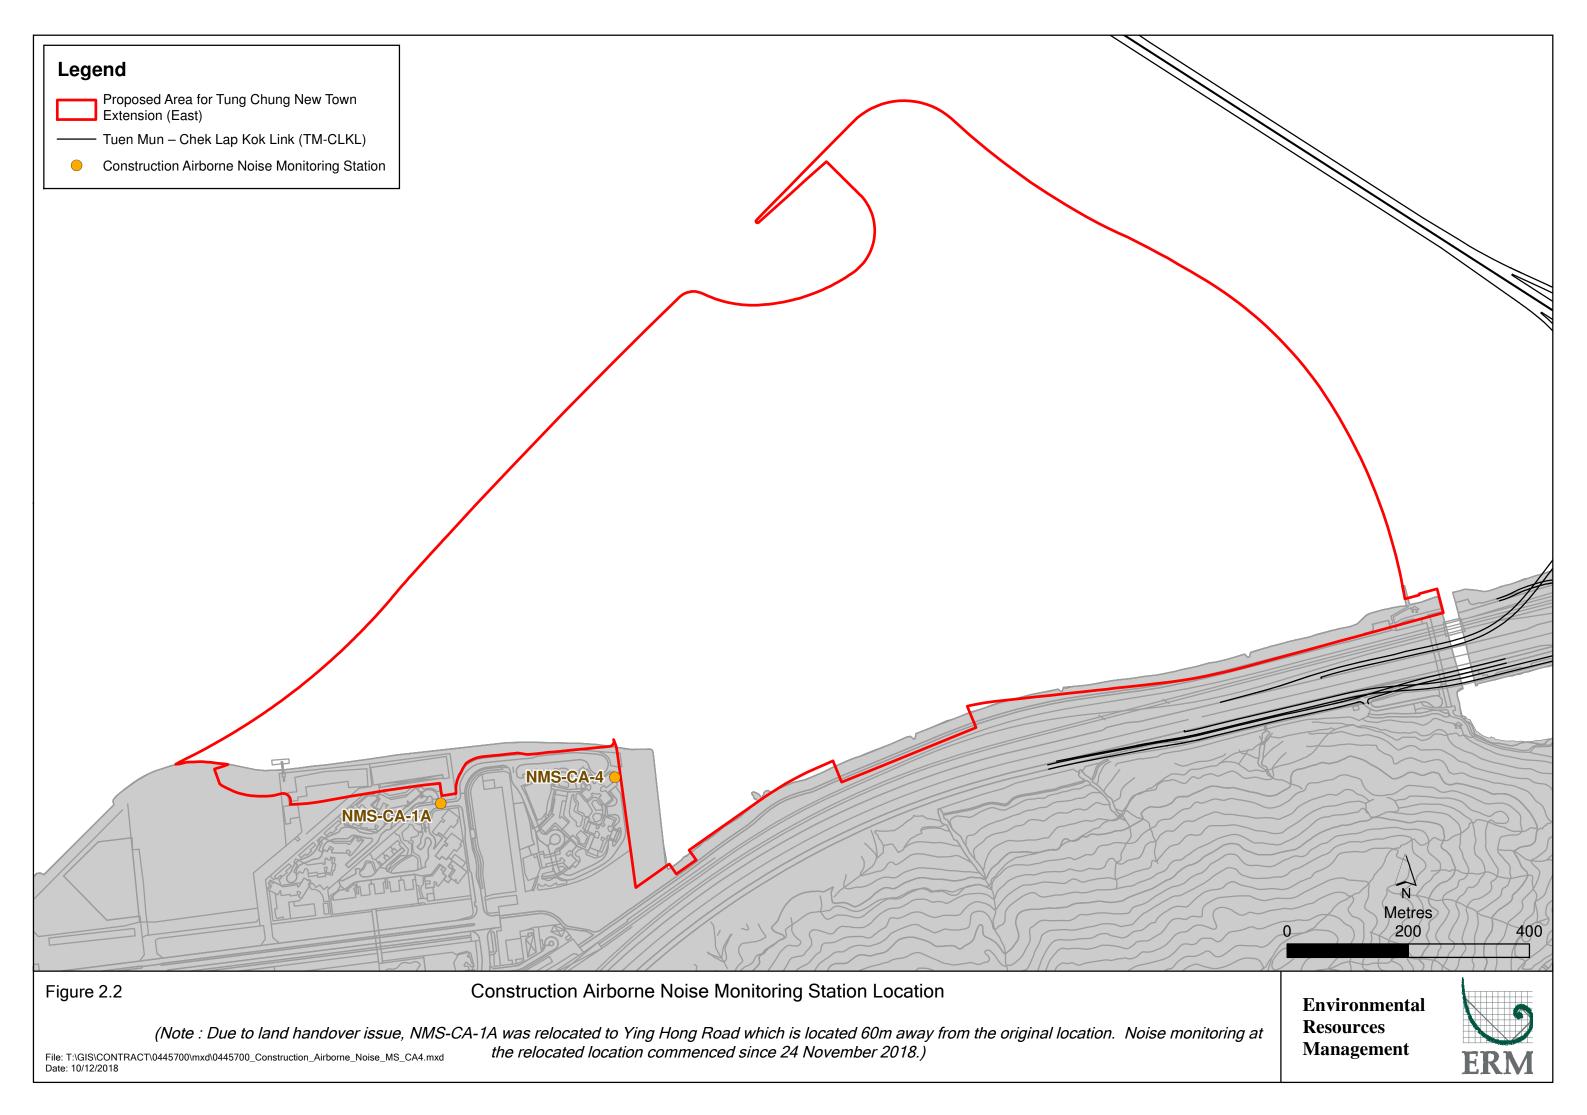


Table 2.5 Noise Monitoring Details

Station (a)	ocation	Parameter	Frequency and Duration	Monitoring Dates	Equipment
(b) pr Tu Ea Ce Lin Ho NMS-CA-4 Re pr rec are Tu Ea	ung Chung ast – entury ink/Ying fong Road (c) esidential	30-minute measurement between 0700 and 1900 on normal weekdays (Monday to Saturday). L <sub>eq</sub> , L <sub>10</sub> and L <sub>90</sub> would be recorded.	Once per week for 30 mins during the construction period of the Project	1, 6, 12, 18, 24 and 30 March 2021	Sound Level Meter: Rion NL-52 (S/N: 00643039) Acoustic Calibrator: LARSON DAVIS CAL200 (S/N: 16878)

#### Remarks:

- (a) It should be noted that impact monitoring at other construction noise monitoring locations at TCE as stated in the Updated EM&A Manual will commence after the flat intake of residential premise in TCE (for Monitoring Station NMS-CA-1) and operation of schools (for Monitoring Stations NMS-CA-2 and NMS-CA-3).
- (b) Impact monitoring at monitoring station NMS-CA-1A commenced on 19 September 2018 in view of the close vicinity of the construction works near the residential area at Century Link.
- (c) Due to land handover issue, NMS-CA-1A was relocated to Ying Hong Road which is located 60m away from the original location. Proposal on the relocation of NMS-CA-1A was approved by IEC on 23 November 2018. Noise monitoring at the relocated location commenced since 24 November 2018.

#### 2.2.2 Monitoring Schedule for the Reporting Month

The schedule for noise monitoring during the reporting period is provided in *Annex F2*.

#### 2.2.3 Results and Observations

Results for noise monitoring are summarized in *Table 2.6*. The monitoring data and the graphical presentation are provided in *Annex F3*.

Table 2.6 Summary of Construction Noise Monitoring Results in the Reporting Period

Monitoring Station	Average , dB(A), L <sub>eq (30mins)</sub>	Range, dB(A), L <sub>eq (30mins)</sub>	Limit Level, dB(A), L <sub>eq (30mins)</sub>
NMS-CA-1A	64.7	62.9-65.7	75
NMS-CA-4	67.1	62.4-70.7	75

Major noise sources during the noise monitoring included noise from barge and plant operation, DCM works, craning, haul road traffic, nearby traffic and aircraft as well as nearby construction sites.

No Limit Level exceedance was recorded for construction noise monitoring in the reporting period. However, five (5) Action Level were triggered from five (5) environmental complaints related to noise nuisance received in the reporting period. Investigations were conducted for the complaints in accordance with the Event and Action Plan (*Annex F4*) and the details were provided in Section 2.9.

#### 2.3 WATER QUALITY MONITORING

#### 2.3.1 Monitoring Requirements and Equipment

Impact water quality monitoring was carried out to ensure that any deterioration of water quality was detected, and that timely action was taken to rectify the situation. Impact water quality monitoring was undertaken three days per week since the commencement of marine works during the reporting period in accordance with the Updated EM&A Manual. Each impact water quality monitoring was scheduled such that the interval between two impact water quality monitoring was more than 36 hours to record representative water quality data throughout the week during the marine works.

Two (2) replicate *in-situ* measurements and samples were collected at each monitored water depth of each designated monitoring stations. Dissolved Oxygen (DO), pH value, salinity, temperature and turbidity were measured *in-situ* whereas the level of suspended solids (SS) were determined by ALS Technichem (HK) Pty Ltd which is a HOKLAS accredited laboratory.

The Action and Limit Levels of the water quality monitoring are provided in *Table 2.7*.

Table 2.7 Action and Limit Levels for Water Quality

Parameters	Action Level	Limit Level
DO in mg/L	Surface and Middle	Surface and Middle
(Surface, Middle & Bottom)	5.9 mg/L [1]	4 mg/L [1]
	Bottom 5.6 mg/L	Bottom 2 mg/L
SS in mg/L (Depth-averaged)	station at the same tide of the	23.5 mg/L or 130% of upstream control station at the same tide of the same day, whichever is higher. [2]

Parameters	Action Level	Limit Level
Turbidity in NTU (Depth-	17.1 NTU	23.5 NTU
averaged)	or	or
	120% of upstream control	130% of upstream control
	station at the same tide of the	station at the same tide of the
	same day, whichever is higher.	same day, whichever is higher.
	[2]	[2]

#### Notes:

- (1) For DO, non-compliance occurs when monitoring results is lower than the limits.
- (2) For SS and Turbidity, non-compliance occurs when monitoring results is larger than the limits

The locations of the monitoring stations under the Project are shown in *Figure* 2.3 and *Table* 2.8.


Table 2.8 Locations of Impact Water Quality Monitoring Stations and the Corresponding Monitoring Requirements

Monitoring Station	Description	Coor	dinates	Parameters (a)	Frequency	Monitoring Dates	Depth
		Easting	Northing				
TCE-WQM1	Near Airport Channel	811838	817341	Dissolved     Oxygen (DO)	Impact monitoring:	1, 3, 5, 8, 10, 12, 15, 17,	3 water depths: 1m
TCE-WQM2a	Marine Park 1	814439	819879	(mg/L and % saturation)	3 days per week, at	19, 22, 24, 26, 29 and	below sea surface, mid-
TCE-WQM2b	Marine Park 2	814439	821905	• Temperature (°C)	mid-flood and mid-ebb	31 March 2021	depth and 1m
TCE-WQM3A	Outlet of Tai Ho Wan	814705	817859	• Turbidity (NTU)	tides during the		above seabed. If
TCE-WQM4 TCE-C1	HKBCF Control Station - Outside Airport Channel	813344 804247	818849 815620	<ul> <li>Salinity (ppt)</li> <li>pH</li> <li>Water depth (m)</li> <li>Suspended Solid (SS)</li> <li>(mg/L)</li> </ul>	construction period of the Project		the water depth is less than 3m, mid-depth sampling only. If
TCE-C2	Control Station - Sunny Bay	819460	821473	(mg/L)			water depth less than 6m, mid-depth may be omitted

Notes:

(a) In addition to the abovementioned parameters, other relevant data shall also be recorded, including monitoring location / position, time, water depth, tidal stages, weather conditions and any special phenomena or work underway at the construction site.

*Table 2.9* summarizes the equipment used in the impact water quality monitoring works. Copies of the calibration certificates are attached in *Annex G1*.

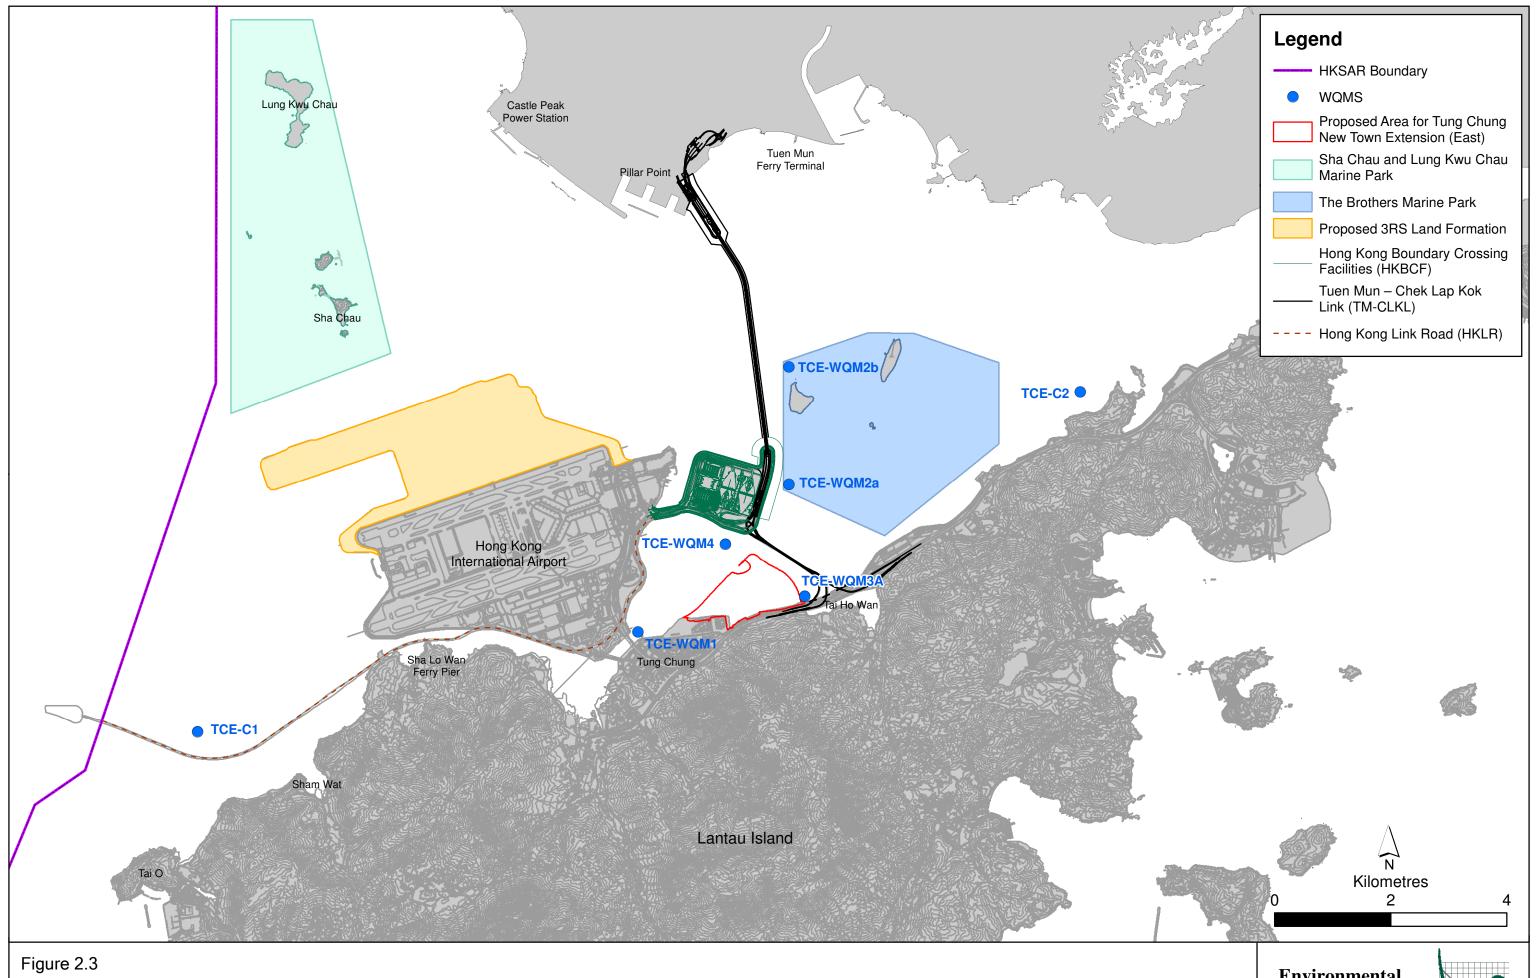

Water Quality Monitoring Locations

Environmental Resources Management



Table 2.9 Water Quality Monitoring Equipment

Equipment	Model
Water Sampler	Kahlsico Water Samplers
Multi-parameter Water	YSI ProDSS (S/N: 15M100005, 16H104233, 18A104824)
Quality System (measurement	YSI 6920 v2 (S/N: 0001C6A7)
of DO, Temperature,	
Turbidity, Salinity and pH)	

#### 2.3.2 Monitoring Schedule for the Reporting Month

The schedule for water quality monitoring during the reporting period was provided in *Annex G2*.

#### 2.3.3 Results and Observations

A total of 14 monitoring events for impact water quality monitoring were conducted at all designated monitoring stations during the reporting period. Impact water quality monitoring results and graphical presentations were provided in *Annex G3*.

Action and Limit level exceedances were recorded for water quality impact monitoring in the reporting period and the event and action plan (*Annex G4*) was undertaken. Investigations on the action and limit level exceedances were conducted and summarized in *Table 2.10* below.

Table 2.10 Details of Exceedances Recorded for Water Quality Monitoring

Date	Tide	Parameter	Station	Type	Justification
15 March 2021	ME	SS	TCE-WQM3A	Action	(a) (b)
	MF	SS	TCE-WQM2b	Action	(a) (b) (d)
17 March 22021	ME	SS	TCE-WQM3A	Limit	(a) (b)
22 March 2021	ME	DO (B)	TCE-WQM2a	Action	(c)

#### Remarks

- (a) The exceedance was not considered as caused by the construction of the Project due to areas of reclamation related marine works undertaken under the Project were surrounded by silt curtain which were inspected daily by the Contractor and inspected periodically by ER. The silt curtain nearby the water quality monitoring stations was observed to be in good condition/well-functioning.
- (b) The exceedance was not considered as caused by the construction of the Project due to no sediment plume was observed nearby the water quality monitoring station during the sampling in mid-ebb/mid-flood tide.
- (c) The exceedance was not considered as caused by the construction of the Project due to the station was located further away from the Project works area.
- (d) The exceedance was not considered as caused by the construction of the Project due to no marine construction activity under the Project was conducted near to the water quality monitoring station.

Based on the investigations conducted for each of the monitoring day with exceedances, the exceedances of DO and SS were not likely caused by the work activities related to the Project.

Nevertheless, the Contractor was reminded to implement all relevant mitigation measures for the marine works, including regular checking of silt curtain integrity, provide periodic maintenance and maintain good site practice. The ET will keep on checking monitoring data, plant, equipment and Contractor's working methods.

#### 2.4 SOFT SHORE ECOLOGICAL MONITORING

#### 2.4.1 Monitoring Requirements

According to the Updated EM&A Manual of the Project, impact soft shore ecological monitoring has to be conducted quarterly at each survey location at Tung Chung Bay (TCB) and Tai Ho Wan (THW) covering wet and dry seasons during the marine construction of the Project. The soft shore ecological monitoring consisted of qualitative walk-through surveys, quantitative transect surveys and sedimentation rate monitoring at the accessible survey locations of TCB and THW.

For qualitative walk-through surveys, the accessible shoreline of TCB and THW at each of the three shore heights: 2 m, 1.5 m and 1 m above Chart Datum was surveyed, and organisms encountered were recorded and their relative abundance noted. In particular, active search of horseshoe crabs and seagrasses were conducted to confirm whether these species are present along the sites.

For quantitative transect survey, one 50 – 100 m horizontal (belt) transect (actual length subject to the site conditions) was surveyed at each of the three shore heights: 2 m, 1.5 m and 1 m above Chart Datum of each survey location. On each transect, five quadrats (50 cm x 50 cm) were placed randomly in each transect to assess the abundance and distribution of flora and fauna. For each quadrat, surface layer to 5 cm depth was sieved and microbenthic organisms (e.g. crustaceans) were recorded and identified. Density of organisms was expressed as individuals / m². Areas with seagrass were also recorded and identified and other information, such as the percentage cover, were also recorded. Sessile animals such as barnacles and oysters in each quadrat were not counted but estimated as percentage cover on the rock surface. All species of algae (encrusting, foliose and filamentous) were also identified and recorded by estimating the percentage cover on the rock surface. All organisms were identified to the lowest possible taxonomic level (at least Genus level). Species encountered outside the quadrat but in the vicinity of survey transect were also recorded.

For sedimentation rate monitoring, to avoid disturbance to the mudflat and nuisance to navigation, no fixed marker/monitoring rod was installed at the monitoring stations. A high precision Global Navigation Satellite System

(GNSS) real time location fixing system was used to locate the station in the precision of 1 mm, which is reasonable under flat mudflat topography with uneven mudflat surface only at micro level.

Measurements were taken directly on the mudflat surface. The Real Time Kinematic GNSS (RTK GNSS) surveying technology was used to measure mudflat surface levels and 3D coordinates of a survey point. The RTK GNSS survey was calibrated against a reference station in the field before and after each survey. The reference station is a survey control point established by the Lands Department of the HKSAR Government using professional surveying instruments such as total station, level and geodetic global navigation satellite system. The coordinates system is in HK1980 GRID system. The reference station was surveyed and established by traditional land surveying methods using professional surveying instruments such as total station, level and geodetic GNSS. The accuracy was down to mm level and higher than the proposed RTK GNSS cm level so that the reference control station has relatively higher accuracy. As the reference control station has higher accuracy, it was set as true evaluation relative to the RTK GNSS measurement. All position and height correction were adjusted and corrected to the reference control station.

The precision of the measured mudflat surface level reading (vertical precision setting) was within 10 mm (standard deviation) after averaging the valid survey records of the XYZ HK1980 GRID coordinates. Each survey record at each station was computed by averaging at least three measurements that are within the above specified precision setting. Both digital data logging and written records were collected in the field. Field data on station fixing and mudflat surface measurement were recorded.

#### 2.4.2 Monitoring Schedule for the Reporting Month

The schedule for soft shore ecological monitoring during the reporting period is provided in *Annex H1*.

#### 2.4.3 Results and Observations

Impact soft shore ecological monitoring was conducted at three (3) monitoring locations at Tung Chung Bay (TCB), situated in the eastern side (TCB1), southern side (TCB2) and western side (TCB3) as well as one (1) monitoring location at Tai Ho Wan (THW) as shown in *Figure 2.4* during the reporting period. Representative photographs taken during the impact monitoring are presented in *Figure 2.5*.

For qualitative walk-through surveys, horseshoe crabs and intertidal soft shore communities were recorded during the impact monitoring. The survey results for each monitoring location are summarized in *Table 2.11* below and detailed in *Annex H2*.


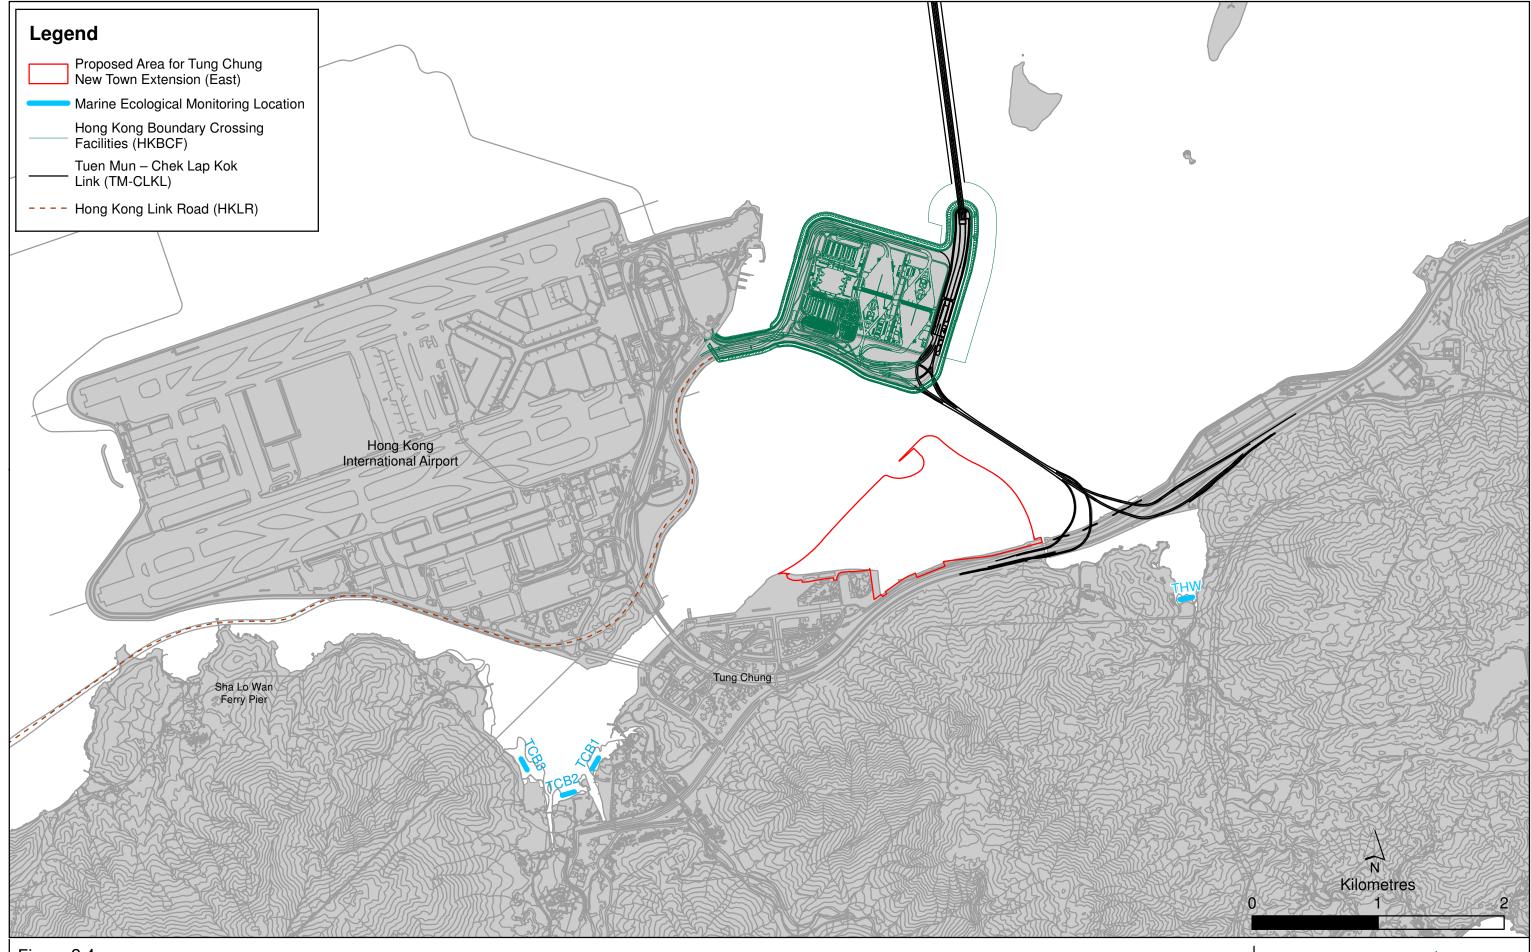


Figure 2.4

Marine Ecological Monitoring (Intertidal Soft-shore Habitats)

Environmental Resources Management




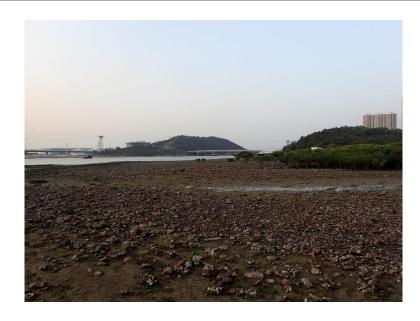

(a) Survey Location at TCB1



(b) Survey Location at TCB2

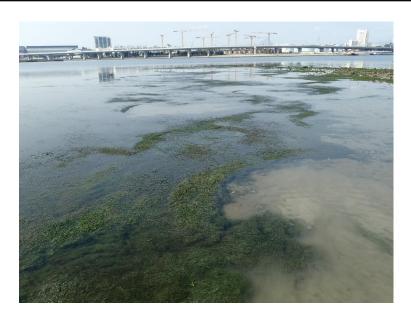

(c) Survey Location at TCB3 and algae *Enteromorpha* spp.



(d) Seagrass *Halophila ovalis* recorded *at TCB3* during the Qualitative Walk-through Survey



(e) Horseshoe crab *Tachypleus tridentatus* recorded at TCB3 during the Qualitative Walk-through Survey



(f) Horseshoe crab *Tachypleus tridentatus* recorded at THW during the Qualitative Walk-through Survey

Figure 2.5

Table 2.11 Summary of Qualitative Walk-through Surveys

		Horse	shoe Crabs	Sea	agrass	No. of Other
Location	Date and Time (1)	No. of Species	No. of Individuals	No. of Species	Area Coverage (m²)	Intertidal Species
TCB1	3/3/2021 15:30-18:00; 15/3/2021 14:00-17:00	0	0	0	0	51
TCB2	2/3/2021 15:00-18:00; 15/3/2021 16:45-17:45	0	0	0	0	52
TCB3	1/3/2021 14:00-17:45; 15/3/2021 14:30-16:30	1	5	1	65	45
TWH	16/3/2021 15:00-18:00	1	20	0	0	52

#### Note:

(1) For quantitative transect surveys, surveys were conducted on 3 and 15 March 2021 at TCB1, 2 March 2021 at TCB2, 1 March 2021 at TCB3 and 16 March 2021 at THW. For qualitative surveys, surveys were conducted on 15 March 2021 at TCB1, TCB2 and TCB3, and on 16 March 2021 at THW. Due to the high algae coverage at TCB2 with smaller searchable area compared to other sites, the qualitative survey of 2 hours per site was reduced to 1 hour.

For the quantitative transect surveys, a total of 4,045 individuals were recorded from all transects at monitoring stations TCB1, TCB2, TCB3 and THW. The most abundant group of intertidal soft shore communities recorded was gastropods, with a total of 3,937 individuals (relative abundance of 97.3% and density of 262.5 individual m<sup>-2</sup>). The summary of the top three dominant species at each shore height of each monitoring station and the complete list of species and density recorded are presented in *Annex H2*. When compared with the results obtained during the baseline monitoring as presented in the Baseline Monitoring Report <sup>(1)</sup>, there was no indication of a change in the composition of intertidal communities recorded during the reporting period.

The mudflat surface levels at the four selected monitoring stations in March 2021 and the corresponding XYZ HK1980 GRID coordinates are presented in *Table 2.12*. When compared with the results obtained during the baseline monitoring as presented in the Baseline Monitoring Report <sup>(1)</sup>, slight changes with <0.11 mPD of sediment levels are recorded for the monitoring stations. The ET will continue to observe the trend of change in sediment levels over time for further comparison and review.

 ERM (2018b). Baseline Monitoring Report for Tung Chung New Town Extension (East). Submitted to EPD under EP-519/2016

Table 2.12 Results of Sedimentation Rate Monitoring

Monitoring Station	Northing (m)	Easting (m)	Z level at March 2021 (mPD)	Remarks
TCB1	816068.723	811129.239	1.171	Soft mudflat
TCB2	815812.736	810917.377	1.103	Soft mudflat
TCB3	816027.422	810696.195	0.936	Soft mudflat
THW	817470.884	815849.908	1.029	Soft mudflat

Based on the impact monitoring results, there was no evidence showing any significant difference in intertidal communities when compared against the data obtained during baseline monitoring. No action is thus required to be undertaken in accordance with the Event and Action Plan presented in *Annex H3*. The ET will continue to observe the change in density or the distribution pattern of horseshoe crab, seagrass and intertidal soft shore communities taking into account natural fluctuation in respect of the occurrence and distribution pattern.

#### 2.5 EM&A SITE INSPECTION

Site inspections were carried out on a weekly basis with the Contractor and ER to monitor the implementation of proper environmental pollution control and mitigation measures for air quality, noise, water quality, waste management, marine ecology and landscape and visual impacts under the Project. In the reporting period, four (4) site inspections were carried out on 4, 11, 18 and 25 March 2021.

Key observations during the site inspections are summarized in *Table 2.13*.

Table 2.13 Key Observations Identified during the Site Inspection in this Reporting Month

<b>Inspection Date</b>	<b>Environmental Observations</b>	Recommendations/ Remarks
4 March 2021	<ul><li>DCM barge (LM2)</li><li>Construction noise permit on the barge was not updated.</li></ul>	and provide the latest version of the
11 March 2021	<ul> <li>Crane barge (Pacific 26)</li> <li>Oil spill and improper handling procedure of spill response were observed.</li> </ul>	construction noise permit on the barge.  Crane barge (Pacific 26)  The Contractor was urged to resolve the spill issue immediately and follow the correct handling procedure as according to the approved Spill Response Plan.
	<ul><li>Area B1 and B2</li><li>Dust was observed on site.</li></ul>	<ul><li>Area B1 and B2</li><li>The Contractor was reminded to arrange watering on the unpaved road.</li></ul>
18 March 2021	<ul> <li>DCM barge (DJ 9-1)</li> <li>Drip tray was not provided for chemical.</li> <li>Drip tray was not sealed and spillage was observed.</li> </ul>	<ul> <li>DCM barge (DJ 9-1)</li> <li>The Contractor was reminded to provide drip tray to chemicals.</li> <li>The Contractor was reminded to ensure drip trays are properly sealed and remove the spillage as according to the approved Spill Response Plan.</li> </ul>

Inspection Date	Environmental Observations	Recommendations/ Remarks		
25 March 2021	Tung Chung East Reclamation Area	Tung Chung East Reclamation Area		
	Defect on silt curtain was observed.	<ul> <li>The Contractor was reminded to provide maintenance and re-align/straighten the silt curtain as according to the alignment in the Silt Curtain Deployment Plan.</li> </ul>		
	Derrick barge (Kong Yeung 88)  • Drip tray was not provided for chemical.	Derrick barge (Kong Yeung 88)  The Contractor was reminded to place		
		chemicals on drip tray.		
	AIS and GPS on the marine vessel were not operating.	<ul> <li>The Contractor was reminded to install a functional AIS/GPS system and ensure it is operating on marine vessel.</li> </ul>		
	Area C1 and C2	Area C1 and C2		
	Dust was observed on site.	The Contractor was reminded to provide watering on unpaved area.		

The Contractor has rectified all of the observations identified during environmental site inspections in the reporting period. The Contractor was reminded to implement all relevant mitigation measures related to construction dust, construction noise, water quality and waste management outlined in the EIA Report and EM&A Manual.

#### 2.6 WASTE MANAGEMENT STATUS

The Contractor has registered as chemical waste producer under the Contract. Sufficient numbers of receptacles were available for general refuse collection and sorting.

All dump trucks engaged on site was equipped with RTTM system during the reporting period. The Surveillance Team of the ET conducted regular site inspection on the dump trucks and their track records. No illegal dumping and landfilling of C&D materials was found during the reporting period.

Wastes generated during this reporting period include mainly non-inert construction wastes, chemical waste and recyclable materials. The Project imports fill materials including mainly sand and public fill. In addition, the Project reuses inert construction materials from other projects which are not generated by the Project for reclamation activities i.e. imported fill (sand) for sand blanket. Reference has been made to the waste flow table prepared by the Contractor. The quantities of different types of wastes and imported fill materials are summarised in *Table 2.14*.

Table 2.14 Quantities of Different Waste Generated and Imported Fill Materials

Month / Year	Inert C&D Materials <sup>(a)</sup> (m³)	Imported Fill <sup>(d)</sup> (sand) (m <sup>3</sup> )	Imported Fill (d) (public fill) (m³)	Inert Construction Waste Re- used (m³)	Non-inert Construction Waste (b) (m³)	Recyclable Materials <sup>(c)</sup> (kg)	Chemical Wastes (kg)
1 to 31 Jan 21	0	183,796	154,392 (e)	0	119.0	263	0
1 to 28 Feb 21	0	30,399 (e)	118,783 <sup>(e)</sup>	0	128.0	228	1,400
1 to 31 Mar 21	26	10,636	162,924	0	233.0	663.0	5,600

#### Notes:

- (a) Inert construction wastes include hard rock and large broken concrete, and materials disposed as public fill.
- (b) Non-inert construction wastes include general refuse disposed at landfill.
- (c) Recyclable materials include metals, paper, cardboard, plastics and others.
- (d) Imported fill materials include sand and public fill.
- (e) Updated figure was presented.

#### 2.7 IMPLEMENTATION STATUS OF ENVIRONMENTAL MITIGATION MEASURES

A summary of the Environmental Mitigation Implementation Schedule is presented in *Annex B*. The necessary mitigation measures were implemented properly for the Project.

## 2.8 SUMMARY OF EXCEEDANCES OF THE ENVIRONMENTAL QUALITY PERFORMANCE LIMIT

The monitoring results for air quality monitoring (1-hour TSP) complied with the Action/ Limit levels in the reporting period. No Limit Level exceedance was recorded for construction noise monitoring in the reporting period. However, five (5) Action Level were triggered from five (5) environmental complaints related to noise nuisance received in the reporting period.

Action level and limit level exceedances were recorded for water quality impact monitoring in the reporting period. The investigations on the action level and limit level exceedances were conducted and the results were summarized in *Section 2.3.3*.

Cumulative statistics on exceedances is provided in *Annex I*.

## 2.9 SUMMARY OF COMPLAINTS, NOTIFICATION OF SUMMONS AND SUCCESSFUL PROSECUTIONS

There was no notification of summons or prosecution recorded in the reporting period.

Six (6) environmental complaints were received in the reporting period. Investigations were conducted for the environmental complaints in accordance with the complaint handling process as stated in the Complaint Management Plan. Environmental complaints in the reporting period are summarized below.

### Complaint(s) Investigation/Follow up action(s) Environmental complaint related to Based on the information provided by the noise was referred by the Islands DC Contractor, the noise generated was due to the Member, Mr. Sammy Tsui was worker hammering with hand held hammer for received on 14 March 2021 the works. Although the works fulfilled all the statutory requirement under the Noise Control Ordinance, noise generated during hammering would still cause disturbance to the nearby resident. In order to reduce noise generation by hammering, the Contractor will use plastic hammer to replace the original metal hammer. 2 Environmental complaint related to Based on the information provided by the construction dust and noise was Contractor and results of air quality monitoring referred by CEDD on 19 March 2021. and noise monitoring, no non-compliance was observed. Nevertheless, the Contractor would continue to monitor the environmental impact of the reclamation works to the public, review the effectiveness of the mitigation measures and introduce enhancement as appropriate in order to minimize the nuisance to the public. 3 Environmental complaint related to Based on the information provided by the barges frequently passing by the sea Contractor and results of air quality monitoring area near Seaview Crescent which and noise monitoring, no non-compliance was observed. However, vessel traveling or anchored caused air and noise disturbance was received by Contractor on 19 March at the coastal area near Seaview Crescent could cause adverse visual impact to the surrounding. 2021. Therefore, the Contractor would continue to review and enhance the working arrangement in order to minimize the number of construction vessel anchored near residential area. Environmental complaint related to Based on the information provided by the noise at night was referred by EPD Contractor and ER, only marine DCM drilling on 24 March 2021. work was conducted after 10:00pm which was

located far away. Therefore, the mentioned noise in this complaint case was not related to the Tung

Chung New Town Extension (East).

	Complaint(s)	Investigation/Follow up action(s)
5	Environmental complaint related to banging and knocking noise was referred by EPD on 30 March 2021.	Based on the information provided by the Contractor and ER, there was no non-compliance observed. Nevertheless, the Contractor will use plastic hammer to replace the original metal hammer to address the noise generation. In addition, toolbox training was provided by the Contractor to remind workers to handle materials/works during holiday period to minimize noise generation.
6	Environmental complaint related to dust and mud was referred by EPD on 30 March 2021.	Based on the information provided by the Contractor and ER, there was no non-compliance observed. The Contractor would continue to provide watering for all breaking works for dust suppression.

Statistics on complaints, notifications of summons, successful prosecutions are summarised in *Annex I*.

### 3 FUTURE KEY ISSUES

### 3.1 CONSTRUCTION PROGRAMME FOR THE COMING MONTH

Works to be undertaken in the next monitoring period of April 2021 are summarized in *Table 3.1* below, together with the key issues and the key mitigation measures:

Table 3.1 Major Activities for the Next Reporting Period

Activities	Key Issues	<b>Key Mitigation Measures</b>
<ul> <li>Land-based Works</li> <li>Ground investigation works</li> <li>Land DCM works and jet grouting</li> <li>Placing of sorted public fill</li> <li>Box culvert construction</li> <li>Installation of prefabricated vertical drains</li> <li>U-channel construction</li> </ul>	<ul> <li>Dust emission</li> <li>Handling and storage of C&amp;D materials generated from construction activities</li> <li>Noise from plant operation</li> <li>Emission of dark smoke from PMEs</li> <li>Efficiency of wastewater and drainage management</li> </ul>	<ul> <li>Good site practices</li> <li>Regular water spraying on stockpiles, unpaved haul road and land filling area</li> <li>Provide tarpaulin sheets coverage on stockpiles</li> <li>Sorting and reuse of C&amp;D materials as far as practicable</li> <li>Use of QPME and noise barrier/acoustic mat</li> <li>Regular maintenance of PMEs</li> <li>Implementation of wastewater and drainage management</li> </ul>
<ul> <li>Laying of geotextile and sand blanket for reclamation works and DCM works</li> <li>Marine-based instruments monitoring works</li> <li>Placing of sorted public fill</li> <li>DCM works</li> <li>Seawall construction</li> </ul>	<ul> <li>Elevation in impact on Water Quality due to sediment loss from sand blanket laying and marine filling works</li> <li>Potential surface runoff</li> <li>Potential filling material drop from barges</li> <li>Disturbance to Chinese White Dolphin</li> <li>Noise from marine vessels and plant operation during normal working hours or restricted hours</li> <li>Dust emission during storage and transfer of sand/ sorted public fill</li> <li>Emission of dark smoke from marine vessel</li> </ul>	<ul> <li>Provision of perimeter silt curtain</li> <li>Provision of a leading seawall of at least 200m before marine filling works</li> <li>Regular cleaning of accumulated sand/fill materials at the edge of the barges</li> <li>Implementation of Dolphin Watching for the marine-based works</li> <li>Strictly follow requirement under CNP for the use of PMEs and works within restricted period</li> <li>Use of acoustic mat and other noise mitigation measures when necessary</li> <li>Regular maintenance of engines and mechanical equipment</li> </ul>

The ET will keep track on the construction works to confirm compliance of environmental requirements and the proper implementation of all necessary mitigation measures. The ET will also recommend to the Contractor about the environmental toolbox topics on the abovementioned key issues for the next reporting period.

# 3.2 MONITORING SCHEDULE FOR THE COMING MONTH The tentative schedules for environmental monitoring in April 2021 are provided in *Annex J*.

### 4 CONCLUSION AND RECOMMENDATION

This EM&A Report presents the findings of the EM&A activities undertaken during the period from 1 to 31 March 2021 in accordance with the Updated EM&A Manual and the requirements of the Environmental Permit (*EP*-519/2016).

Air quality (1-hour TSP), noise, water quality (DO, turbidity and SS) and soft shore ecological monitoring were carried out in the reporting period.

The monitoring results for air quality monitoring (1-hour TSP) complied with the Action/ Limit levels in the reporting period.

No exceedance of Limit Levels was recorded for construction noise monitoring in the reporting period. However, five (5) Action Level were triggered from five (5) environmental complaints related to noise nuisance in the reporting period.

No Project-related Action/ Limit level exceedances were recorded for water quality after investigations.

Based on the monitoring results for soft shore ecological monitoring, there was no evidence showing any significant difference in intertidal communities when compared against the data obtained during baseline monitoring. The ET will continue to observe the change in density or the distribution pattern of horseshoe crab, seagrass and intertidal soft shore communities taking into account natural fluctuation in respect of the occurrence and distribution pattern.


Environmental site inspections were carried out during the reporting period. Recommendations on remedial actions were given to the Contractor for the deficiencies identified during the site inspections.

There was no notification of summons or prosecution recorded in the reporting period. Six (6) environmental complaints were received in the reporting period. Investigations were conducted for the environmental complaints in accordance with the complaint handling process as stated in the Complaint Management Plan.

The ET will keep track on the construction works to confirm compliance of environmental requirements and the proper implementation of all necessary mitigation measures.

# Annex A

# Project Organisation

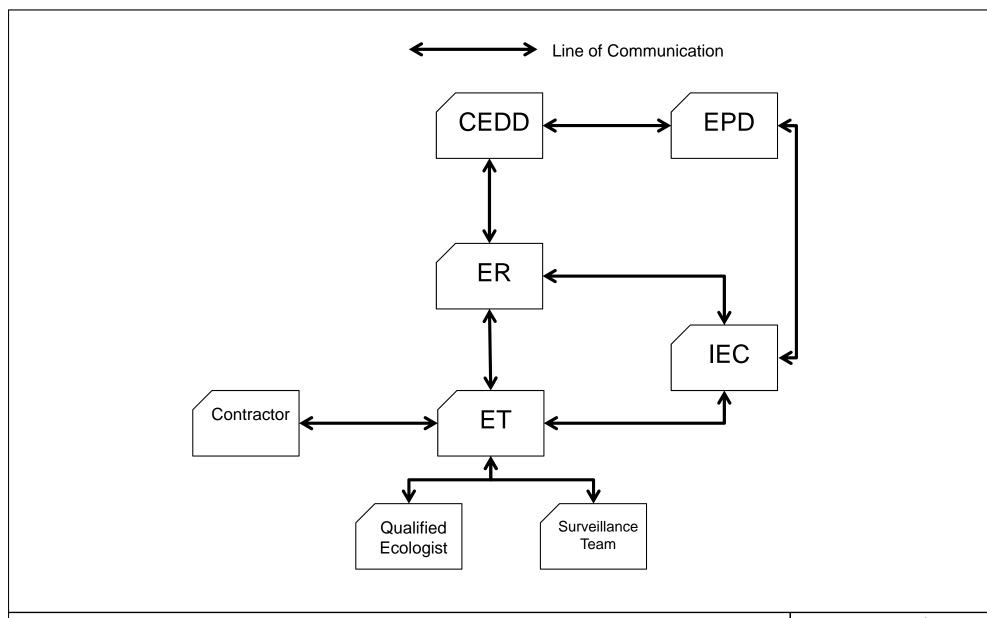

Annex A

Project Organization for Environmental Works

Environmental Resources Management



# Annex B

# Environmental Mitigation Implementation Schedule

Note: Chapters 1 to 2 of the EIA report present the background information of the Project, identified concurrent projects, objectives and scope for various environmental aspects, and description on alternative options and construction description. Chapters 3 to 12 of the EIA report present the EIA findings and mitigation measures are described below with cross-reference to the EIA report. Chapters 13 to 15 describe the environmental monitoring requirements, summary of environmental outcomes and conclusion.

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and / or standards to be achieved
Common	Mitigation	Measures (Applicable to ALL Project Components, including D	Ps and Non-DPs)				
Construc	tion Dust In	npact					
S3.4.6	D1	Water spraying every hour on exposed worksites and haul road.	Minimize dust impact at the nearby sensitive receivers	Contractor	All construction sites	Construction stage	APCO     To control the dust impact to meet HKAQO and TM-EIAO criteria
S3.4.6	D2	The contractor shall follow the procedures and requirements given in the Air Pollution Control (Construction Dust) Regulation	Minimize dust impact at the nearby sensitive receivers	Contractor	All construction sites	Construction stage	APCO     To control the dust impact to meet HKAQO and TM-EIAO criteria
S3.4.6	D3	The following dust suppression measures should be incorporated to control the dust nuisance throughout the construction phase:  • Any excavated or stockpile of dusty material should be covered entirely by impervious sheeting or sprayed with water to maintain the entire surface wet and then removed or backfilled or reinstated where practicable within 24 hours of the excavation or unloading;  • Any dusty materials remaining after a stockpile is removed should be wetted with water and cleared from the surface of roads;	Minimize dust impact at the nearby sensitive receivers	Contractor	All construction sites	Construction stage	APCO     To control the dust impact to meet HKAQO and TM-EIAO criteria

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and / or standards to be achieved
		• A stockpile of dusty material should not be extended beyond the pedestrian barriers, fencing or traffic cones;					
		• The load of dusty materials on a vehicle leaving a construction site should be covered entirely by impervious sheeting to ensure that the dusty materials do not leak from the vehicle;					
		<ul> <li>Where practicable, vehicle washing facilities with high pressure water jet should be provided at every discernible or designated vehicle exit point. The area where vehicle washing takes place and the road section between the washing facilities and the exit point should be paved with concrete, bituminous materials or hardcores;</li> </ul>					
		<ul> <li>When there are open excavation and reinstatement works, hoarding of not less than 2.4m high should be provided as far as practicable along the site boundary with provision for public crossing. Good site practice shall also be adopted by the Contractor to ensure the conditions of the hoardings are properly maintained throughout the construction period;</li> </ul>					
		• The portion of any road leading only to construction site that is within 30m of a vehicle entrance or exit should be kept clear of dusty materials;					
		• Surfaces where any pneumatic or power-driven drilling, cutting, polishing or other mechanical breaking operation takes place should be sprayed with water or a dust suppression chemical continuously;					
		<ul> <li>Any area that involves demolition activities should be sprayed with water or a dust suppression chemical immediately prior to, during and immediately after the activities so as to maintain the entire surface wet;</li> </ul>					
		• Where a scaffolding is erected around the perimeter of a building under construction, effective dust screens,					

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and / or standards to be achieved
		sheeting or netting should be provided to enclose the scaffolding from the ground floor level of the building, or a canopy should be provided from the first floor level up to the highest level of the scaffolding;					
		• Any skip hoist for material transport should be totally enclosed by impervious sheeting;					
		• Every stock of more than 20 bags of cement or dry pulverised fuel ash (PFA) should be covered entirely by impervious sheeting or placed in an area sheltered on the top and the 3 sides;					
		• Cement or dry PFA delivered in bulk should be stored in a closed silo fitted with an audible high level alarm which is interlocked with the material filling line and no overfilling is allowed;					
		• Loading, unloading, transfer, handling or storage of bulk cement or dry PFA should be carried out in a totally enclosed system or facility, and any vent or exhaust should be fitted with an effective fabric filter or equivalent air pollution control system; and					
		• Exposed earth should be properly treated by compaction, turfing, hydroseeding, vegetation planting or sealing with latex, vinyl, bitumen, shortcrete or other suitable surface stabiliser within six months after the last construction activity on the construction site or part of the construction site where the exposed earth lies.					
S3.4.6	D4	Implement regular dust monitoring under EM&A programme during the construction stage.	Monitoring of dust impact	Contractor	Selected dust monitoring stations	Construction stage	• TM-EIAO

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and / or standards to be achieved
Construc	ction Noise						
S4.3.4	NI	<ul> <li>Implement the following good site management practices:</li> <li>only well-maintained plant should be operated on-site and plant should be serviced regularly during the construction programme;</li> <li>machines and plant (such as trucks, cranes) that may be in intermittent use should be shut down between work periods or should be throttled down to a minimum;</li> <li>plant known to emit noise strongly in one direction, where possible, be orientated so that the noise is directed away from nearby NSRs;</li> <li>silencers or mufflers on construction equipment should be properly fitted and maintained during the construction works;</li> <li>mobile plant should be sited as far away from NSRs as possible and practicable;</li> <li>material stockpiles, site office and other structures should be effectively utilised, where practicable, to screen noise</li> </ul>	Control construction airborne noise	Contractor	All construction sites where practicable	Construction stage	• Annex 5, TM-EIAO
S4.3.4	N2	from on-site construction activities.  Use of quiet plant which should be made reference to the Powered Mechanical Equipment (PME) listed in the Technical Memorandum or the Quality Powered Mechanical Equipment (QPME) / other commonly used PME listed in Environmental Protection Department (EPD) web pages as far as possible which includes the Sound Power Level (SWLs) for specific quiet PME.	Reduce the noise levels of plant items	Contractor	All construction sites where practicable	Construction stage	• Annex 5, TM-EIAO
S4.3.4	N3	Install movable temporary noise barriers (typical design is wooden framed barrier with a small-cantilevered upper portion of superficial density no less than 7kg/m² on a skid	Screen the noisy plant items to be used at all	Contractor	All construction sites where	Construction stage	• Annex 5, TM- EIAO

EIA EM&A Ref. Log Ro	Racammandad Mittaatian Magairea	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and / or standards to be achieved
	footing with 25mm thick internal sound absorptive lining), and full enclosure, screen the noisy plants including air compressors, generators etc.	construction sites		practicable		
S4.3.4 N4	Implement a noise monitoring under EM&A programme.	Monitor the construction noise levels at the selected representative locations	Contractor	Selected noise monitoring stations	Construction stage	• TM-EIAO
Operational Noise	(Road Traffic Noise)					
S4.5.4 N5	Provide a series of noise mitigation measures including low noise surfacing material, noise barriers, facades with no openable window, school boundary walls and architectural fins before occupation of the protected NSRs. Locations of noise mitigation measures are stated as following:  Year 2023:  • Facade with no openable window at B1-1 and B1-2 for TCE; TCV-6 for TCW  • 1.5m long architectural fin at B1-1 and B1-2 for TCE  • Approx. 50m long, 4m high school boundary wall at possible school development near Tung Chung Area 39  • Approx. 120m long, 5m high vertical barrier with 3m cantilevered arm at 45° at the corner at junction between Chung Mun Road and Road L24  • Approx. 210m long LNRS along Chung Mun Road  • Approx. 160m long LNRS along Road L24  • Approx. 160m long LNRS along Road L30	from road traffic	Relevant government departments / Private developers	Refer to Figure 6.1, Figure 6.1a- b, Figure 6.2, Figures 6.2a-b, Figure 6.3, Figures 6.3a-d, Figure 6.4, and Figures 6.4a-e	of the Project for existing NSRs. While for mitigation measures to protect planned NSRs, it should be constructed before population intake	
	<ul> <li>Approx. 210m long LNRS along Chung Mun Road</li> <li>Approx. 160m long LNRS along Road L24</li> </ul>					

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and / or standards to be achieved
		D1-2, D2-3 and D2-4 for TCE; TCV-6 for TCW					
		• 1.5m long architectural fin at B1-1, B1-2 and D2-4 for TCE; TCV-1 for TCW					
		• Approx. 60m long, 5m high school boundary wall along Road L3					
		• Approx. 70m long, 5m high school boundary wall with 3m cantilevered arm at 45° along Road L3					
		• Approx. 50m long, 4m high school boundary wall at possible school development near Tung Chung Area 39					
		<ul> <li>Approx. 120m long, 5m high vertical barrier with 3m cantilevered arm at 45° at the corner at junction between Chung Mun Road and Road L24</li> </ul>					
		Approx. 210m long LNRS along Chung Mun Road					
		Approx. 160m long LNRS along Road L24					
		• Approx. 160m long LNRS along Road L30					
		Year 2027:					
		• Facade with no openable window at A1-1, A1-2, A2-1, A2-2, A2-3, A2-4, B1-1, B1-2, D1-1, D1-2, D2-3 and D2-4 for TCE; TCV-6 for TCW					
		• 1.5m long architectural fin at A2-1, A2-4, B1-1, B1-2 and D2-4 for TCE;					
		• 1.8m long architectural fin at A1-1, A1-2, A2-1 and A2-4					
		• Approx. 60m long, 5m high school boundary wall along Road L3					
		• Approx. 70m long, 5m high school boundary wall with 3m cantilevered arm at 45° along Road L3					
		• Approx. 50m long, 4m high school boundary wall at					

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and / or standards to be achieved
		possible school development near Tung Chung Area 39					
		<ul> <li>Approx. 120m long, 5m high vertical barrier with 3m cantilevered arm at 45° at the corner at junction between Chung Mun Road and Road L24</li> </ul>					
		Approx. 210m long LNRS along Chung Mun Road					
		• Approx. 160m long LNRS along Road L24					
		• Approx. 160m long LNRS along Road L30					
		Year 2045:					
		• Facade with no openable window at A1-1, A1-2, A2-1, A2-2, A2-3, A2-4, B1-1, B1-2, C1-1, C2-1, C2-2, D1-1, D1-2, D2-3, D2-4, E1-4 and E1-5 for TCE; TCV-1 and TCV-6 for TCW					
		• 1.5m long architectural fin at A2-1, A2-4, B1-1, B1-2, C1-1 and D2-4 for TCE; TCV-1 for TCW					
		• 1.8m long architectural fin at A1-1, A1-2, A2-1, A2-4 and C1-1					
		• Approx. 100m long, 5m high absorptive vertical barrier along Road D3					
		• Approx. 50m long, 5m high absorptive vertical barrier with 3m cantilevered arm at 45° along Road L7					
		• Approx. 60m long, 5m high school boundary wall along Road L3					
		• Approx. 70m long, 5m high school boundary wall with 3m cantilevered arm at 45° along Road L3					
		• Approx. 80m long, 4m high school boundary wall along Road L2					
		• Approx. 40m long, 3m high school boundary wall along Road L2					

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and / or standards to be achieved
		Approx. 50m long, 4m high school boundary wall at possible school development near Tung Chung Area 39					
		• Approx. 120m long, 5m high vertical barrier with 3m cantilevered arm at 45° at the corner at junction between Chung Mun Road and Road L24					
		Approx. 210m long LNRS along Chung Mun Road					
		Approx. 160m long LNRS along Road L24					
		Approx. 160m long LNRS along Road L30					
Operatio	nal Noise (I	Fixed Noise)					
S4.6.4	N6	For existing and planned NSRs which are located near to the proposed noise sources, the following tentative noise mitigation measures are considered:  • All the pumps should be enclosed inside building structures;  • Proper selection of quiet plant to reduce the tonality at NSRs;  • Installation of silencer / acoustic enclosure / acoustic louvers for the exhaust of ventilation system.  • For underground train stations, sound attenuators with sufficient attenuations can be installed to the ventilation shafts.  • Openings of ventilation system should be located away from NSRs.	Reduce operation fixed noise	Relevant government departments / Future Operator	All plant rooms where practicable	Prior to operation of the Project	Noise Control Ordinance and its TM, TM- EIAO
0	nal Noise (I	D. (1.37. to)					

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and / or standards to be achieved
S4.8.4	N7	<ul> <li>Facade with no openable windows for residential block at B1-2</li> <li>1.5m long architectural fin at B1-2</li> <li>Before Phase 3 is occupied:</li> <li>It should be noted that Railway Stations at TCE and TCW and its associated railway system is a Designated Project under Item A.2 of Schedule 2 of TM-EIAO. Hence, the proposed mitigation measures are tentative for cumulative assessment purpose in this EIA and all the mitigation measures will be revised by the railway operator during their Schedule 2 EIA.</li> <li>Approx. 325m long, semi enclosure along the tracks of Tung Chung Line facing B0-2 and COM-1</li> <li>Approx. 210m long, semi enclosure along the tracks of Tung Chung Line facing A1-2 and C1-1</li> <li>Approx. 390m long, semi enclosure along the track of Tung Chung Line to Tung Chung direction facing C1-1 to C2-1</li> <li>Approx. 630m long, semi enclosure along the track of Tung Chung Line to Hong Kong direction facing C1-1 and C2-1</li> </ul>	Reduce operation rail noise	government	Refer to Figure 6.1, Figure 6.1a-b, Figure 6.2, Figures 6.2a-b, Figures 6.3a-d, Figure 6.4, and Figures 6.4a-e	population intake	Noise Control Ordinance and its TM, TM- EIAO

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and / or standards to be achieved
Water Q	uality (Const	ruction Phase)					
S5.4.3	W1	<ul> <li>General Construction Activities</li> <li>In accordance with the Practice Note for Professional Persons on Construction Site Drainage, Environmental Protection Department, 1994 (ProPECC PNI/94), best management practices should be implemented on site as far as practicable. The best practices are detailed below:</li> <li>At the start of site establishment, perimeter cut-off drains to direct off-site water around the site should be constructed with internal drainage works. Channels, earth bunds or sand bag barriers should be provided on site to direct stormwater to silt removal facilities.;</li> <li>Diversion of natural stormwater should be provided as far as possible. The design of temporary on-site drainage should prevent runoff going through site surface, construction machinery and equipment in order to avoid or minimize polluted runoff. Sedimentation tanks with sufficient capacity, constructed from pre-formed individual cells of approximately 6 to 8 m3 capacities, are recommended as a general mitigation measure which can be used for settling surface runoff prior to disposal. The system capacity shall be flexible and able to handle multiple inputs from a variety of sources and suited to applications where the influent is pumped;</li> <li>The dikes or embankments for flood protection should be implemented around the boundaries of earthwork areas. Temporary ditches should be provided to facilitate the runoff discharge into an appropriate watercourse, through a silt/sediment trap. The silt/sediment traps should be incorporated in the permanent drainage channels to enhance deposition rates;</li> </ul>	To minimize water quality impact from construction site runoff and general construction activities	Contractor	All construction sites where applicable	Construction stage	Water Pollution Control Ordinance     ProPECC PN1/94     TM-EIAO     TM-DSS
		• The design of efficient silt removal facilities should be					

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and / or standards to be achieved
		based on the guidelines in Appendix A1 of ProPECC PN 1/94. The detailed design of the sand/silt traps should be undertaken by the contractor prior to the commencement of construction;					
		Construction works should be programmed to minimize surface excavation works during the rainy seasons (April to September). All exposed earth areas should be completed and vegetated as soon as possible after earthworks have been completed. If excavation of soil cannot be avoided during the rainy season, or at any time of year when rainstorms are likely, exposed slope surfaces should be covered by tarpaulin or other means;					
		All drainage facilities and erosion and sediment control structures should be regularly inspected and maintained to ensure proper and efficient operation at all times and particularly following rainstorms. Deposited silt and grit should be removed regularly and disposed of by spreading evenly over stable, vegetated areas;					
		If the excavation of trenches in wet periods is necessary, it should be dug and backfilled in short sections wherever practicable. Water pumped out from trenches or foundation excavations should be discharged into storm drains via silt removal facilities;					
		All open stockpiles of construction materials (for example, aggregates, sand and fill material) should be covered with tarpaulin or similar fabric during rainstorms. Measures should be taken to prevent the washing away of construction materials, soil, silt or debris into any drainage system;					
		Manholes (including newly constructed ones) should always be adequately covered and temporarily sealed so as to prevent silt, construction materials or debris being washed into the drainage system and storm runoff being					

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and / or standards to be achieved
		directed into foul sewers;					
		Precautions to be taken at any time of year when rainstorms are likely, actions to be taken when a rainstorm is imminent or forecasted, and actions to be taken during or after rainstorms are summarized in Appendix A2 of ProPECC PN 1/94. Particular attention should be paid to the control of silty surface runoff during storm events;					
		<ul> <li>All vehicles and plant should be cleaned before leaving a construction site to ensure no earth, mud, debris and the like is deposited by them on roads. An adequately designed and sited wheel washing facilities should be provided at every construction site exit where practicable. Wash-water should have sand and silt settled out and removed at least on a weekly basis to ensure the continued efficiency of the process. The section of access road leading to, and exiting from, the wheel-wash bay to the public road should be paved with sufficient backfall toward the wheel-wash bay to prevent vehicle tracking of soil and silty water to public roads and drains;</li> </ul>					
		Oil interceptors should be provided in the drainage system downstream of any oil/fuel pollution sources. The oil interceptors should be emptied and cleaned regularly to prevent the release of oil and grease into the storm water drainage system after accidental spillage. A bypass should be provided for the oil interceptors to prevent flushing during heavy rain;					
		Construction solid waste, debris and rubbish on site should be collected, handled and disposed of properly to avoid water quality impacts;					
		All fuel tanks and storage areas should be provided with locks and sited on sealed areas, within bunds of a capacity equal to 110% of the storage capacity of the largest tank to prevent spilled fuel oils from reaching water sensitive.					

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and / or standards to be achieved
		<ul> <li>Regular environmental audit on the construction site should be carried out in order to prevent any malpractices.         Notices should be posted at conspicuous locations to remind the workers not to discharge any sewage or wastewater into the water bodies, mangroves and open sea.     </li> </ul>					
S5.4.3	W2	<ul> <li>Sewage from workforce</li> <li>Portable chemical toilets and sewage holding tanks are recommended for handling the construction sewage generated by the workforce. A licensed contractor should be employed to provide appropriate and adequate portable toilets and be responsible for appropriate disposal and maintenance;</li> <li>Notices should be posted at conspicuous locations to remind the workers not to discharge any sewage or wastewater into the nearby environment during the construction phase of the Project;</li> <li>Regular environmental audit on the construction site should be conducted in order to provide an effective control of any malpractices and achieve continual improvement of environmental performance on site.</li> </ul>	To minimize water quality from sewage effluent in construction phase	Contractor	All construction sites where practicable	Construction stage	Water Pollution Control Ordinance     TM-DSS
S5.4.3	W3	Construction Works and Bridge Works near Tung Chung Stream  • Use precast structures or other similar approaches	To prevent any construction works in river and avoid any direct water quality impact to Tung Chung Stream	Contractor	All construction sites where practicable	Construction stage	• ProPECC PN1/94
S5.4.3	W4	<ul> <li>Construction Works of Sewage Pumping Stations</li> <li>A buffer zone of about 20m or about 30m will be zoned to</li> </ul>	To avoid any direct water quality impact to Tung Chung Stream		All construction sites where	Construction stage	• ProPECC PN1/94

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and / or standards to be achieved
		prevent any construction works near river.			practicable		
S5.4.3	W5	<ul> <li>Construction Work of Fresh Water and Salt Water Reservoirs</li> <li>Good site management as stipulated in ProPECC PN1/94 will be fully implemented to avoid polluted liquid or solid wastes from falling into the river waters or drainage.</li> </ul>	To avoid water quality impact	Contractor	All construction sites where practicable	Construction stage	• ProPECC PN1/94
S5.4.3	W6	<ul> <li>Construction of Storm Water Management Facilities and Polder Scheme</li> <li>Good site management as stipulated in ProPECC PN1/94 will be fully implemented to avoid polluted liquid or solid wastes from falling into the river waters or drainage.</li> </ul>	To avoid any direct water quality impact to Tung Chung Stream		All construction sites where practicable	Construction stage	• ProPECC PN1/94
S5.4.3	W7	Groundwater and Runoff for Tunnel Works  • Cut-and-Cover method for the underpass at Road D1 in Tung Chung East to minimise the intrusion of groundwater. Good site management as stipulated in ProPECC PN1/94 will be fully implemented to avoid polluted liquid or solid wastes from falling into the river waters or drainage.	To avoid water quality impact	Contractor	All construction sites where practicable	Construction stage	• ProPECC PN1/94
S5.5.8	W8	<ul> <li>Good Management Practice in Construction Phase</li> <li>The following good site management practices shall be adopted for the filling works:</li> <li>Water quality monitoring shall be implemented to ensure effective control of water pollution and recommend additional mitigation measures required;</li> <li>The decent speed of grabs shall be controlled to minimize the seabed impact and to reduce the volume of overdredging;</li> <li>A perimeter silt curtain shall be installed during the entire</li> </ul>	To avoid water quality impact	Contractor	All construction sites where practicable	Construction stage	• ProPECC PN1/94

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and / or standards to be achieved
		reclamation periods;					
		Barges or hoppers shall not be filled to a level which will cause overflow of materials or pollution of water during loading or transportation;					
		Excess materials shall be cleaned from the decks and exposed fittings of barges before the vessels are moved;					
		Plants should not be operated with leaking pipes and any pipe leakages shall be repaired quickly;					
		Adequate freeboard shall be maintained on barges to reduce the likelihood of decks being washed by wave action;					
		<ul> <li>All vessels should be sized so that adequate clearance is maintained between vessels and the seabed in all tide conditions, to ensure that undue turbidity is not generated by turbulence from vessel movement or propeller wash; and</li> </ul>					
		• The works shall not cause foam, oil, grease, litter or other objectionable matter to be present in the water within and adjacent to the works site.					
S5.5.8	W9	The recovered C&D materials for filling would be ensured no floating or non-inert material by visual inspection, quality assurance, etc.	To avoid water quality impact	Contractor	All construction sites where practicable	Construction stage	• Waste Disposal Ordinance

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and / or standards to be achieved
Water Qu	ality (Opera	tional Phase)					
S5.6.10	W10	<ul> <li>The following mitigation measures will be implemented to TCV East, North and West SPS, upgraded CMRSPS, proposed TCE West SPS and TCE East SPS</li> <li>100% standby pump capacity with spare pump of 50% pump capacity</li> <li>Dual-feed power supply</li> <li>Wet well storage providing up to 6-hours ADWF capacity (equivalent to about 4 hours of response time during peak flow condition); and</li> <li>Emergency communication mechanism amongst relevant government departments.</li> </ul>	To prevent the impact due to the emergency discharge at TCW and TCE	DSD	Proposed Sewage Pumping Station at TCW and TCE	Operational Stage	• DSD's Sewerage Manual
S5.6.10	W11	<ul> <li>The following mitigation measures will be implemented to gravity sewers and rising mains</li> <li>Adopt high density polyethylene (HDPE) pipe for proposed gravity sewers and rising mains.</li> <li>Further protection on proposed rising mains with concrete surround will be provided to mitigate the risk of bursting.</li> </ul>	To minimize the risk of bursting and hence bursting discharge from gravity sewers and rising mains	DSD	Proposed rising mains within TCE and TCW	Operational Stage	-
S5.6.10	W12	Maintenance Dredging for the Proposed Marina  Silt curtain should be deployed to reduce the sediment dispersion from the dredging inside the marina.	To reduce the sediment dispersion	Future operator	Proposed marina at TCE	Operational Stage	-

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and / or standards to be achieved
Sewage d	and Sewerag	e Treatment Implications					
S6.5.4	SS1	<ul> <li>Emergency Discharge of Proposed TCV West SPS, TCV East SPS, TCV North SPS and Upgraded CMRSPS</li> <li>The following mitigation measures will be implemented to TCV East, North and West SPS, and upgraded CMRSPS:         <ul> <li>100% standby pumping capacity within each SPS, with spare pump up to 50% pumping capacity stockpiled in each SPS for any emergency use</li> </ul> </li> <li>Twin rising mains</li> <li>Dual-feed power supply</li> <li>Emergency storage facilities up to 6-hours ADWF capacity; and</li> <li>Emergency communication mechanism amongst relevant government departments.</li> </ul>	To prevent the impact due to the emergency discharge at TCW	DSD	Proposed Sewage Pumping Station at TCW	Operational stage	N/A
S6.5.4	SS2	<ul> <li>Emergency Discharge of Proposed TCE West SPS and TCE         East SPS     </li> <li>In order to minimize the impact due to the emergency discharge, the following precautionary measures shall be included in the design of sewage pumping station:         <ul> <li>100% standby pumping capacity within each SPS, with spare pump up to 50% pumping capacity stockpiled in each SPS for any emergency use</li> <li>Twin rising mains</li> <li>Dual-feed power supply</li> <li>Emergency storage facilities up to 6-hours ADWF capacity; and</li> </ul> </li> <li>Emergency communication mechanism amongst relevant</li> </ul>	To minimize the impact due to the emergency discharge at TCE	DSD	Proposed Sewage Pumping Station at TCE	Operational stage	N/A

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation	Location / Timing	Implementation Stage	Requirements and / or standards to be achieved
		government departments.					
S6.5.4	SS3	The following mitigation measures will be implemented to prevent pipe bursting on Rising Mains within TCE and TCW:  • Strong pipe – use HDPE pipe with welded joints  • Concrete encasement – concrete surround all rising mains	To minimize the risk of bursting and hence bursting discharge from gravity sewers and rising mains		Proposed rising mains within TCE and TCW		N/A

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and / or standards to be achieved
Waste Mo	anagement (	Construction Waste)					
S7.4.1	WM1	<ul> <li>Good Site Practices</li> <li>The following good site practices are recommended throughout the construction activities:</li> <li>nomination of an approved personnel, such as a site manager, to be responsible for the implementation of good site practices, arrangements for collection and effective disposal to an appropriate facility, of all wastes generated at the site;</li> <li>training of site personnel in site cleanliness, appropriate waste management procedures and concepts of waste reduction, reuse and recycling;</li> <li>provision of sufficient waste disposal points and regular collection for disposal;</li> <li>imposition of penalty system on Contractors' improper behaviours when illegal dumping and landfilling outside their respective construction sites, i.e. on nearby farmlands and riverbanks, are reported;</li> <li>appropriate measures to minimise windblown litter and dust during transportation of waste by either covering trucks or by transporting wastes in enclosed containers;</li> <li>regular cleaning and maintenance programme for drainage systems, sumps and oil interceptors; and</li> <li>the contractor should prepare a Waste Management Plan (WMP) as part of the Environmental Management Plan (EMP) in accordance with the ETWB TC(W) No. 19/2005 for construction phase. The EMP should be submitted to the Engineer for approval. Mitigation measures proposed in the EIA Report and the EM&amp;A</li> </ul>	Minimize generation during construction	Contractor	All construction sites	Construction stage	• Waste Disposal Ordinance

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and / or standards to be achieved
S7.4.1	WM2	<ul> <li>Waste Reduction Measures</li> <li>Waste reduction is best achieved at the planning and design phase, as well as by ensuring the implementation of good site practices. The following recommendations are proposed to achieve reduction:</li> <li>segregate and store different types of waste in different containers, skip or stockpiles to enhance reuse or recycling of materials and their proper disposal;</li> <li>proper storage and site practices to minimize the potential for damage and contamination of construction materials;</li> <li>plan and stock construction materials carefully to minimize amount of waste generated and avoid unnecessary generation of waste;</li> <li>sort out demolition debris and excavated materials from demolition works to recover reusable/recyclable portions (i.e. soil, broken concrete, metal etc.);</li> <li>provide training to workers on the importance of appropriate waste management procedures, including waste reduction, reuse and recycling.</li> </ul>	Reduce waste generation	Contractor	All construction sites	Construction stage	• Waste Disposal Ordinance
S7.4.1	WM3	<ul> <li>Storage of Waste</li> <li>The following recommendation should be implemented to minimize the impacts:</li> <li>waste such as soil should be handled and stored well to ensure secure containment; and</li> <li>Depends on actual site activities, certain locations within the site area would be used for storage of waste to enhance reuse. However, there would not be any designated location for storage of waste, and the storage locations would need to be adjusted to suite actual site conditions;</li> </ul>	Good site practice to minimize the waste generation and recycle the C&D materials as far as practicable so as to reduce the amount for final disposal		All construction sites	Construction stage	<ul> <li>Land         (Miscellaneous         Provisions)         Ordinance</li> <li>Waste Disposal         Ordinance</li> <li>ETWB TCW         No. 19/2005</li> </ul>

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and / or standards to be achieved
S7.4.1	WM4	Collection and Transportation of Waste  The following recommendation should be implemented to minimize the impacts:  • remove waste in timely manner;  • employ the trucks with cover or enclosed containers for waste transportation;  • obtain relevant waste disposal permits from the appropriate authorities; and  • disposal of waste should be done at licensed waste disposal facilities.	Minimize waste impacts from storage	Contractor	All construction sites	Construction stage	Waste Disposal Ordinance
S7.4.1	WM5	<ul> <li>Excavated and C&amp;D Materials</li> <li>Wherever practicable, C&amp;D materials should be segregated from other wastes to avoid contamination and ensure acceptability at public fill reception facilities or reclamation sites. The following mitigation measures should be implemented in handling the excavated and C&amp;D materials:         <ul> <li>maintain temporary stockpiles and reuse excavated fill material for backfilling;</li> <li>carry out on-site sorting;</li> <li>make provisions in the Contract documents to allow and promote the use of recycled aggregates where appropriate; and</li> <li>implement a trip-ticket system for each works contract to ensure that the disposal of C&amp;D materials are properly documented and verified, so as to avoid the illegal dumping and landfilling of C&amp;D materials on farmlands/ riverbanks at TCW;</li> </ul> </li> <li>The recommended C&amp;D materials handling should include:</li> </ul>	Minimize waste impacts from excavated and C&D materials	Contractor	All construction sites	Construction Stage	<ul> <li>Land         (Miscellaneous         Provisions)         Ordinance</li> <li>Waste Disposal         Ordinance</li> <li>ETWB TCW         No. 19/2005</li> <li>Project         Administrative         Handbook for         Civil         Engineering         Works, 2012         Edition</li> </ul>

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and / or standards to be achieved
		On-site sorting of C&D materials					
		Reuse of C&D materials					
		Use of Standard Formwork and Planning of Construction Materials purchasing					
S7.4.1	WM6	Provision of Wheel Wash Facilities  Wheel wash facilities have to be provided at the site entrance before the trucks leaving the works area. Dust disturbance due to the trucks transportation to the public road network could be minimized by such arrangement.	Minimize waste impacts from trucks transportation	Contractor	All construction sites	Construction Stage	N/A
\$7.4.1	WM7	Excavated Contaminated Soil  As a precaution, it is recommended that standard good site practice should be implemented during the construction phase to minimize any potential exposure to contaminated soils or groundwater.	Remediate contaminated soil	Contractor	All construction sites where applicable	Construction stage	<ul> <li>Practice Guide for Investigation and Remediation of Contaminated Land</li> </ul>
S7.4.1	WM8	<ul> <li>Excavated Marine Sediments</li> <li>Reference has been made to the sediment testing results.</li> <li>Possible mitigation measures to handle the contaminated/uncontaminated sediment are summarized as follows.</li> <li>All construction plant and equipment shall be designed and maintained to minimise the risk of silt, sediments, contaminants or other pollutants being released into the water column or deposited in the locations other than designated location.</li> <li>All vessels shall be sized such that adequate draft is maintained between vessels and the sea bed at all states of the tide to ensure that undue turbidity is not generated by turbulence from vessel movement or propeller wash.</li> <li>Adequate freeboard shall be maintained on barges to</li> </ul>	Handle excavated sediment	Contractor	All construction sites where applicable	Construction stage	• ETWB-TCW 34/2002

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and / or standards to be achieved
		ensure that decks are not washed by wave action.					
S7.4.1	WM9	<ul> <li>Dumping of excavated sediment</li> <li>Keep and produce logs and other records to demonstrate compliance and ensure journeys are consistent with designated locations</li> <li>Comply with the conditions in the dumping permit.</li> <li>All bottom dumping vessels (hopper barges) shall be fitted with tight fittings seals to their bottom openings to prevent leakage of material.</li> <li>The excavated sediment shall be placed into the disposal pit by bottom dumping.</li> <li>Contaminated marine mud shall be transported by split barge of not less than 750m³ capacity and capable of rapid opening and discharge at the disposal site.</li> <li>Discharge shall be undertaken rapidly and the hoppers shall be closed immediately. Sediment adhering to the sides of the hopper shall not be washed out of the hopper and the hopper shall remain closed until the barge returns to the disposal site.</li> <li>For Type 3 special disposal treatment, sealing of contaminant with geosynthetic containment before dropping into designated mud pit. A geosynthetic containment method is a method whereby the sediments are sealed in geosynthetic containers and, the containers would be dropped into the designated contaminated mud pit where they would be covered by further mud disposal and later by the mud pit capping at the disposal site, thereby fulfilling the requirements for fully confined mud disposal.</li> </ul>	Handle excavated sediment	Contractor	All construction sites where applicable	Construction stage	• ETWB-TCW 34/2002
S7.4.1	WM10	<u>Chemical Waste</u>	Control the chemical waste and ensure proper	Contractor	All construction	Construction stage	

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and / or standards to be achieved	
		If chemical wastes are produced at the construction site, the Contractors should register with EPD as chemical waste producer. Chemical wastes should be stored in appropriate containers and collected by a licensed chemical waste collector. Chemical wastes (e.g. spent lubricant oil) should be	storage, handling and disposal.		sites		(Chemical Waste) General) Regulation	
		recycled at an appropriate facility as far as possible, while the chemical waste that cannot be recycled should be disposed of at either the Chemical Waste Treatment Centre, or another licensed facility, in accordance with the Waste Disposal (Chemical Waste) (General) Regulation.					• Code of Practice on the Packaging, Labelling and Storage of Chemical Waste	
S7.4.1	WM11	General Refuse     General refuse should be stored in enclosed bins separately from construction and chemical wastes. Recycling bins should also be placed to encourage recycling.	Minimize production of the general refuse and avoid odour, pest and litter impacts		All construction sites	Construction stage	Waste Disposal Ordinance	
		<ul> <li>Preferably enclosed and covered areas should be provided for general refuse collection and routine cleaning for these areas should also be implemented to keep areas clean.</li> <li>A reputable waste collector should be employed to remove general refuse on a daily basis.</li> </ul>						
S7.4.1	WM12	Floating Refuse accumulated along the seawall  The floating refuse along seawall should be collected to avoid accumulation. In addition, proper seawall design should be employed, and regular checking and cleaning of floating refuse should be implemented.	Control floating refuse and ensure proper disposal	Contractor	Construction sites along seawall	Construction stage	Waste Disposal Ordinance	
Waste Ma	Waste Management (Operational Waste)							
S7.4.2	WM13	Illegal dumping and landfilling	Prevent waste from	Relevant	All	Operational stage		

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and / or standards to be achieved
		As a Development Permission Area (DPA) plan will be issued by the Town Planning Board as a temporary measure before the formal Outline Zoning Plan (OZP) for Tung Chung New Town Extension is adopted, statutory right to guide and control the development and use of land would be authorised. Should there be illegal dumping and landfilling observed/ reported on nearby farmlands and riverbanks, the government authority should take all necessary actions including but not limited to prosecution to remediate the circumstances.	illegal dumping and landfilling	government departments	construction		
\$7.4.2	WM14	<ul> <li>Municipal Solid Waste</li> <li>A reputable waste collector should be employed to remove general refuse on a daily basis.</li> <li>A 4-bin recycling system for paper, metals, plastics and glass should be adopted together with a general refuse bin. They should be placed in prominent places to promote waste separation at source. All recyclable materials should be collected by recyclers.</li> </ul>	Remove general refuse generated from the proposed development	FEHD/ Relevant Operators	All construction sites	Operational stage	Waste Disposal Ordinance
S7.4.2	WM15	Chemical Waste     Localized chemical waste storage areas should be located close to the source of waste generation for temporary storage. Drum-type containers with proper labelling should be used to collect chemical wastes for storage at the designated areas.      A licensed collector should be employed for the chemical waste collection and the chemical wastes	Reduce chemical waste due to waste handling	Contractors/ Relevant Operators	All construction sites	Operational stage	
		<ul> <li>chemical waste collection and the chemical wastes should be disposed at an appropriate facility, such as Chemical Waste Treatment Centre (CWTC) in Tsing Yi.</li> <li>Collection receipts issued by the licensed collector showing the quantities and types of chemical waste taken off-site and details of the treatment facility should be kept for record.</li> </ul>					

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation	Location / Timing	Implementation Stage	Requirements and / or standards to be achieved
S7.4.2	WM16	<ul> <li>Floating Refuse accumulated along seawall</li> <li>The floating refuse along seawall should be collected to avoid accumulation.</li> </ul>	Control floating refuse and ensure proper disposal		Along seawall	Operational stage	Waste Disposal Ordinance
S7.4.2	WM17	Floating Refuse inside Marina  • Floating refuse at the marina will be collected and disposed by the licensed waste collector and as required.	Reduce floating refuse washing up onto marina by currents and wind	-	Marina	Operational stage	Waste Disposal Ordinance

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and / or standards to be achieved		
Land Con	Land Contamination								
S8.4.1	LCI	Undertaking environmental Site Inspection (SI) for all potentially contaminated sites as listed in the Contamination Assessment Plan (CAP).	contamination potential before the		All potentially contaminate d sites as listed in the CAP	Prior to the construction stage	<ul> <li>Annex 19 of the TM-EIAO, Guidelines for Assessment of Impact On Sites of Cultural Heritage and Other Impacts (Section 3 : Potential Contaminated Land Issues);</li> <li>Guidance Manual for Use of Risk-Based Remediation Goals (RBRGs) for Contaminated Land Management;</li> <li>Guidance Notes for Contaminated Land Assessment and Remediation; and</li> <li>Practice Guide for Investigation and Remediation of Contaminated Land</li> </ul>		

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and / or standards to be achieved
							• Recommendation s in Health Risk Assessment
S8.4.2	LC2	Re-appraisal would be required for the surveyed sites, other remaining areas of the PDAs and the works areas for the associated infrastructures because the development of these sites/ areas would only commence a number of years later, which may allow changes in the land usage of these sites and may give rise to potential land contamination issues.  The Project Proponent's appointed consultant would prepare a supplementary CAP presenting the findings of the reappraisal and strategy of the recommended SI, if required, and submit to EPD for review and approval.	J 1		All the surveyed sites as listed in the CAP, other remaining areas of the PDAs and works areas for the associated infrastructur es	Prior to the construction stage	Ditto
S8.5	LC3	After approval of the supplementary CAP and upon completion of the SI works, the PP should prepare and submit a Contamination Assessment Report (CAR) for all potentially contaminated sites listed in the CAP to EPD for agreement.	Present the findings of SI and evaluate the level and extent of potential contamination		All the surveyed sites as listed in the CAP, other remaining areas of the PDAs and works areas for the associated infrastructures	Prior to the construction stage	Ditto
S.8.5	LC4	Preparation and submission of Remediation Action Plan (RAP) to EPD for agreement if land contamination is confirmed.	Recommend appropriate mitigation measures for the contaminated soil and groundwater identified in the	Detailed Design	All the surveyed sites as listed in the CAP, other remaining	Prior to the construction stage	Ditto

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and / or standards to be achieved
			assessment if remediation is required		areas of the PDAs and works areas for the associated infrastructu res		
S.8.5	LC5	Preparation and submission of Remediation Report (RR) to EPD for agreement.	Demonstrate that the decontamination work is adequate and is carried out in accordance with the endorsed CAR and RAP	Detailed Design Consultant /	All the surveyed sites as listed in the CAP, other remaining areas of the PDAs and works areas for the associated infrastructures	Prior to the construction stage	Ditto

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and / or standards to be achieved
Ecology	( Design Ph	ase)					
S9.8.1	EC1	Development under the Project have avoided all the recognised sites of conservation importance, including Country Parks,	To protect the recognised sites of conservation importance and habitats inside	PlanD	TCW	RODP	Not available
S9.8.1	EC2	About 30m buffer zone at the two main branches and the joined outlet section of Tung Chung Stream; and about 20m buffer for the major tributary at Ngau Au of Tung Chung Stream	To protect the Tung Chung Stream	PlanD	Tung Chung Stream	RODP	Not available
S9.8.2	EC3	Detailed designs should avoid the encroachment of important habitats (e.g. Fung Shui Wood) within the Project Site	To protect the important habitats within Project Site	PlanD	TCW	Design Phase	Not available
S9.8.2	EC4	Detailed designs of noise barriers to prevent bird collision	To prevent bird collision	HyD	Noise barriers	Design Phase	• Guidelines on Design of Noise Barriers
S9.8.2	EC5	Measures and suitable designs of sewage pumping stations to prevent emergency discharge accidents in TCE and TCW  100% standby pumping capacity within each SPS, with spare pump up to 50% pumping capacity stockpiled in each SPS for any emergency use  Twin rising mains  Dual-feed power supply  Emergency storage facilities up to 6-hours ADWF capacity; and  Emergency communication mechanism amongst relevant government departments.	To protect the water bodies from impacts due to emergency discharge in TCE and TCW	DSD	Proposed and Upgraded Sewage pumping stations at TCE and TCW	Design Phase	• DSD standards

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and / or standards to be achieved
Ecology (	Construction	on Phase)					
S9.8.2	EC6	Adoption of non-dredged reclamation method	To maintain the marine water quality	Contractor	Reclamation area of TCE and Road P1	Construction phase	• EIA • Contractual requirements
S9.8.3	EC7	Compensation woodland planting	To compensate loss of woodland, fung shui wood and orchard	Contractor	Uphill of Sheung Lei Pai FSW and Tung Chung Road	Construction phase	EIA     Contractual requirements
S9.8.3	EC8	Planting of emergent plant	To provide habitats for this Jhora Scrub Hopper, and to compensate the loss of their habitats (wet abandoned agricultural land) in northern section of Fong Yuen	DSD / Contractor	Inside the future River Park	Construction phase	EIA     Contractual requirements
S9.8.3	EC9	Capture-and-translocation exercise	Minimize the potential impact to amphibian species of conservation importance including Romer's Tree Frog and Chinese Bullfrog due to site formation	For public works, provided by the government departments responsible for the construction of those public works or the site formation works.  For TCV-1 and	Public works near the eastern branch of Tung Chung Stream, in particular 1) the River Park, 2) the Distributor Road along	Capture-and- translocation exercise before commencement of site formation	<ul> <li>EIA</li> <li>Contractual requirements</li> <li>Explanatory statement of the OZP (for private lots)</li> </ul>

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and / or standards to be achieved
				TCV-5, where the lands within mostly belong to private lots, the future project proponents of those private lots, via the established mechanism for land transaction application.	branch of Tung Chung Stream, 3) the road		
S9.8.3	EC10	Preservation and/or Transplantation of plant species of conservation importance and the following monitoring of preserved/transplanted plant individuals	Protection of plant species of conservation importance	For public works, provided by the government departments responsible for the construction of those public works or the site formation works.	Within construction sites  All areas for public works  Also be required in private lands	For preservation and/or transplantation, before commencement of site formation.	Contractual requirements

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and / or standards to be achieved
				For TCV-1, where the lands within mostly belong to private lots, the future project proponents of those private lots, via the established mechanism for land transaction application.	in TCV-1.		
S9.8.3	EC11	Defining and maintaining construction site boundaries (including erection of site hoarding, fences etc.)	Screen construction disturbance to the nearby habitats	Contractor	Along the boundary of construction sites and buffer zones of Tung Chung Streams, along the boundary of mature woodland and Fung Shui Wood, and along the boundary between TCV-6 and the middle section of Fong Yuen	Before commencement of site formation	• EIA • Contractual requirements
S9.8.3	EC12	Protection of Tung Chung Stream	Minimize the potential water pollution due to	Contractor	Within construction	Construction	• EIA

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and / or standards to be achieved
			construction of road crossings or other works near Tung Chung Stream		sites	phase	• Contractual requirements
S9.8.3	EC13	Implementation of standard site practices	Minimize the potential impact due to dust, noise and runoff during construction phase	Contractor	Within construction sites	Construction phase	• EIA • Contractual requirements
S9.8.4	EC14	Adopting Eco-shoreline design	To mitigate the impact of the marine loss	CEDD	Along future seawall	Construction stage	• EIA • Contractual requirements
S9.8.4	EC15	Strict enforcement on no-dumping	Minimise the potential impact to marine habitats	Contractor	In reclamation area as well as all works area and travel route of works vessels	Before and during construction phase	• EIA • Contractual requirements
S9.8.4	EC16	Spill response plan	Minimise the potential impact to marine habitats	Contractor	In reclamation area as well as all works area and travel route of works vessels	Before and during construction phase	• EIA • Contractual requirements
S.9.8.4	EC17	Control and minimization of marine traffic by including using larger-sized barges, land transportation of materials, reuse of excavation and C&D materials and speed limits &	Reduce marine traffic	Contractor	In reclamation area as well	Construction phase	• EIA • Contractual

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and / or standards to be achieved
		regular routes of works vessels			as all works area and travel route of works vessels		requirements
S9.8.4	EC18	Dolphin exclusion zone and dolphin watching plan	Protection of CWD	Contractor	In reclamation area as well as all works area	Construction phase	• EIA • Contractual requirements
S9.8.4	EC19	Speed limits and regular routes of works vessels; Prepare and submit a "Works Vessel Travel Route Plan"	Protection of CWD	Contractor	In reclamation area as well as all works area	Construction phase	• EIA • Contractual requirements
S9.11.1	EC20	Monitoring of compensatory planting woodland	Monitor the survival of trees and establishment of the woodland	CEDD/ Contractor	Areas of compensator y woodland planting	Quarterly for 3 years after completion of planting works	• EIA • Contractual requirements
S9.11.1	EC21	Monitoring of translocated amphibians	Monitor the effectiveness of the translocation programme	Public works: Responsible government departments / Contractor Private lots: Private developers	Release sites for translocated amphibians	After translocation exercise.  At least three surveys in each release site during the breeding season, preferably monthly between April and June,	<ul> <li>EIA</li> <li>Contractual requirements</li> <li>Explanatory statement of the OZP (for private lots)</li> </ul>
S9.11.1	EC22	Monitoring of preserved / transplanted plant species	Monitor and evaluate	Public works:	Construction	After	• EIA

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and / or standards to be achieved
			the effectiveness of the preservation and transplantation programme.	Responsible government departments / Contractor Private lots: Private developers	sites for preserved plants; recipient sites for transplanted plants	transplantation or preservation.  For transplanted individuals, for two years, monthly for the first year, and then quarterly for the second year.  For the preserved individuals, monthly throughout the construction.	requirements
S9.11.1	EC23	Monitoring of Tung Chung Stream and Wong Lung Hang Stream EISs	Protect the EISs	Contractor	Tung Chung Stream and Wong Lung Hang Stream	Construction phase and post- construction phase	• EIA • Contractual requirements
9.11.2	EC24	Monitoring of Tung Chung Bay and Tai Ho Wan	Protect Tung Chung Bay and Tai Ho Wan	Contractor	Tung Chung Bay and Tai Ho Wan	Construction phase and post- construction phase	• EIA • Contractual requirements
Ecology (	Operationa	l Phase)					
S9.11.1	EC25	Monitoring of emergent plant inside River Park	Monitor the survival of emergent plant	DSD/ Contractor	Three months after completion of planting in future River Park	Quarterly for 2 years after completion of planting works	<ul><li>EIA</li><li>Contractual requirements</li></ul>

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures		Implementation Agent	Location / Timing	Implementation Stage	Requirements and / or standards to be achieved
9.11.2	EC26	Eco-shoreline monitoring	Monitor the colonisation and establishment of fauna and/or flora, water quality, and recruitments of fisheries species	CEDD/ Contractor	Eco- shoreline at TCE PDA reclamation	phase twice in	• EIA • Contractual requirements

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location	Implementation Stage	Requirements and / or standards to be achieved
Fisheries	3						
S10.8	F1	Good Site Practices	To protect the fisheries resources	Contractor	In reclamation area	Construction phase	• EIA • Contractual requirements
S10.8	F2	No dumping	To protect the fisheries resources	Contractor	In reclamation area	Construction phase	• EIA • Contractual requirements
S10.8	F3	Spill response plan	To protect the fisheries resources	Contractor	In reclamation area	Construction phase	• EIA • Contractual requirements
S10.9	F4	Follow the mitigation measures proposed in the water quality assessment for the construction and operation phases of the project.	To protect the fisheries resources	Contractor	Waters in Northern Lantau	Construction phase and operation phase	
S10.9	F5	Follow the mitigation measure of eco-shoreline in ecology chapter for the construction and operation phases of the project.	To enhance the fisheries resources	Contractor	Eco- shorelines	Construction phase and operation phase	

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementati on Agent	Location	Implementation Stage	Requirements and / or standards to be achieved
Landsca	pe and Visua	al (Construction Phase)					
S11.7 MM1	LV1	Optimisation of Construction Areas & Providing Temporary Landscape on Temporary Construction — Construction areas' control shall be enforced, where possible, to ensure that the landscape and visual impacts arising from the construction activities are minimised.  It includes reduction of the extent of working areas and temporary works areas, management on storing and using the construction equipment and materials, and consideration of detailed schedules to shorten the construction period. Temporary landscape treatments are considered to be adopted such as applying hydro-seeding on temporary stockpiles and reclamation areas to alleviate the potential impacts.	Minimise the landscape and visual impacts arising from the construction activities	Relevant Government Departments / Private Sector	Through-out Tung Chung West (TCW) area and Tung Chung East (TCE) area	Construction Phase	
S11.7 MM2	LV2	Minimize Topographical Change – The footprint of construction elements and temporary works areas should be optimised to reduce topographical/landform changes, as well as reduce land take and interference with natural terrain. Where there is a need to significantly cut into the existing landform, retaining walls and cut slopes should be considered as appropriate.  To minimize landform changes and land resumption, earthworks and engineered slopes should be designed to be a visually interesting, compatible with the surrounding landscape and to mimic the natural contouring and terrain as appropriate.	Reduce topographical changes and minimize land resumption	Relevant Government Departments / Private Sector	Through-out TCW area	Prior to Construction & Construction Phase	• GEO Publication No/1/2011, Technical Guidelines on Landscape Treatment for Slopes
S11.7 MM3	LV3	Preservation of Potentially Registerable OVTs, Rare and Protective Vegetation – Exiting trees to be retained within the Project Site should be carefully protected during construction. In particular Potentially Registerable OVTs are considered to be preserved according to ETWB	Protect and Preserve Trees	Relevant Government Departments / Private Sector	Onsite, particularly for TCW area	Prior to Construction & Construction Phase	• ETWB TC(W) No.29/2004 and DEVB TC(W)

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementati on Agent	Location	Implementation Stage	Requirements and / or standards to be achieved
		Technical Circular (Works) No. 29/2004. Rare and Protective Vegetation shall be protected following Forestry Regulations (Cap.96) and Protection of Endangered Species of Animals and Plants Ordinance (Cap.586). Detailed Tree Protection Specification shall be provided in the Contract Specification according to DEVB TCW No. 10/2013 Tree Preservation. Following DEVB (GLTM) Guidelines for Tree Preservation during Development, the Contractor shall be required to submit, for approval, a detailed working method statement for the protection of trees prior to undertaking any works adjacent to all retained trees, including trees in contractor's works areas.  A detailed tree survey will be carried out for the Tree Removal Application (TRA) process which will be carried out at the later detailed design stage of the Project. The detailed tree survey will propose which trees should be retained, transplanted or felled and will include details of tree protection measures for those trees to be retained.					No.10/2013.  • Greening, Landscape and Tree Management Section (GLTM) of the Development Bureau, Guidelines on Tree Preservation during Development (April, 2015)
S11.7 MM4	LV4	Transplanting of Existing Trees – Trees unavoidably affected by the Project works should be transplanted where practical. Trees should be transplanted straight to their final receptor locations within the site and not held in a temporary nursery as far as possible.  A detailed Tree Transplanting Specification shall be provided in the Contract Specification, where applicable. Sufficient time for necessary tree root and crown preparation periods shall be allowed in the project programme. A detailed transplanting proposal will be submitted to relevant government departments for approval in accordance with DEVB TCW 10/2013 and LAO PN 7/2007 and final locations of transplanted trees should be agreed prior to commencement of the work.  For trees associated with highways e.g. roadside planting	Transplant Trees where suitable for transplantation	Relevant Government Departments / Private Sector	Onsite where possible, otherwise consider offsite locations	Prior to Construction & Construction Phase	<ul> <li>DEVB TC(W)         No.10/2013         and LAO         PN7/2007</li> <li>HyD         HQ/GN/13         Interim         Guidelines for         Tree         Transplanting         Works under         Highways         Department's         Vegetation         Maintenance</li> </ul>

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementati on Agent	Location	Implementation Stage	Requirements and / or standards to be achieved
		along highways, that are unavoidably affected and should be transplanted. HyD HQ/GN/13 'Interim Guidelines for Tree Transplanting Works under Highways Department's Vegetation Maintenance Ambit' should be referred to.					Ambit  GLTM of the Development Bureau, Guidelines on Tree Preservation during Development (April, 2015)
S11.7 MM5	LV5	Screen hoarding — To reduce negative visual impact, construction site hoarding should be erected around the site to screen pedestrian level views into the construction area from visual sensitive receivers.  Hoarding design should consider greening measures such as colour and form should be adopted to improve its visual appearance.	To screen undesirable views of the work site.	Relevant Government Departments / Private Sector	Through-out TCW and TCE areas	Construction Phase	
S11.7 MM6	LV6	Adopting Non-dredge Method for the Reclamation – In order to minimize the potential adverse impacts caused by the reclamation, a number of alternative construction methodologies has been critically examined. After considering all the options such as fully dredged, partially dredged and non-dredged methods for seawall construction and reclamation, non-dredged method for both the seawall construction and reclamation are recommended so as to minimize the generation of dredged sediment.	Minimize the potential adverse impacts caused by the reclamation	Relevant Government Departments / Private Sector	Through-out TCE area	Construction Phase	• Foreshore and Sea-bed (Reclamations) Ordinance (Cap.127)
S11.7 MM7	LV7	Protection of Natural Rivers and Streams – For all the natural rivers and streams inside the development area, in accordance with ETWB TCW 5/2005, consideration of protection measures should be made to minimize any impacts from the construction works, especially those	Protection of Natural Rivers and Streams Minimize the impacts from the construction works	Relevant Government Departments / Private Sector	Through-out TCW area	Prior to Construction & Construction Phase	<ul> <li>EPD ProPECC PN1/94 Construction Site Drainage.</li> <li>DSD Technical</li> </ul>

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementati on Agent	Location	Implementation Stage	Requirements and / or standards to be achieved
		development near Tung Chung Stream.  According to the latest RODP, a 30m buffer zone will be zoned as "CA". Precast structures or other similar approaches will be used to prevent / minimise any construction works in river and thus to avoid any direct water quality impact. Good site management as stipulated in ProPECC PN1/94 will be fully implemented to avoid polluted liquid or solid wastes from falling into the river waters.					Circular No. 2/2004.  • ETWB TC(W) No.5/2005  Protection of natural streams/rivers from adverse impacts arising from construction works
S11.7 MM8	LV8	Preservation of Natural Coastline – The natural coastline along the proposed "RO" of the RODP in TCW should be preserved. The remaining natural shorelines in Tung Chung Bay including sandy shores close to the Tung Chung old pier will be conserved as a Waterfront Park according to the latest RODP.	Preservation of Natural Coastline	Relevant Government Departments	Onsite where possible	Prior to Construction & Construction Phase	
S11.7 MM9	LV9	Providing Natural Rock Material/ Planting for Artificial Seawall – There would be inevitable permanent losses of marine waters (seabed and water column), and direct impacts on existing artificial seawalls due to the reclamation. To minimize the impacts, the design of the future seawall like 'eco-shoreline' could be improved to provide high ecological functions and mitigate the impact of the loss.	Mitigate the impacts on existing artificial seawalls	Relevant Government Departments	Onsite where possible	Prior to Construction & Construction Phase	
		An 'eco-shoreline' is any shoreline which provides beneficial functions to the local ecosystem through a range of active or passive solutions, whilst providing coastal protection. By means of using natural rock materials for artificial seawall and considering to introduce a native vegetation buffer directly behind the top of seawalls as appropriate to create habitat, shelter and a source of food					

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementati on Agent	Location	Implementation Stage	Requirements and / or standards to be achieved
		for benefiting both terrestrial and aquatic species along the foreshore, these measures can help to enhance the ecological functions and 'natural-look' of the shoreline, and the potential impacts will be mitigated.					
Landscap	e and Visua	d (Operational Phase)					
S11.7 MM10	LV10	Compensatory Planting — Compensatory planting for felled trees shall be provided to the satisfaction of relevant Government departments. Required numbers and locations of compensatory trees shall be determined and agreed separately with Government during the Tree Removal Application process under DEVB TCW No. 10/2013 and LAO PN 7/2007.  The location of compensatory planting is proposed at the potential open areas such as open spaces, amenity areas, open areas of the streetscapes including roadside planting, as well as the open areas within development lots.  The species to be planted should be all native species, taken "Characteristics of Major Local Tree Species Propagated by AFCD" as a reference. A search of species to be planted will be conducted in a further detailed stage.	Compensate for trees and shrubs lost due to the Project	Relevant Government Departments / Private Sector	Onsite where possible, particular-ly for TCW area	Prior to Construction, Construction Phase & Maintenance in Operation Phase	DEVB TC(W)     No.10/2013     and LAO PN     7/2007.      GLTM of the     Development     Bureau,     Guidelines on     Tree     Preservation     during     Development     (April, 2015)
S11.7 MM11	LV11	Woodland Restoration – A search of area to mitigate the loss of woodland has been conducted. Priority has been given to the practicability of compensation of woodland within the boundary of RODP. Given the nature of the project is to provide development opportunities to satisfy the needs for the society in general and the aspirations of local communities, compensation of woodland is only possible for the areas beyond the RODP. It is considered that the areas adjoining the woodlands near the existing services reservoirs, and hillsides to the east of Tung Chung Road, would be suitable locations. The advantage of these locations is that there are existing woodlands immediately	Reprovide areas of woodland to compensate for those areas of quality woodland lost	CEDD/AFCD	In areas identified and as agreed with AFCD	Prior to Construction, Construction Phase & Maintenance in Operation Phase	DEVB     Technical     Circular Works     10/2013- Tree     Preservation      GLTM of the     Development     Bureau,     Guidelines on     Tree     Preservation

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementati on Agent	Location	Implementation Stage	Requirements and / or standards to be achieved
		downhill to the location and the Sheung Ling Pei Fung Shui Wood is further downhill behind Sheung Ling Pei Village, planting new woodland areas adjoining existing woodlands would form an ecological linkage and increase the overall habitat size, and hence would help to enhance the ecological and landscape values in the long run.					during Development (April, 2015)
		It is noted that the compensation trees for landscape impacts will also be planted near the future service reservoirs. The tree species to be planted should be all native species for woodland compensation, and the two areas uphill to Sheung Ling Pei should also make reference to the existing tree species reported in Fung Shui Woods habitat.					
S11.7 MM12	LV12	Screen Planting – Tall screen/buffer trees and shrubs should be planted to screen proposed structures such as roads and buildings. This measure will form part of the compensatory planting and will improve compatibility with the surrounding environment and create a pleasant pedestrian environment.	To screen proposed structures  Improve compatibility with the surrounding environment	Relevant Government Departments	Through-out the working sites of the TCW and TCE areas	Prior to Construction, Construction Phase & Maintenance in Operation Phase	• HyD HQ/GN/15— Guidelines for Greening Works along Highways.
S11.7 MM13	LV13	Roadside Planting – Roadside greening is proposed alongside all roads within the possible developments. It will enhance local identity, if theme planting is used, and reduce visual impact through screening. At-grade road planting should be considered along central dividers and on road islands e.g. in the middle of roundabouts.	Soften the hard, straight edges and provide greening along the roads; Improve the visual amenity	Relevant Government Departments	Along new roads, and On appropriate viaducts	Prior to Construction, Construction Phase & Maintenance in Operation Phase	<ul> <li>HyD         HQ/GN/15-             Guidelines for Greening             Works along             Highways.     </li> <li>Development             Bureau             Technical             Circular Works             No.2/2012 -             Allocation of Space for Quality</li> </ul>

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	-	Location	Implementation Stage	Requirements and / or standards to be achieved
							Greening on Roads

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementati on Agent	Location	Implementation Stage	Requirements and / or standards to be achieved
S11.7 MM14	LV14	Aesthetic Design of Built Development – The planning of the revised RODP has considered reducing potential visual impacts, enhancing visual amenity and keeping visual corridors. The proposed development will ensure the building massing is compatible with its surroundings. To improve visual amenity, natural building materials could be used on building facades. For example, stone and timber should be considered for architectural features; light earthy tone colours such as shades of green, shades of grey, shades of brown and off-white should be considered for the façade treatment to reduce the visibility of the development components. The form, textures, finishes and colours of the proposed development components should aim to be compatible with the existing surroundings. It would only be implemented for public developments/projects.	Improve visual amenity of the new buildings, keep visual corridors and integrate as possible into the surrounding landscape	Relevant Government Departments	Through-out the TCW and TCE areas	Prior to Construction, Maintenance in Operation Phase	<ul> <li>Hong Kong Planning Standards and Guidelines (HKPSG) issued by the Planning Department (As at Aug 2011);</li> <li>PNAP APP- 152, Sustainable Building Design Guidelines</li> </ul>
S11.7 MM15	LV15	Maximise Greening on Structures – The Government has been actively promoting greening in buildings and structures such as bridges to improve the environment. This includes actively implementing rooftop greening or vertical greening, as where practicable to enhance the cityscape and mitigate the heat island effect in urban areas. For the new built forms in TCW and TCE, it is considered the implementation of the following greening measures could alleviate the landscape and visual impacts of new development and help the development blend in with its surrounding landscape:  • Sky Garden: Refuge floors or voids in building mass formed by partial removal of floor plates on certain building storeys or provision of freed up areas on certain building storeys provide opportunities for sky gardens for the proposed built development. It can allow views through the development to the background formed by the natural hillsides and	Maximise Greening coverage  Enhance visual amenity, create visual corridors and integrate as possible into the surrounding landscape	Relevant Government Departments	On appropriate buildings and structures	Prior to Construction, Construction Phase & Maintenance in Operation Phase	Development     Bureau     Technical     Circular     (Works) No.     3/2012 Site     Coverage of     Greenery for     Government     Building     Projects      PNAP APP-     152,     Sustainable     Building     Design     Guidelines

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementati on Agent	Location	Implementation Stage	Requirements and / or standards to be achieved
		enhance the visual amenity effectively. For public developments, relevant technical document Technical Circular (Works) No. 3/2012 Site Coverage of Greenery for Government Building Projects by Development Bureau in 2011 shall be referred to. For private developments, it is only applicable to sites with inadequate greening coverage and should be implemented in accordance with Sustainable Building Design Guidelines PNAP APP-152.					
		• Green Roof: The Architectural Services Department completed the Study on Green Roof Application in Hong Kong in 2007 which reviewed the latest concepts and design technology of green roof and recommended technical guidelines suitable for application in Hong Kong. The study will be taken into account to the new buildings to be built in TCW and TCE. Landscape and visual impact can be alleviated and the landscape and visual value can be enhanced. For private development, it is only applicable to sites with inadequate greening coverage and should be implemented in accordance with Sustainable Building Design Guidelines PNAP APP-152. Relevant technical document Technical Circular (Works) No. 3/2012 Site Coverage of Greenery for Government Building Projects by Development Bureau in 2011 shall be reference. For public developments, relevant technical document Technical Circular (Works) No. 3/2012 Site Coverage of Greenery for Government Building Projects by Development Bureau in 2011 shall be referred to. For private developments, it is only applicable to sites with inadequate greening coverage and should be implemented in accordance with Sustainable Building Design Guidelines PNAP APP-152.					
		Vertical Green: Planting of climbers to grow up					

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementati on Agent	Location	Implementation Stage	Requirements and / or standards to be achieved
		vertical surfaces where appropriate (e.g. building edges), to soften hard structures and facilities. Relevant technical document Technical Circular (Works) No. 3/2012 Site Coverage of Greenery for Government Building Projects by Development Bureau in 2011 shall be observed. For public developments, relevant technical document Technical Circular (Works) No. 3/2012 Site Coverage of Greenery for Government Building Projects by Development Bureau in 2011 shall be reference. For private development, it is only applicable to sites with inadequate greening coverage and should be implemented in accordance with Sustainable Building Design Guidelines PNAP APP-152.  • Greening on infrastructure: Planting could be provided on infrastructure such as bridges where appropriate to enhance greenery to soften its built edges. Screen planting could be provided near infrastructure to reduce any undesirable visual impacts.					
S11.7 MM16	LV16	Noise barrier design — The visual impact of noise mitigation measures will be mitigated by appropriate detailed design, including suitable combination of transparent and sound absorbent materials, appropriate colour selection of panels and supporting structures, or provision of at-grade planting of trees, shrubs and/or climbers camouflage to the barriers, as well as design of supporting structures to incorporate a high level of quality and aesthetics. A combination of transparent panels at top and solid panels at bottom would lighten the visual impact, and at the same time maintain the attractiveness by using colourful panels. The noise barriers would be implemented for District Distributor Roads and Local Distributor Roads at both TCE and TCW area.	Minimize the visual impact from the structures of noise barriers	HyD	Noise barriers within the TCW and TCE areas	Prior to Construction, Construction Phase & Maintenance in Operation Phase	<ul> <li>GLTM of the Development Bureau's Guidelines on Greening of Noise Barriers (April 2012).</li> <li>Guidelines on Design of Noise Barriers by HyD and EPD in 2003</li> </ul>

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementati on Agent	Location	Implementation Stage	Requirements and / or standards to be achieved
S11.7 MM17	LV17	Landscape Treatment for Polders & Attenuation Ponds – There would be polders and attenuation ponds in TCW. While they are primarily used for receiving and treating surface runoff and alleviating the flood risk during heavy rainfall, the design of those has provided an opportunity to have a synergy to enhance both the ecological and landscape values together.	Enhance the landscape and visual value	DSD	Polders & Attenuation Ponds where possible	Prior to Construction, Construction Phase & Maintenance in Operation Phase	
		Depending on detailed design, part of these attenuation ponds (mainly the biofiltration zone) could be refined in an appropriate manner, without compromising its primary functions of treating surface runoff and flood protection, to incorporate ecological and landscape design such as planting of aquatic plants and butterfly foodplant for providing the landscape and ecological enhancement.					
Landscape	e and Visua	l (Construction & Operational Phase)					
S11.7 MM18	LV18	Landscaping on Slopes – Hydro seeding of modified slopes should be done as soon as grading works are completed to prevent erosion and subsequent loss of landscape resources and character. Woodland tree seedlings and/ or shrubs should be planted where gradient and site conditions allow.  In addition, landscape planting should be provided for the retaining structures associated with modified slopes where condition allow.	Enhance landscape value, plant diversity and their visual appearance	CEDD	Onsite, particularly in TCW area	Prior to Construction, Construction Phase & Maintenance in Operation Phase	• GEO Publication No.1/2011 Technical Guidelines on Landscape Treatment for Slopes by CEDD in 2011
S11.7 MM19	LV19	Landscape Treatment on Channelized Watercourses – For the channelized watercourses in Tung Chung Stream that will be dechannelized, the Drainage Services Department Practice Note No.1/2005 – Guidelines on Environmental Considerations for River Channel Design, should be considered and appropriate measures included ensuring the new watercourses match the existing as far as possible.	Avoid direct impacts on the watercourse Improve the visual amenity	CEDD	The channelized watercourses throughout the TCW area	Prior to Construction, Construction Phase & Maintenance in Operation Phase	• Drainage Services Department Practice Note No.1/2005 – Guidelines on Environmental

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementati on Agent	Location	Implementation Stage	Requirements and / or standards to be achieved
		Measures can include enhancement planting to upgrade the channels as appropriate, including consideration of wetland planting along embankments where appropriate; as well as consideration of the best materials for the channel lining (e.g. gabion).					Considerations for River Channel Design
S11.7 MM20	LV20	Light Control – Construction day and night time lighting should be controlled to minimize glare impact to adjacent VSRs during the construction stage. Street and night time lighting shall also be controlled to minimize glare impact to adjacent VSRs during the operation phase.	Minimize negative glare impact to adjacent VSRs	Relevant Government Departments / Private Sector	Through-out the TCW and TCE areas	Construction Phase & Operation Phase	

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and / or standards to be achieved
Cultural 1	Heritage Im	pact (Construction and Operational Phase)					
S.12.5	СН1	Terrestrial Archaeology  • Implement rescue excavations/ survey-cum-rescue excavations/ further surveys after land resumption and prior to any construction works (see Figure 14.1 for the locations of rescue excavations/survey-cum-rescue excavations/further survey)	Rescue excavations to salvage archaeological data and cultural materials     Survey-cum-rescue excavations to better locate and design the follow up rescue excavations     Further surveys to obtain sufficient data for formulation of appropriate mitigation measures	Future Private Developer	After land resumption and prior to any construction works	resumption and	<ul> <li>Guidelines for Cultural Heritage Impact Assessment</li> <li>TM-EIAO Annex 10 and Annex 19</li> <li>Antiquities and Monuments Ordinance</li> </ul>
S.12.5	CH2	Terrestrial Archaeology  Implement watching brief during construction phase (see Figure 14.1 for the locations of watching brief)	To identify and record any archaeological material or features revealed during construction phase	Future Private	During construction phase	During construction phase	

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and / or standards to be achieved
EM&A P	roject						
S13.2	EM1	An Independent Environmental Checker needs to be employed as per the EM&A Manual.	Control EM&A Performance	Project Proponent	All constructi on sites	Construction stage	• EIAO Guidance Note No.4/2010 • TM-EIAO
S13.2 – 13.4	EM2	<ol> <li>An Environmental Team needs to be employed as per the EM&amp;A Manual.</li> <li>Prepare a systematic Environmental Management Plan to ensure effective implementation of the mitigation measures.</li> <li>An environmental impact monitoring needs to be implementing by the Environmental Team to ensure all the requirements given in the EM&amp;A Manual are fully complied with.</li> </ol>	Perform environmental monitoring & auditing	Project Proponent	All constructi on sites	Construction stage	• EIAO Guidance Note No.4/2010 • TM-EIAO

Docum ent Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and / or standards to be achieved
Works Ve	essel Travel	Routes (Extracted from Works Vessel Travel Route Plan subm	itted under Condition 2.13 oj	the EP)			
S3.2	WVTR1	All works vessels shall be equipped with Global Positional System (GPS) or equivalent automatic identification system (AIS) for real time tracking and monitoring of their travel routing, speed and anchorage points. The system shall be capable to record and analyse the travel routing, speed and anchorage points.	Control EM&A Performance	Contractor	All marine constructi on sites	Construction stage	EIA     Contractual requirements
S3.3.1	WVTR2	<ol> <li>Once approaching or leaving the entrance of the silt curtain, all vessels will travel at a speed no greater than 8 knots between the site and boundary of The Brothers Marine Park. The vessels can then navigate at normal speed (8-12 knots) after that distance unless other restrictions are imposed.</li> <li>If any dolphins are sighted within 250m of a vessel then the vessel will slow down to a speed no greater than 5 knots for at least 3 minutes after the last sighting.</li> </ol>	Protection of CWD	Contractor	All marine constructi on sites	Construction stage	• EIA • Contractual requirements
S3.3.2	WVTR3	All captains and the supervising staff should undergo training to learn about local dolphins and porpoises. They should be trained to be aware of the protocol for dolphin friendly" vessel operation (refer to the Code of Conduct for Dolphin Watching Activities from AFCD).	Protection of CWD	Contractor	All marine constructi on sites	Construction stage	• EIA • Contractual requirements
S3.3.2	WVTR4	Training on the requirements of the WVTRP would be provided for construction vessels' personnel to follow, which should include the details of the normal operational routings of the construction works vessels and reporting of deviations from the normal operational routings of the construction works vessels. The training course will be given to the licensed vessel captains by the trainers before commencement of work and refreshment course will be provided every quarter.	Protection of CWD	Contractor	All marine constructi on sites	Construction stage	EIA     Contractual requirements

Docum ent Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and / or standards to be achieved
Deployme	ent of Silt C	urtain(s) (Extracted from Silt Curtain Deployment Plan submi	tted under Condition 2.16 of	the EP)			
S4	SCD1	Before the start of the installation work, Qualified Ecologists with dolphin monitoring experience shall scan the exclusion zone for at least 30 minutes. If dolphins are observed in the exclusion zone, the installation work shall be delayed until the dolphins left the area.	Protection of CWD	Contractor	All marine constructi on sites	Construction stage	• EIA • Contractual requirements
S4	SCD2	If dolphins are observed within the exclusion zone during the installation work, the relevant part of the work shall cease until the dolphins left the area.	Protection of CWD	Contractor	All marine constructi on sites	Construction stage	• EIA • Contractual requirements
S5	SCD3	On-board supervisors will be assigned to check the condition of the silt curtain before commencement of works every day. An inspection checklist will be kept on site for record purpose.	Silt Curtain Integrity	Contractor	All marine constructi on sites	Construction stage	• EIA • Contractual requirements
S5	SCD4	For the tentative arrangement of silt curtain under adverse weather, the silt curtain will not be temporary removed during adverse weather. However, related works will be suspended immediately if silt curtain is found any damaged.	Silt Curtain Integrity	Contractor	All marine constructi on sites	Construction stage	• EIA • Contractual requirements
S5	SCD5	Diver inspection shall be carried out if necessary to inspect the installation and decommission of silt curtain to ensure proper installation and functioning of the silt curtain according to the design drawings. Nearby marine works will resume after repairing of the damaged silt curtains.	Silt Curtain Integrity	Contractor	All marine constructi on sites	Construction stage	• EIA • Contractual requirements
S5	SCD6	Refuse around the silt curtain will be collected at regular intervals on a daily basis so that water behind the silt curtains will be kept free from floating debris.	Waste Management	Contractor	All marine constructi on sites	Construction stage	• EIA • Contractual requirements

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and / or standards to be achieved
-------------	-----------------	---------------------------------	---	-------------------------	----------------------	-------------------------	---

Post-planting Monitoring and Maintenance (Details to be provided after the submission of Detailed Compensatory Woodland Planting Plan as required under EP Condition 2.22)

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and / or standards to be achieved
-------------	-----------------	---------------------------------	---	-------------------------	----------------------	-------------------------	---

Use of New Low Noise Road Surfacing Material(s) (Details to be provided after the submission of Plan for Review of Use of New Low Noise Road Surfacing Material(s) as required under EP Condition 2.23)

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and / or standards to be achieved
Follow-up actions to be taken by the Contractor and Dump Truck Drivers in case of Illegal Dumping and Landfilling of C&D Materials (Extracted from Waste Management Plan submitted under Condition 2.24 of the EP)							
S5.4	WM1	Investigation report will be prepared by the Contractor and submit to ER within 2 working days.	Control EM&A Performance		All constructi on sites		EP     Contractual requirements
S5.4	WM2	The Contractor will discuss with ER for the follow up actions (e.g. warning letter, cease operation, etc.) if required.	Control EM&A Performance	Contractor	All constructi on sites		• EP • Contractual requirements

## Annex C

Status of Submissions and Implementation Status of Mitigation Measures under EP

# Annex C Status of Submissions and Implementation Status of Mitigation Measures under EP

EP Condition	Submission / Implementation Status	Status
2.1	Set up of Community and Professional	Community and Professional Liaison
2.1	Liaison Groups	Groups were set up.
2.1	Complaint Management Plan	Accepted by EPD
2.5	Employment of Qualified Ecologist(s)	Qualified Ecologists have been
	1 7 2 0 (/	employed to carry out work relating to
		ecological aspects.
2.6	Employment of Surveillance Team	Surveillance Team has been employed
		to conduct regular site inspection.
2.11	Management Organizations	Accepted by EPD
2.12	Construction Works Schedule and Location Plans	Updated Plan was submitted to EPD on
2.13	Works Vessel Travel Route Plan	1 February 2021 Accepted by EPD
2.13	Eco-shoreline Implementation Plan	The Plan was submitted to EPD on 15
2.11	Leo Shoreme imprementation i tan	September 2020 and accepted by EPD
		on 23 November 2020
2.15	Dolphin Watching Plan	Updated Plan was submitted on 21
		September 2018 and accepted by EPD
		on 12 October 2018
2.16	Silt Curtain Deployment Plan	Updated Plan was submitted to EPD on
		15 September 2020 and accepted by EPD on 14 October 2020
2.17	Spill Paspansa Plan	
2.17	Spill Response Plan Plan on Provision of Buffer Zones	Accepted by EPD  To be prepared no later than 3 months
2.10	Tian on Trovision of Banci Zones	before the commencement of
		construction works at Tung Chung
		Valley
2.19	River Park Plan	To be prepared no later than 3 months
		before the commencement of
		construction works at Tung Chung
2.20	Hilbrid Falores and and Translated and	Valley
2.20	Habitat Enhancement and Translocation Plan for Amphibian Species of	To be prepared no later than 3 months before the commencement of
	Conservation Importance	construction works at Tung Chung
	Corber varion importance	Valley
2.21	Detailed Preservation and/or	To be prepared no later than 3 months
	Translocation Plan for Plant Species of	before the commencement of
	Conservation Importance	construction works at Tung Chung
		Valley
2.22	Detailed Compensatory Woodland	To be prepared no later than 3 months
	Planting Plan	before the commencement of
		construction works at Tung Chung
2.23	Plan for Review of Use of New Low Noise	Valley To be prepared no later than 3 months
2.20	Road Surfacing Material(s)	before the commencement of
	(-)	roadworks
2.24	Waste Management Plan	Accepted by EPD
2.25	(i) no dredging of marine sediment shall	Under implementation
	be carried out for the Project	
	(ii) all reclamation filling works shall be	Under implementation
	carried out within a leading seawall of	
	at least 200m; and	Under implementation
	(iii) silt curtains surrounding the reclamation area shall be deployed in	Under implementation
	accordance with the Silt Curtain	
	Deployment Plan	
	1 - /	

ED	Submission / Implementation States	Chabine
EP Condition	Submission / Implementation Status	Status
Condition		Under implementation
2.26	Implement Silt Curtain Deployment Plan	Under implementation
2.27	and Spill Response Plan	Un den immlementation
2.27	Implement dolphin exclusion zone of	Under implementation
	250m around the reclamation site at Tung	
	Chung East during the installation of the perimeter silt curtains and any re-	
	deployment of the perimeter silt curtains	
	by Qualified Ecologist(s)	
2.28	Once the perimeter silt curtains are	Under implementation
2.20	installed or re-deployed, the Dolphin	Onder implementation
	Watching Plan shall be implemented as	
	part of the EM&A programme	
2.29	(i) no underwater blasting and	Under implementation
2.2)	percussive piling shall be carried out for	Chaci implementation
	the Project; and	
	(ii) air compressors and other noisy	Under implementation
	equipment mounted on works vessels	Chaci implementation
	shall be acoustically-decoupled	
2.30	Implement Works Vessel Travel Route	Under implementation
	Plan	r
	Implement Eco-shoreline Implementation	To be implemented
	Plan	r
	Implement Dolphin Watching Plan	Under implementation
2.31	Implement Plan on Provision of Buffer	To be implemented
	Zones, River Park Plan, Habitat	•
	Enhancement and Translocation Plan for	
	Amphibian Species of Conservation	
	Importance, Detailed Preservation and/or	
	Translocation Plan for Plant Species of	
	Conservation Importance and Detailed	
	Compensatory Woodland Planting Plan	
2.32	Implement Plan for review of the use of	To be implemented
	new road surfacing material(s)	
	Implement Waste Management Plan	Under implementation
2.33	Install noise barriers and low noise road	To be implemented
	surfacing at the extended Chung Mun	
	Road and Road D3	
	All noise mitigation measures	
	implemented shall be properly	
	maintained during the operation of the	
• • •	above roads	
2.34	Implement a deodouriser with an odour	To be implemented
	removal efficiency of at least 95% shall be	
	installed, operated and maintained within	
	each sewage pumping station. The	
	exhaust of the deodouriser shall be	
	oriented away from sensitive receivers;	
	and all odourous facilities of each	
	sewage pumping station shall be	
	enclosed and negative pressure shall be maintained within the facilities.	
2.35		To be implemented
2.33	Enclose all the pumps inside a building structure	To be implemented
	SHUCIUIE	

EP	Submission / Implementation Status	Status
Condition		
2.36	(i) a 100% standby pumping capacity	To be implemented
	shall be installed and maintained	
	(ii) a 50% spare pumping capacity shall	To be implemented
	be installed and maintained	
	(iii) dual-feed power supply shall be	To be implemented
	installed and maintained; and	
	(iv) an emergency facility with a 6-hour	To be implemented
	storage capacity of average dry weather	
	flow shall be installed and maintained.	

## Annex D

Status of Statutory Environmental Requirements

# Annex D Status of Statutory Environmental Requirements

Contract No.	Description	Location	Ref No.	Status
General	Environmental Permit	TCNTE Works Area	EP-519/2016	Granted on 9 Aug 2016
Contract No. NL/2017/03	Discharge License under Water Pollution Control Ordinance	Area WA1, near Ying Tung Road, Tung Chung	WT00031099-2018	Validity from 19 Jun 2018 to 30 Jun 2023
		Area WA1, near Ying Tung Road, Tung Chung	WT00034715-2019	Validity from 21 Jan 2020 to 31 Jan 2025
	Billing Account for Disposal of Construction Waste	-	Application No. RT01957	Approved on 22 January 2018
	Registration as Chemical Waste Producer	Site Office for TCE	WPN-5213-950- B2528-01	Issued on 28 Feb 2018
	TOducei		WPN-5213-950- B2528-02	Issued on 20 Apr 2018
		Area WA3, near To Kau Wan, Tung Chung	WPN-5213-974- B2528-03	Issued on 9 April 2019
	Construction Noise Permit	Reclamation area	GW-RS0101-21	Validity from 18 Feb 2021 to 17 Aug 2021
		TCE Works Area near Lantau Toll Plaza	GW-RW0047-21	Validity from 15 Feb to 14 Aug 2021
	Licence for the conduct of a Specified Process (SP Licence)	TCNTE Works Area	L-3-264 (1)	Validity from 12 Aug 2020 to 11 Aug 2024

# Annex E

# Air Quality

# Annex E1

# Calibration Certificates for Air Quality

# ALS Technichem (HK) Pty Ltd

# ALS Laboratory Group

ANALYTICAL CHEMISTRY & TESTING SERVICES



# SUB-CONTRACTING REPORT

CONTACT

: MR K.W. FAN

WORK ORDER

HK2014798

CLIENT

: ENVIROTECH SERVICES CO.

: RM113, 1/F, MY LOFT, 9 HOI WING ROAD,

SUB-BATCH : 1

**ADDRESS** 

DATE RECEIVED : 21-APR-2020

TUEN MUN, N.T. HONG KONG

DATE OF ISSUE : 27-APR-2020

**PROJECT** 

NO. OF SAMPLES : 1

CLIENT ORDER

#### General Comments

- Sample(s) was/ were submitted by client. Sample(s) arrived laboratory in ambient condition. The result(s) related only to the
- Sample information (Project name, Sample ID, Sampling date/time, etc., if any) is provided by client.
- Calibration was subcontracted to and analysed by Action United Enviro Services.

## Signatories

This document has been signed by those names that appear on this report and are the authorised signatories

Signatories

Position

Kirland Jones Richard Fung

Managing Director

This is the Final Report and supersedes any preliminary report with this batch number.

All pages of this report have been checked and approved for release.

ALS Technichem (HK) Pty Ltd Part of the ALS Laboratory Group

11/F. Chung Shun Knitting Centre 1 - 3 Wing Yip Street Kwai Chung N.T. Hong Kong Tel. +852 2610 1044 Fax. +852 2610 2021 www.alsglobal.com

WORK ORDER

: HK2014798

SUB-BATCH

CLIENT

: 1 : ENVIROTECH SERVICES CO.

**PROJECT** 



ALS Lab	Client's Sample ID	Sample Type	Sample Date	External Lab Report No.	
HK2014798-001	S/N: 436553	Equipments	21-Apr-2020	S/N: 436553	

# **Equipment Verification Report (TSP)**

### **Equipment Calibrated:**

Type:

Laser Dust monitor

Manufacturer:

Sibata LD-3B

Serial No.

436553

Equipment Ref:

Nil

Job Order

HK2014798

## Standard Equipment:

Standard Equipment:

Higher Volume Sampler (TSP)

Location & Location ID:

AUES office (calibration room)

Equipment Ref:

HVS 018

Last Calibration Date:

9 March 2020

# **Equipment Verification Results:**

Verification Date:

23 April 2020

Hour	Time	Mean Temp °C	Mean Pressure (hPa)	Concentration in mg/m³ (Standard Equipment)	Total Count (Calibrated Equipment)	Count/Minute (Total Count/min)
2hr01min	09:23 ~ 11:24	20.6	1017.2	0.011	1429	11.8
2hr01min	11:28 ~ 13:29	20.6	1017.2	0.010	1559	12.9
2hr	13:35 ~ 15:35	20.6	1017.2	0.015	2028	16.9

# Linear Regression of Y or X

Slope (K-factor):

0.0009

Correlation Coefficient

0.9956

Date of Issue

27 April 2020

### Remarks:

- 1. Strong Correlation (R>0.8)
- 2. Factor 0.0009 should be applied for TSP monitoring

\*If R<0.5, repair or re-verification is required for the equipment

0.018 0.016 0.014 0.012 0.01 0.008 0.006 0.004 0.002 0 5 10 15 20

Operator : \_\_\_\_\_

Fai So

Signature:

Date: \_.\_

27 April 2020

QC Reviewer:

Ben Tam

Signature:

Data

27 April 2020

### TSP SAMPLER CALIBRATION CALCULATION SPREADSHEET

Location: Gold King Industrial Building, Kwai Chung Date of Calibration: 9-Mar-20
Location ID: Calibration Room Next Calibration Date: 9-Jun-20

#### CONDITIONS

Sea Level Pressure (hPa)
Temperature (°C)

1008.5 23.4 Corrected Pressure (mm Hg)
Temperature (K)

296

#### CALIBRATION ORIFICE

Make-> TISCH
Model-> 5025A
Calibration Date-> 7-Feb-20

Qstd Slope ->
Qstd Intercept ->
Expiry Date->

2.03014 -0.04616 7-Feb-21

#### **CALIBRATION**

	Plate	H20 (L)	H2O (R)	H20	Qstd	I	IC	LINEAR
	No.	(in)	(in)	(in)	(m3/min)	(chart)	corrected	REGRESSION
	18	6.1	6.1	12.2	1.744	55	55.02	Slope = 36.8508
	13	4.9	4.9	9.8	1.565	49	49.01	Intercept = -8.9222
ı	10	3.8	3.8	7.6	1.381	42	42.01	Corr. coeff. = 0.9997
	8	2.4	2.4	4.8	1.102	32	32.01	
	5	1.4	1.4	2.8	0.847	22	22.01	

#### Calculations:

Qstd = 1/m[Sqrt(H20(Pa/Pstd)(Tstd/Ta))-b]

IC = I[Sqrt(Pa/Pstd)(Tstd/Ta)]

Ostd = standard flow rate

IC = corrected chart respones

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration (deg K)

Pstd = actual pressure during calibration ( mm Hg )

### For subsequent calculation of sampler flow:

1/m(( I )[Sqrt(298/Tav)(Pav/760)]-b)


m = sampler slope

b = sampler intercept

I = chart response

Tav = daily average temperature

Pav = daily average pressure

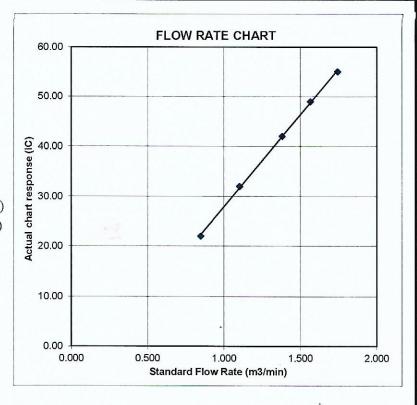



RECALIBRATION
DUE DATE:

February 7, 2021

# Certificate of Calibration

**Calibration Certification Information** 

Cal. Date: February 7, 2020

Rootsmeter S/N: 438320

Ta: 295

°K

mm Hg

Operator: Jim Tisch

Calibration Model #: TE-5025A

Calibrator S/N: 1612

Pa: 745.5

Run	Vol. Init (m3)	Vol. Final (m3)	ΔVol. (m3)	ΔTime (min)	ΔP (mm Hg)	ΔH (in Ĥ2O)
1	1	2	1	1.3730	3.2	2.00
2	3	4	1	0.9820	6.4	4.00
3	5	6	1	0.8780	8.0	5.00
4	7	8	1	0.8340	8.8	5.50
5	9	10	1	0.6900	12.8	8.00

		Data Tabula	tion		
Vstd	Qstd	$\sqrt{\Delta H \left(\frac{Pa}{Pstd}\right) \left(\frac{Tstd}{Ta}\right)}$		Qa	$\sqrt{\Delta H(Ta/Pa)}$
(m3)	(x-axis)	(y-axis)	Va	´ (x-axis)	(y-axis)
0.9866	0.7186	1.4078	0.9957	0.7252	0.8896
0.9824	1.0004	1.9909	0.9914	1.0096	1.2581
0.9802	1.1165	2.2259	0.9893	1.1267	1.4066
0.9792	1.1741	2.3345	0.9882	1.1849	1.4753
0.9739	1.4114	2.8155	0.9828	1.4244	1.7792
	m=	2.03014		m=	1.27124
QSTD	b=	-0.04616	QA	b=	-0.02917
	r=	0.99995		r=	0.99995

	Calculation	s	
Vstd=	ΔVol((Pa-ΔP)/Pstd)(Tstd/Ta)	Va=	ΔVol((Pa-ΔP)/Pa)
Qstd=	Qstd= Vstd/∆Time		Va/ΔTime
	For subsequent flow rat	e calculatio	ns:
Qstd=	$1/m\left(\left(\sqrt{\Delta H\left(\frac{Pa}{Pstd}\right)\left(\frac{Tstd}{Ta}\right)}\right)-b\right)$	Qa=	$1/m\left(\left(\sqrt{\Delta H(Ta/Pa)}\right)-b\right)$

	Standard Conditions
Tstd:	298.15 °K
Pstd:	760 mm Hg
ì	Key
ΔH: calibrator	manometer reading (in H2O)
ΔP: rootsmete	er manometer reading (mm Hg)
Ta: actual abs	olute temperature (°K)
Pa: actual bar	ometric pressure (mm Hg)
b: intercept	
m: slope	

### RECALIBRATION

US EPA recommends annual recalibration per 1998
40 Code of Federal Regulations Part 50 to 51,
Appendix B to Part 50, Reference Method for the
Determination of Suspended Particulate Matter in
the Atmosphere, 9.2.17, page 30

Tisch Environmental, Inc. 145 South Miami Avenue Village of Cleves, OH 45002

www.tisch-env.co

TOLL FREE: (877)263-761

FAX: (513)467-90(

# Annex E2

# Monitoring Schedule for Air Quality

# Tung Chung New Town Extension (East) Air Quality Monitoring Schedule (March 2021)

Sunday	Monday	Tuesday	Wednesday		Friday	Saturday
	1-Mar	2-Mar	3-Mar	4-Mar	5-Mar	6-Mar
	Air Quality Monitoring					Air Quality Monitoring
7-Mar	8-Mar	9-Mar	10-Mar	11-Mar	12-Mar	13-Mar
					Air Quality Monitoring	
14-Mar	15-Mar	16-Mar	17-Mar	18-Mar	19-Mar	20-Mar
				Air Quality Monitoring		
21-Mar	22-Mar	23-Mar	24-Mar	25-Mar	26-Mar	27-Mar
			Air Quality Monitoring			
28-Mar	29-Mar	30-Mar	31-Mar			
		Air Quality Monitoring				


# Annex E3

# Monitoring Results for Air Quality

Table E3 Data for 1-hr TSP Monitoring at Station DM-1

Date	Start Time	Finish Time	Weather	1-hour TSP (μg/m³)
01-03-21	13:57	14:57	Sunny	26
01-03-21	14:57	15:57	Sunny	50
01-03-21	15:57	16:57	Sunny	59
06-03-21	8:07	9:07	Sunny	57
06-03-21	9:07	10:07	Sunny	65
06-03-21	10:07	11:07	Sunny	44
12-03-21	8:12	9:12	Sunny	48
12-03-21	9:12	10:12	Sunny	43
12-03-21	10:12	11:12	Sunny	34
18-03-21	8:13	9:13	Cloudy	49
18-03-21	9:13	10:13	Cloudy	40
18-03-21	10:13	11:13	Cloudy	28
24-03-21	8:05	9:05	Cloudy	65
24-03-21	9:05	10:05	Cloudy	66
24-03-21	10:05	11:05	Cloudy	66
30-03-21	13:20	14:20	Sunny	49
30-03-21	14:20	15:20	Sunny	47
30-03-21	15:20	16:20	Sunny	49

Figure E3 Graphical Presentation for 1-hr TSP Monitoring at Station DM-1

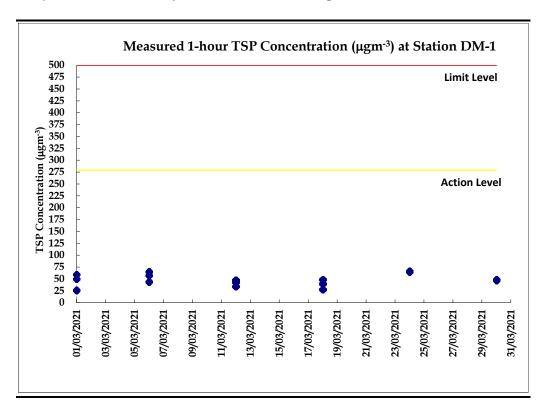

# Annex E4

# Event and Action Plan for Air Quality

Annex E4 Event and Action Plan for Air Quality

Event	Action							
Event	ET	IEC	ER	Contractor				
Action level exceedance for one sample	<ol> <li>Identify source, investigate the causes of exceedance and propose remedial measures;</li> <li>Inform IEC and ER;</li> <li>Repeat measurement to confirm finding;</li> <li>Increase monitoring frequency to daily.</li> </ol>	<ol> <li>Check monitoring data submitted by ET;</li> <li>Check Contractor's working method.</li> </ol>	1. Notify Contractor.	<ol> <li>Rectify any unacceptable practice;</li> <li>Amend working methods if appropriate.</li> </ol>				
Action level exceedance for two or more consecutive samples	<ol> <li>Identify source;</li> <li>Inform IEC and ER;</li> <li>Advise the ER on the effectiveness of the proposed remedial measures;</li> <li>Repeat measurements to confirm findings;</li> <li>Increase monitoring frequency to daily;</li> <li>Discuss with IEC and Contractor on remedial actions required;</li> <li>If exceedance continues, arrange meeting with IEC and ER;</li> <li>If exceedance stops, cease additional monitoring.</li> </ol>	<ol> <li>Check monitoring data submitted by ET;</li> <li>Check Contractor's working method;</li> <li>Discuss with ET and Contractor on possible remedial measures;</li> <li>Advise the ET on the effectiveness of the proposed remedial measures;</li> <li>Supervise Implementation of remedial measures.</li> </ol>	<ul><li>failure in writing;</li><li>2. Notify Contractor;</li><li>3. Ensure remedial measures properly implemented.</li></ul>	<ol> <li>Submit proposals for remedial to ER within 3 working days of notification;</li> <li>Implement the agreed proposals;</li> <li>Amend proposal if appropriate.</li> </ol>				

Frank	Action						
Event	ET	IEC	ER	Contractor			
Limit level exceedance for one sample	<ol> <li>Identify source, investigate the causes of exceedance and propose remedial measures;</li> <li>Inform ER, Contractor and EPD;</li> <li>Repeat measurement to confirm finding;</li> <li>Increase monitoring frequency to daily;</li> <li>Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and ER informed of the results.</li> </ol>	<ol> <li>Check monitoring data submitted by ET;</li> <li>Check Contractor's working method;</li> <li>Discuss with ET and Contractor on possible remedial measures;</li> <li>Advise the ER on the effectiveness of the proposed remedial measures;</li> <li>Supervise implementation of remedial measures.</li> </ol>	<ul><li>failure in writing;</li><li>2. Notify Contractor;</li><li>3. Ensure remedial measures properly implemented.</li></ul>	<ol> <li>Take immediate action to avoid further exceedance;</li> <li>Submit proposals for remedial actions to IEC within 3 working days of notification;</li> <li>Implement the agreed proposals;</li> <li>Amend proposal if appropriate.</li> </ol>			
Limit level exceedance for two or more consecutive samples	<ol> <li>Notify IEC, ER, Contractor and EPD;</li> <li>Identify source;</li> <li>Repeat measurement to confirm findings;</li> <li>Increase monitoring frequency to daily;</li> <li>Carry out analysis of Contractor's working procedures to determine possible mitigation to be implemented;</li> <li>Arrange meeting with IEC and ER to discuss the remedial actions to be taken;</li> <li>Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and ER informed of the results;</li> <li>If exceedance stops, cease additional monitoring.</li> </ol>	<ol> <li>Discuss amongst ER, ET, and Contractor on the potential remedial actions;</li> <li>Review Contractor's remedial actions whenever necessary to assure their effectiveness and advise the ER accordingly;</li> <li>Supervise the implementation of remedial measures.</li> </ol>	<ol> <li>Confirm receipt of notification of failure in writing;</li> <li>Notify Contractor;</li> <li>In consultation with the IEC, agree with the Contractor on the remedial measures to be implemented;</li> <li>Ensure remedial measures properly implemented;</li> <li>If exceedance continues, consider what portion of the work is responsible and instruct the Contractor to stop that portion of work until the exceedance is abated.</li> </ol>	<ol> <li>Take immediate action to avoid further exceedance;</li> <li>Submit proposals for remedial actions to IEC within 3 working days of notification;</li> <li>Implement the agreed proposals;</li> <li>Resubmit proposals if problem still not under control;</li> <li>Stop the relevant portion of works as determined by the ER until the exceedance is abated.</li> </ol>			

Annex F

Noise

# Annex F1

# Calibration Certificates for Noise



#### Sun Creation Engineering Limited

Calibration & Testing Laboratory

# Certificate of Calibration 校下證書

C203474

證書編號

Certificate No.:

· ITEM TESTED / 送檢項目 (Job No. / 序引編號: IC20-1282)

Date of Receipt / 收件日期: 15 June 2020

Description / 儀器名稱

Precision Acoustic Calibrator

Manufacturer / 製造商

LARSON DAVIS

Model No. / 型號

CAL200

Serial No. / 編號

16878

Supplied By / 委託者

Envirotech Services Co.

Room 113, 1/F, My Loft, 9 Hoi Wing Road, Tuen Mun,

New Territories, Hong Kong

TEST CONDITIONS/測試條件

Temperature / 溫度 : Line Voltage / 電壓 :  $(23 \pm 2)^{\circ}$ C

Relative Humidity / 相對濕度 :  $(50 \pm 25)\%$ 

TEST SPECIFICATIONS / 測試規範

Calibration check

DATE OF TEST / 測試日期

23 June 2020

TEST RESULTS / 測試結果

The results apply to the particular unit-under-test only.

The results do not exceed manufacturer's specification.

The results are detailed in the subsequent page(s).

The test equipment used for calibration are traceable to National Standards via:

- The Government of The Hong Kong Special Administrative Region Standard & Calibration Laboratory
- Agilent Technologies / Keysight Technologies
- Fluke Everett Service Center, USA
- The Bruel & Kjaer Calibration Laboratory, Denmark

Tested By

測試

K P Cheuk Assistant Engineer

Certified By 核證

K C Lee Engineer Date of Issue 簽發日期

29 June 2020

The test equipment used for calibration is traceable to the National Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗所書面批准。

Sun Creation Engineering Limited - Calibration & Testing Laboratory c/o 4/F, 1 Hing On Lane, Tuen Mun, New Territories, Hong Kong 輝創工程有限公司 - 校正及檢測實驗所 c/o 香港新界屯門興安里一號四樓 Tel/電話: (852) 2927 2606 Fax/傳真: (852) 2744 8986



#### Sun Creation Engineering Limited

Calibration & Testing Laboratory

# Certificate of Calibration

Certificate No.: C203474

證書編號

校正證書

The unit-under-test (UUT) was allowed to stabilize in the laboratory for over 12 hours before the commencement of the test.

2. The results presented are the mean of 3 measurements at each calibration point.

3. Test equipment:

> **Equipment ID** CL130 CL281 TST150A

Description Certificate No. Universal Counter C193756 Multifunction Acoustic Calibrator CDK1806821 Measuring Amplifier C201309

4. Test procedure: MA100N.

5. Results:

5.1 Sound Level Accuracy

UUT Nominal Value	Measured Value (dB)	Mfr's Spec. (dB)	Uncertainty of Measured Value (dB)
94 dB, 1 kHz	93.9	± 0.2	± 0.2
114 dB, 1 kHz	113.9		

Frequency Accuracy

UUT Nominal Value (kHz)	Measured Value (kHz)	Mfr's Spec.	Uncertainty of Measured Value (Hz)
1	1.000	1 kHz ± 1 %	± 1

Remark: The uncertainties are for a confidence probability of not less than 95 %.

Only the original copy or the laboratory's certified true copy is valid.

The values given in this Certificate only relate to the values measured at the time of the test and any uncertainties quoted will not include allowance for the equipment long term drift, variations with environment changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measurement. Sun Creation Engineering Limited shall not be liable for any loss or damage resulting from the use of the equipment.

The test equipment used for calibration is traceable to the National Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗所書面批准。



## Sun Creation Engineering Limited

Calibration & Testing Laboratory

# Certificate of Calibration 校正證書

Certificate No.: C202701

證書編號

· ITEM TESTED / 送檢項目 (Job No. / 序引編號: IC20-0981)

Date of Receipt / 收件日期: 7 May 2020

Description / 儀器名稱

Sound Level Meter

Manufacturer / 製造商

Rion

Model No. / 型號

NL-52 00643039

Serial No./編號 Supplied By / 委託者

Envirotech Services Co.

Room 113, 1/F, My Loft, 9 Hoi Wing Road, Tuen Mun,

New Territories, Hong Kong

TEST CONDITIONS / 測試條件

Temperature / 溫度 :

 $(23 \pm 2)^{\circ}$ C

Relative Humidity / 相對濕度 :

 $(50 \pm 25)\%$ 

Line Voltage / 電壓 :

TEST SPECIFICATIONS / 測試規範

Calibration

DATE OF TEST / 測試日期

18 May 2020

TEST RESULTS / 測試結果

The results apply to the particular unit-under-test only.

The results do not exceed manufacturer's specification. (after adjustment)

The results are detailed in the subsequent page(s).

The test equipment used for calibration are traceable to National Standards via:

- The Government of The Hong Kong Special Administrative Region Standard & Calibration Laboratory
- The Bruel & Kjaer Calibration Laboratory, Denmark
- Agilent Technologies / Keysight Technologies
- Fluke Everett Service Center, USA

Tested By

測試

K P Cheuk

Assistant Engineer

Certified By

Lee Engineer Date of Issue 簽發日期

22 May 2020

核證

The test equipment used for calibration is traceable to the National Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗所書面批准。



## Sun Creation Engineering Limited

Calibration & Testing Laboratory

# Certificate of Calibration

校正證書

Certificate No.: C202701

證書編號

- 1. The unit-under-test (UUT) was allowed to stabilize in the laboratory for over 12 hours, and switched on to warm up for over 10 minutes before the commencement of the test.
- 2. Self-calibration using the internal standard (After Adjustment) was performed before the test 6.1.1.2 to 6.3.2.
- 3. The results presented are the mean of 3 measurements at each calibration point.
- 4. Test equipment:

Equipment ID

Description

Certificate No.

CL280 CL281 40 MHz Arbitrary Waveform Generator

C200258

Multifunction Acoustic Calibrator

CDK1806821

- 5. Test procedure: MA101N.
- 6. Results:
- 6.1 Sound Pressure Level
- 6.1.1 Reference Sound Pressure Level

6.1.1.1 Before Adjustment

	UUT	Setting	Market Committee of the	Applie	d Value	UUT	IEC 61672
Range	Function	Frequency	Time	Level	Freq.	Reading	Class 1 Spec.
(dB)		Weighting	Weighting	(dB)	(kHz)	(dB)	(dB)
30 - 130	L <sub>A</sub>	A	Fast	94.00	1	* 97.3	± 1.1

<sup>\*</sup> Out of IEC 61672 Class 1 Spec.

6.1.1.2 After Adjustment

	UUT	Setting		Applie	d Value	UUT	IEC 61672
Range (dB)	Function	Frequency Weighting	Time Weighting	Level (dB)	Freq. (kHz)	Reading (dB)	Class 1 Spec. (dB)
30 - 130	L <sub>A</sub>	A	Fast	94.00	1	94.0	± 1.1

6.1.2 Linearity

	UU'	T Setting		Applie	d Value	UUT
Range (dB)	Function	Frequency Weighting	Time Weighting	Level (dB)	Freq. (kHz)	Reading (dB)
30 - 130	$L_{A}$	A	Fast	94.00 104.00	• 1	94.0 (Ref.) 104.0
	16,			114.00		114.0

IEC 61672 Class 1 Spec. :  $\pm$  0.6 dB per 10 dB step and  $\pm$  1.1 dB for overall different.

The test equipment used for calibration is traceable to the National Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗所書面批准。



Sun Creation Engineering Limited

Calibration & Testing Laboratory

# Certificate of Calibration 校正證書

Certificate No.:

C202701

證書編號

6.2 Time Weighting

	רטט	Setting		Applie	d Value	UUT	IEC 61672
Range (dB)	Function	Frequency Weighting	Time Weighting	Level (dB)	Freq. (kHz)	Reading (dB)	Class 1 Spec. (dB)
30 - 130	$L_{A}$	A	Fast	94.00	1	94.0	Ref.
			Slow			94.0	$\pm 0.3$

#### 6.3 Frequency Weighting

6.3.1 A-Weighting

	UUT	Setting		Appl	ied Value	UUT	IEC 61672
Range (dB)	Function	Frequency Weighting	Time Weighting	Level (dB)	Freq.	Reading (dB)	Class 1 Spec. (dB)
30 - 130	L <sub>A</sub>	A	Fast	94.00	63 Hz	67.7	$-26.2 \pm 1.5$
					125 Hz	77.8	$-16.1 \pm 1.5$
					250 Hz	85.3	-8.6 ± 1.4
					500 Hz	90.8	$-3.2 \pm 1.4$
					1 kHz	94.0	Ref.
					2 kHz	95.3	$+1.2 \pm 1.6$
					4 kHz	95.1	$+1.0 \pm 1.6$
					8 kHz	93.0	-1.1 (+2.1; -3.1)
					12.5 kHz	89.6	-4.3 (+3.0; -6.0)

6.3.2 C-Weighting

	UUT	Setting		Appl	ied Value	UUT	IEC 61672
Range (dB)	Function	Frequency Weighting	Time Weighting	Level (dB)	Freq.	Reading (dB)	Class 1 Spec. (dB)
30 - 130	L <sub>C</sub>	C	Fast	94.00	63 Hz	93.2	$-0.8 \pm 1.5$
					125 Hz	93.9	$-0.2 \pm 1.5$
					250 Hz	94.0	$0.0 \pm 1.4$
				- 7	500 Hz	94.0	$0.0 \pm 1.4$
					1 kHz	94.0	Ref.
					2 kHz	93.9	$-0.2 \pm 1.6$
					4 kHz	93.2	$-0.8 \pm 1.6$
					8 kHz	91.1	-3.0 (+2.1; -3.1)
					12.5 kHz	87.7	-6.2 (+3.0; -6.0)

The test equipment used for calibration is traceable to the National Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory

Website/網址: www.suncreation.com

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗所書面批准。



# Sun Creation Engineering Limited

Calibration & Testing Laboratory

# Certificate of Calibration 校正證書

Certificate No.: C202701

證書編號

Remarks: - UUT Microphone Model No.: UC-59 & S/N: 12128

- Mfr's Spec. : IEC 61672 Class 1

- Uncertainties of Applied Value : 94 dB : 63 Hz - 125 Hz :  $\pm$  0.35 dB

104 dB : 1 kHz :  $\pm$  0.10 dB (Ref. 94 dB) 114 dB : 1 kHz :  $\pm$  0.10 dB (Ref. 94 dB)

- The uncertainties are for a confidence probability of not less than 95 %.

#### Note:

Only the original copy or the laboratory's certified true copy is valid.

The values given in this Certificate only relate to the values measured at the time of the test and any uncertainties quoted will not include allowance for the equipment long term drift, variations with environment changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measurement. Sun Creation Engineering Limited shall not be liable for any loss or damage resulting from the use of the equipment.

The test equipment used for calibration is traceable to the National Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.

本證書所載校正用之測試器材均可溯源至國際標準。 局部複印本證書需先獲本實驗所書面批准。

# Annex F2

# Monitoring Schedule for Noise

# Tung Chung New Town Extension (East) Noise Monitoring Schedule (March 2021)

Sunday	Monday	Tuesday		Thursday	Friday	Saturday
	1-Mar	2-Mar	3-Mar			
	Noise Monitoring					Noise Monitoring
7-Ma	8-Mar	9-Mar	10-Mar	11-Mar	12-Mar	13-Mar
					Noise Monitoring	
14-Ma	15-Mar	16-Mar	17-Mar	18-Mar	19-Mar	20-Mar
				Noise Monitoring		
21-Ma	22-Mar	23-Mar	24-Mar	25-Mar	26-Mar	27-Mar
			Noise Monitoring			
28-Ma	29-Mar	30-Mar	31-Mar			
		Noise Monitoring				

# Annex F3

# Monitoring Results for Noise

Table F3.1 Data for Noise Monitoring at Station NMS-CA-1A during Normal Working Hours (0700-1900 hours)

Date & Time	L <sub>eq (5min)</sub>	L <sub>10</sub>	L <sub>90</sub>	L <sub>eq (30min)</sub>
01-03-21 14:44	60.8	64.1	55.8	
01-03-21 14:49	63.9	66.9	56.6	1
01-03-21 14:54	62.5	65.3	57.4	20.0
01-03-21 14:59	62.5	65.0	58.4	62.9
01-03-21 15:04	63.9	66.3	58.4	
01-03-21 15:09	63.3	66.5	58.6	1
06-03-21 8:53	64.4	67.3	59.1	
06-03-21 8:58	63.3	65.3	59.2	1
06-03-21 9:03	65.3	68.2	59.1	04.0
06-03-21 9:08	64.6	67.4	59.2	64.9
06-03-21 9:13	65.5	68.0	60.4	1
06-03-21 9:18	65.8	68.3	60.1	1
12-03-21 8:43	65.3	69.4	59.5	
12-03-21 8:48	64.1	67.7	57.4	1
12-03-21 8:53	64.6	67.7	57.1	04.0
12-03-21 8:58	64.7	67.7	57.4	64.6
12-03-21 9:03	63.3	67.1	58.1	1
12-03-21 9:08	65.2	69.0	57.5	1
17-03-21 9:15	66.7	69.7	58.8	
17-03-21 9:20	65.6	69.3	56.8	1
17-03-21 9:25	64.9	68.3	56.7	6F 7
17-03-21 9:30	66.1	69.8	58.9	65.7
17-03-21 9:35	64.9	68.9	58.8	1
17-03-21 9:40	66.0	68.2	56.9	1
23-03-21 8:42	66.6	69.2	62.0	
23-03-21 8:47	65.3	68.2	60.8	1
23-03-21 8:52	63.8	65.6	60.4	65.0
23-03-21 8:57	65.3	67.6	62.3	65.0
23-03-21 9:02	63.8	66.0	61.2	1
23-03-21 9:07	64.5	66.9	61.1	1
28-03-21 13:49	66.7	69.8	60.8	
28-03-21 13:54	65.0	66.8	60.3	
28-03-21 13:59	65.1	67.0	61.0	65.3
28-03-21 14:04	65.3	67.9	59.3	00.5
28-03-21 14:09	62.1	64.4	58.0	
28-03-21 14:14	66.2	69.1	60.6	

Figure F3.1 Graphical Presentation for Noise Monitoring at Station NMS-CA-1A


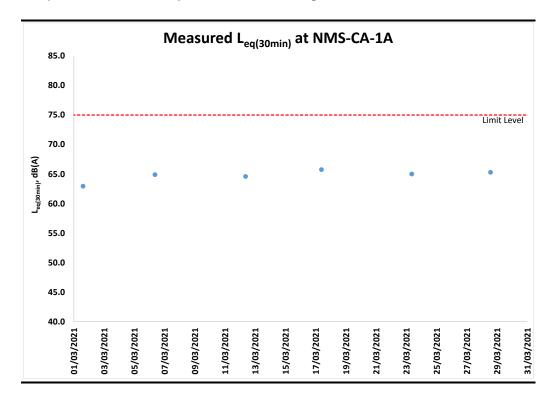


Table F3.2 Data for Noise Monitoring at Station NMS-CA-4 during Normal Working Hours (0700-1900 hours)

Date & Time	L <sub>eq (5min)</sub>	L <sub>10</sub>	L <sub>90</sub>	L <sub>eq (30min)</sub>
01-03-21 13:54	68.6	71.6	65.0	
01-03-21 13:59	67.1	68.7	64.8	1
01-03-21 14:04	68.3	70.2	65.8	00.0
01-03-21 14:09	68.4	69.6	66.0	68.2
01-03-21 14:14	68.3	69.6	66.9	]
01-03-21 14:19	68.3	70.1	65.4	]
06-03-21 10:45	67.2	69.3	64.3	
06-03-21 10:50	66.6	68.4	63.8	1
06-03-21 10:55	68.5	70.6	64.9	00.4
06-03-21 11:00	68.2	70.6	63.9	68.4
06-03-21 11:05	69.7	71.9	66.6	1
06-03-21 11:10	69.4	71.6	66.6	1
12-03-21 8:08	65.8	68.9	61.4	
12-03-21 8:13	72.5	76.4	65.2	]
12-03-21 8:18	71.3	74.8	66.6	70.7
12-03-21 8:23	72.2	76.1	66.5	1 /0./
12-03-21 8:28	71.1	73.8	67.1	]
12-03-21 8:33	67.7	70.4	61.2	]
17-03-21 8:16	68.2	72.2	61.1	
17-03-21 8:21	66.0	69.2	61.4	]
17-03-21 8:26	67.8	70.4	62.8	67.8
17-03-21 8:31	68.8	71.7	64.8	67.8
17-03-21 8:36	68.0	70.9	63.0	1
17-03-21 8:41	67.8	70.1	63.7	1
23-03-21 7:53	65.2	68.4	61.2	
23-03-21 7:58	61.8	63.1	60.3	
23-03-21 8:03	66.2	67.4	64.8	65.2
23-03-21 8:08	66.3	68.0	64.1	65.2
23-03-21 8:13	66.0	67.4	63.7	1
23-03-21 8:18	64.2	65.5	62.6	1
28-03-21 13:01	64.4	68.0	59.3	
28-03-21 13:06	64.6	67.7	59.7	
28-03-21 13:11	59.4	60.5	58.0	62.4
28-03-21 13:16	60.7	62.7	58.5	02.7
28-03-21 13:21	60.7	62.4	58.3	
28-03-21 13:26	62.1	64.3	58.9	

Figure F3.2 Graphical Presentation for Noise Monitoring at Station NMS-CA-4

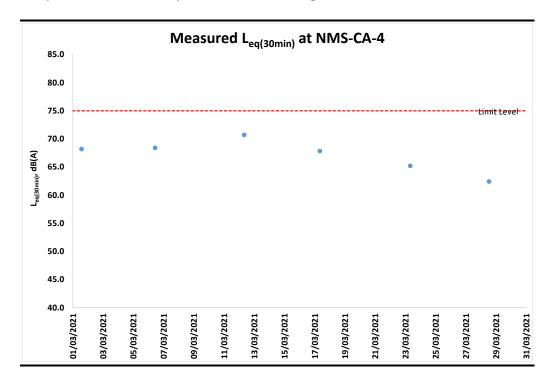

# Annex F4

# Event and Action Plan for Noise

Annex F4 Event and Action Plan for Construction Noise

Event		Actio	n	
Event	ET	IEC	ER	Contractor
Action Level Exceedance	Notify IEC, ER and Contractor;     Carry out investigation;	1. Review the analysed results submitted by the ET;	Confirm receipt of notification of failure in writing;	1. Submit noise mitigation proposals to IEC and ER;
	<ul><li>3. Report the results of investigation to the IEC, ER and Contractor;</li><li>4. Discuss with the Contractor and formulate remedial measures;</li><li>5. Increase monitoring frequency to check mitigation effectiveness.</li></ul>	<ul><li>2. Review the proposed remedial measures by the Contractor and advise the ER accordingly;</li><li>3. Supervise the implementation of remedial measures.</li></ul>	<ol> <li>Notify Contractor;</li> <li>Require Contractor to propose remedial measures for the analysed noise problem;</li> <li>Ensure remedial measures are properly implemented</li> </ol>	2. Implement noise mitigation proposals.
Limit Level Exceedance	<ol> <li>Identify source;</li> <li>Inform IEC, ER, EPD and Contractor;</li> <li>Repeat measurements to confirm findings;</li> <li>Increase monitoring frequency;</li> <li>Carry out analysis of Contractor's working procedures to determine possible mitigation to be implemented;</li> <li>Inform IEC, ER and EPD the causes and actions taken for the exceedances;</li> <li>Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and ER informed of the results;</li> <li>If exceedance stops, cease additional monitoring.</li> </ol>	<ol> <li>Discuss amongst ER, ET, and Contractor on the potential remedial actions;</li> <li>Review Contractors remedial actions whenever necessary to assure their effectiveness and advise the ER accordingly;</li> <li>Supervise the implementation of remedial measures.</li> </ol>	<ol> <li>Confirm receipt of notification of failure in writing;</li> <li>Notify Contractor;</li> <li>Require Contractor to propose remedial measures for the analysed noise problem;</li> <li>Ensure remedial measures properly implemented;</li> <li>If exceedance continues, consider what portion of the work is responsible and instruct the Contractor to stop that portion of work until the exceedance is abated.</li> </ol>	<ol> <li>Take immediate action to avoid further exceedance;</li> <li>Submit proposals for remedial actions to IEC within 3 working days of notification;</li> <li>Implement the agreed proposals;</li> <li>Resubmit proposals if problem still not under control;</li> <li>Stop the relevant portion of works as determined by the ER until the exceedance is abated.</li> </ol>

ENVIRONMENTAL RESOURCES MANAGEMENT

CIVIL ENGINEERING AND DEVELOPMENT DEPARTMENT

# Annex G

# Water Quality

# Annex G1

# Calibration Certificates for Water Quality

Tel: (852) 3956 8717; Fax: (852) 3956 3928

REPORT OF EQUIPMENT PERFORMANCE CHECK/ CALIBRATION

Report No.

BA010040

Date of Issue

18 January 2021

Page No.

1 of 2

#### PART A - CUSTOMER INFORMATION

Enovative Environmental Service Ltd. Flat 2207, Yu Fun House, Yu Chui Court, Shatin

New Territories, Hong Kong Attn: Mr. Thomas WONG

#### PART B - DESCRIPTION

Name of Equipment

YSI ProDSS (Multi-Parameters)

Manufacturer

YSI (a xylem brand)

Serial Number

15M100005

Date of Received

Jan 18, 2021

Date of Calibration

Jan 18, 2021

Date of Next Calibration(a)

Apr 17, 2021

### PART C - REFERENCE METHODS/ DOCUMENTS FOR THE CALIBRATION

**Parameter** 

Reference Method

pH at 25°C

APHA 21e 4500-H<sup>+</sup> B APHA 21e 4500-O G

Dissolved Oxygen Conductivity at 25°C

APHA 21e 2510 B

Salinity

APHA 21e 2520 B

Turbidity

APHA 21e 2130 B

Temperature

Section 6 of international Accreditation New Zealand Technical

Guide no. 3 Second edition March 2008: Working Thermometer Calibration Procedure.

#### PART D - CALIBRATION RESULTS(b,c)

#### (1) pH at 25°C

Target (pH unit)	Displayed Reading(d) (pH Unit)	Tolerance <sup>(e)</sup> (pH Unit)	Results
4.00	4.04	0.04	Satisfactory
7.42	7.43	0.01	Satisfactory
10.01	9.91	-0.10	Satisfactory

Tolerance of pH should be less than ±0.20 (pH unit)

#### (2) Temperature

Reading of Ref. thermometer (°C)	Displayed Reading (°C)	Tolerance (°C)	Results
15	15.0	0.0	Satisfactory
30	29.9	-0.1	Satisfactory
40	41.0	1.0	Satisfactory

Tolerance limit of temperature should be less than ±2.0 (°C)

#### ~ CONTINUED ON NEXT PAGE ~

#### Remark(s): -

(a) The "Date of Next Calibration" is recommended according to best practice principals as practiced by QPT or quoted form relevant international standards.

(b) The results relate only to the calibrated equipment as received

(c) The performance of the equipment stated in this report is checked with independent reference material and results compared against a calibrated secondary source.

(d) "Displayed Reading" denotes the figure shown on item under calibration/ checking regardless of equipment precision or significant figures.

(e) The "Tolerance Limit" mentioned is the acceptance criteria applicable for similar equipment used by Quality Pro Test-Consult Ltd. or quoted form relevant international standards..

LEE Chun-ning, Desmond Senior Chemist



專業化驗有限公司 QUALITY PRO TEST-CONSULT LIMITED

Unit 10, 14/F, Wah Wai Centre, 38-40 Au Pui Wan St., Fotan, Hong Kong Email: info@qualityprotest.com; Website: www.qualityprotest.com Tel: (852) 3956 8717; Fax: (852) 3956 3928

# REPORT OF EQUIPMENT PERFORMANCE CHECK/ CALIBRATION

Report No.

: BA010040

Date of Issue

18 January 2021

Page No.

2 of 2

## PART D - CALIBRATION RESULTS (Cont'd)

#### (3) Dissolved Oxygen

Expected Reading (mg/L)	Displayed Reading (mg/L)	Tolerance (mg/L)	Results
1.37	1.42	0.05	Satisfactory
4.90	4.91	0.01	Satisfactory
6.88	6.90	0.02	Satisfactory
8.58	8.78	0.20	Satisfactory

Tolerance limit of dissolved oxygen should be less than ±0.50 (mg/L)

#### (4) Conductivity at 25°C

Conc. of KCl (M)	Expected Reading (µS/cm)	Displayed Reading (μS/cm)	Tolerance (%)	Results
0.001	146.9	149.5	1.77	Satisfactory
0.01	1412	1387	-1.77	Satisfactory
0.1	12890	12927	0.29	Satisfactory
0.5	58670	57334	-2.28	Satisfactory
1.0	111900	112918	0.91	Satisfactory

Tolerance limit of conductivity should be less than  $\pm 10.0$  (%)

#### (5) Salinity

Expected Reading (g/L)	Displayed Reading (g/L)	Tolerance (%)	Results
10	10.03	0.30	Satisfactory
20	20.11	0.55	Satisfactory
30	31.15	3.83	Satisfactory

Tolerance limit of salinity should be less than  $\pm 10.0$  (%)

### (6) Turbidity

Expected Reading (NTU)	Displayed Reading <sup>(f)</sup> (NTU)	Tolerance <sup>(g)</sup> (%)	Results
0	0.05	==:	Satisfactory
10	10.09	0.9	Satisfactory
20	21.04	5.2	Satisfactory
100	104.68	4.7	Satisfactory
800	806.11	0.8	Satisfactory

Tolerance limit of turbidity should be less than  $\pm 10.0$  (%)

~ END OF REPORT ~

Remark(s): -

<sup>&</sup>quot;Displayed Reading" presents the figures shown on item under calibration/ checking regardless of equipment precision or significant figures.

The "Tolerance Limit" mentioned is the acceptance criteria applicable for similar equipment used by Quality Pro Test-Consult Ltd. or quoted form relevant international standards.



# 專業化驗有限公司 OUALITY PRO TEST-CONSULT LIMITED

Unit 10, 14/F, Wah Wai Centre, 38-40 Au Pui Wan St., Fotan, Hong Kong Email: info@qualityprotest.com; Website: www.qualityprotest.com Tel: (852) 3956 8717; Fax: (852) 3956 3928

# REPORT OF EQUIPMENT PERFORMANCE CHECK/ CALIBRATION

Report No.

BA030094

Date of Issue

26 March 2021

Page No.

1 of 2

#### PART A - CUSTOMER INFORMATION

Enovative Environmental Service Ltd. Flat 2207, Yu Fun House, Yu Chui Court, Shatin New Territories, Hong Kong Attn: Mr. Thomas WONG

#### PART B - DESCRIPTION

Name of Equipment

YSI ProDSS (Multi-Parameters)

Manufacturer

YSI (a xylem brand)

Serial Number

15M100005

Date of Received

Mar 25, 2021

Date of Calibration

Mar 25, 2021

Date of Next Calibration(a)

Jun 24, 2021

#### PART C – REFERENCE METHODS/ DOCUMENTS FOR THE CALIBRATION

**Parameter** 

Reference Method

pH at 25°C

APHA 21e 4500-H<sup>+</sup> B APHA 21e 4500-O G

Dissolved Oxygen Conductivity at 25°C

APHA 21e 2510 B

Salinity

APHA 21e 2520 B APHA 21e 2130 B

Turbidity Temperature

Section 6 of international Accreditation New Zealand Technical

Guide no. 3 Second edition March 2008: Working Thermometer Calibration Procedure.

# PART D - CALIBRATION RESULTS(b,c)

#### (1) pH at 25°C

Target (pH unit)	Displayed Reading(d) (pH Unit)	Tolerance <sup>(e)</sup> (pH Unit)	Results
4.00	4.02	0.02	Satisfactory
7.42	7.38	-0.04	Satisfactory
10.01	10.30	0.29	Satisfactory

Tolerance of pH should be less than ±0.20 (pH unit)

### (2) Temperature

Reading of Ref. thermometer (°C)	Displayed Reading (°C)	Tolerance (°C)	Results
10	10.4	0.4	Satisfactory
20	20.1	0.1	Satisfactory
48	48.3	0.3	Satisfactory

Tolerance limit of temperature should be less than ±2.0 (°C)

#### ~ CONTINUED ON NEXT PAGE ~

## Remark(s): -

(a) The "Date of Next Calibration" is recommended according to best practice principals as practiced by QPT or quoted form relevant international standards.

(b) The results relate only to the calibrated equipment as received

(c) The performance of the equipment stated in this report is checked with independent reference material and results compared against a calibrated secondary source.

(d) "Displayed Reading" denotes the figure shown on item under calibration/checking regardless of equipment precision or significant figures.

LEE Chun-ning, Desmond Senior Chemist

Disputed teating deficient in the acceptance criteria applicable for similar equipment used by Quality Pro Test-Consult Ltd. or quoted form relevant international standards.



# 專業化驗有限公司 QUALITY PRO TEST-CONSULT LIMITED

Unit 10, 14/F, Wah Wai Centre, 38-40 Au Pui Wan St., Fotan, Hong Kong Email: info@qualityprotest.com; Website: www.qualityprotest.com Tel: (852) 3956 8717; Fax: (852) 3956 3928

# REPORT OF EQUIPMENT PERFORMANCE CHECK/ CALIBRATION

Report No.

: BA030094

Date of Issue

26 March 2021

Page No.

: 2 of 2

### PART D - CALIBRATION RESULTS (Cont'd)

#### (3) Dissolved Oxygen

Expected Reading (mg/L)	Displayed Reading (mg/L)	Tolerance (mg/L)	Results
0.36	0.28	-0.08	Satisfactory
2.81	2.58	-0.23	Satisfactory
5.45	5.72	0.27	Satisfactory
8.40	8.64	0.24	Satisfactory

Tolerance limit of dissolved oxygen should be less than  $\pm 0.50$  (mg/L)

#### (4) Conductivity at 25°C

Conc. of KCl (M)	Expected Reading (µS/cm)	Displayed Reading (μS/cm)	Tolerance (%)	Results
0.001	146.9	152.1	3.54	Satisfactory
0.01	1412	1278	-9.49	Satisfactory
0.1	12890	12810	-0.62	Satisfactory
0.5	58670	59234	0.96	Satisfactory
1.0	111900	114225	2.08	Satisfactory

Tolerance limit of conductivity should be less than ±10.0 (%)

### (5) Salinity

Expected Reading (g/L)	Displayed Reading (g/L)	Tolerance (%)	Results
10	9.8	-2.00	Satisfactory
20	20.5	2.50	Satisfactory
30	29.8	-0.67	Satisfactory

Tolerance limit of salinity should be less than  $\pm 10.0$  (%)

# (6) Turbidity

Expected Reading (NTU)	Displayed Reading <sup>(f)</sup> (NTU)	Tolerance <sup>(g)</sup> (%)	Results
0	0.05		Satisfactory
10	9.8	-1.6	Satisfactory
20	18.9	-5.7	Satisfactory
100	96.4	-3.6	Satisfactory
800	822	2.8	Satisfactory

Tolerance limit of turbidity should be less than  $\pm 10.0$  (%)

Remark(s): -

<sup>~</sup> END OF REPORT ~

<sup>(</sup>In the second of the second o

<sup>(8)</sup> The "Tolerance Limit" mentioned is the acceptance criteria applicable for similar equipment used by Quality Pro Test-Consult Ltd. or quoted form relevant international standards.



Email: info@qualityprotest.com; Website: www.qualityprotest.com

Tel: (852) 3956 8717; Fax: (852) 3956 3928

### REPORT OF EQUIPMENT PERFORMANCE CHECK/ CALIBRATION

Report No.

BA030005

Date of Issue

01 March 2021

Page No.

1 of 2

#### PART A - CUSTOMER INFORMATION

Enovative Environmental Service Ltd.

Flat 2207. Yu Fun House, Yu Chui Court, Shatin New Territories, Hong Kong

Attn: Mr. Thomas WONG

#### PART B - DESCRIPTION

Name of Equipment

YSI ProDSS (Multi-Parameters)

Manufacturer

YSI (a xylem brand)

Serial Number

16H104233

Date of Received

Feb 25, 2021

Date of Calibration

Feb 25, 2021

Date of Next Calibration(a)

May 24, 2021

#### PART C – REFERENCE METHODS/ DOCUMENTS FOR THE CALIBRATION

Parameter

pH at 25°C

APHA 21e 4500-H+ B

Dissolved Oxygen

APHA 21e 4500-O G

Conductivity at 25°C

APHA 21e 2510 B APHA 21e 2520 B

Reference Method

Salinity Turbidity

APHA 21e 2130 B

Temperature

Section 6 of international Accreditation New Zealand Technical

Guide no. 3 Second edition March 2008: Working Thermometer Calibration Procedure.

#### PART D - CALIBRATION RESULTS(b,c)

#### (1) pH at 25°C

Target (pH unit)	Displayed Reading(d) (pH Unit)	Tolerance <sup>(e)</sup> (pH Unit)	Results
4.00	4.03	0.03	Satisfactory
7.42	7.44	0.02	Satisfactory
10.01	9.90	-0.11	Satisfactory

Tolerance of pH should be less than ±0.20 (pH unit)

#### (2) Temperature

Reading of Ref. thermometer	Displayed Reading (°C)	Tolerance (°C)	Results
10	10.0	0.0	Satisfactory
21	20.7	-0.3	Satisfactory
41	40,9	-0.1	Satisfactory

Tolerance limit of temperature should be less than ±2.0 (°C)

~ CONTINUED ON NEXT PAGE ~

#### Remark(s): -

The "Date of Next Calibration" is recommended according to best practice principals as practiced by QPT or quoted form relevant international standards.

The results relate only to the calibrated equipment as received

The performance of the equipment stated in this report is checked with independent reference material and results compared against a calibrated secondary source.

"Displayed Reading" denotes the figure shown on item under calibration/checking regardless of equipment precision or significant figures.

The "Tolerance Limit" mentioned is the acceptance criteria applicable for similar equipment used by Quality Pro Test-Consult Ltd. or quoted form relevant international standards..

> LEE Chun-ning, Desmond Senior Chemist



Unit 10, 14/F, Wah Wai Centre, 38-40 Au Pui Wan St., Fotan, Hong Kong Email: info@qualityprotest.com; Website: www.qualityprotest.com Tel: (852) 3956 8717; Fax: (852) 3956 3928

REPORT OF EQUIPMENT PERFORMANCE CHECK/ CALIBRATION

Report No.

BA030005

Date of Issue

01 March 2021

Page No.

2 of 2

#### PART D - CALIBRATION RESULTS (Cont'd)

#### (3) Dissolved Oxygen

Expected Reading (mg/L)	Displayed Reading (mg/L)	Tolerance (mg/L)	Results
0.21	0.01	-0.20	Satisfactory
4.55	4.56	0.01	Satisfactory
6.42	6.21	-0.21	Satisfactory
8.78	8.49	-0.29	Satisfactory

Tolerance limit of dissolved oxygen should be less than ±0.50 (mg/L)

#### (4) Conductivity at 25°C

Conc. of KCl (M)	Expected Reading (µS/cm)	Displayed Reading (μS/cm)	Tolerance (%)	Results
0.001	146.9	146.6	-0.20	Satisfactory
0.01	1412	1440	1.98	Satisfactory
0.1	12890	12717	-1.34	Satisfactory
0.5	58670	58394	-0.47	Satisfactory
1.0	111900	112033	0.12	Satisfactory

Tolerance limit of conductivity should be less than  $\pm 10.0$  (%)

#### (5) Salinity

Expected Reading (g/L)	Displayed Reading (g/L)	Tolerance (%)	Results
10	9.91	-0.90	Satisfactory
20	19.63	-1.85	Satisfactory
30	30.20	0.67	Satisfactory

Tolerance limit of salinity should be less than  $\pm 10.0$  (%)

#### (6) Turbidity

Expected Reading (NTU)	Displayed Reading <sup>(f)</sup> (NTU)	Tolerance <sup>(g)</sup> (%)	Results
0	0.16	144	Satisfactory
10	10.19	1.9	Satisfactory
20	20.36	1.8	Satisfactory
100	99.78	-0.2	Satisfactory
800	798.12	-0.2	Satisfactory

Tolerance limit of turbidity should be less than  $\pm 10.0$  (%)

Remark(s):

<sup>~</sup> END OF REPORT ~

<sup>(</sup>Displayed Reading" presents the figures shown on item under calibration/checking regardless of equipment precision or significant figures.

<sup>(</sup>b) The "Tolerance Limit" mentioned is the acceptance criteria applicable for similar equipment used by Quality Pro Test-Consult Ltd. or quoted form relevant international standards.



Tel: (852) 3956 8717; Fax: (852) 3956 3928

REPORT OF EQUIPMENT PERFORMANCE CHECK/ CALIBRATION

Report No.

BA030006

Date of Issue

01 March 2021

Page No.

1 of 2

#### PART A - CUSTOMER INFORMATION

Enovative Environmental Service Ltd. Flat 2207, Yu Fun House, Yu Chui Court, Shatin New Territories, Hong Kong Attn: Mr. Thomas WONG

#### PART B - DESCRIPTION

Name of Equipment

YSI ProDSS (Multi-Parameters)

Manufacturer

YSI (a xylem brand)

Serial Number

18A104824

Date of Received

Feb 25, 2021

Date of Calibration

Feb 25, 2021

Date of Next Calibration(a)

May 24, 2021

#### PART C – REFERENCE METHODS/ DOCUMENTS FOR THE CALIBRATION

**Parameter** 

Reference Method

pH at 25°C

APHA 21e 4500-H+ B

Dissolved Oxygen

APHA 21e 4500-O G APHA 21e 2510 B

Conductivity at 25°C Salinity

APHA 21e 2520 B

APHA 21e 2130 B

Turbidity Temperature

Section 6 of international Accreditation New Zealand Technical

Guide no. 3 Second edition March 2008: Working Thermometer Calibration Procedure.

#### PART D - CALIBRATION RESULTS(b,c)

#### (1) pH at 25°C

Target (pH unit)	Displayed Reading(d) (pH Unit)	Tolerance <sup>(e)</sup> (pH Unit)	Results
4.00	4.02	0.02	Satisfactory
7.42	7.45	0.03	Satisfactory
10.01	10.09	0.08	Satisfactory

Tolerance of pH should be less than ±0.20 (pH unit)

#### (2) Temperature

Reading of Ref. thermometer	Displayed Reading (°C)	Tolerance (°C)	Results
10	10.0	0.0	Satisfactory
21	20.4	-0.6	Satisfactory
41	40.9	-0.1	Satisfactory

Tolerance limit of temperature should be less than ±2.0 (°C)

#### ~ CONTINUED ON NEXT PAGE ~

#### Remark(s): -

The "Date of Next Calibration" is recommended according to best practice principals as practiced by QPT or quoted form relevant international standards.

The results relate only to the calibrated equipment as received

The performance of the equipment stated in this report is checked with independent reference material and results compared against a calibrated secondary source.

"Displayed Reading" denotes the figure shown on item under calibration/checking regardless of equipment precision or significant figures.

The "Tolerance Limit" mentioned is the acceptance criteria applicable for similar equipment used by Quality Pro Test-Consult Ltd. or quoted form relevant international standards..

> LEE Chun-ning, Desmond Senior Chemist



Email: info@qualityprotest.com; Website: www.qualityprotest.com Tel: (852) 3956 8717; Fax: (852) 3956 3928

### REPORT OF EQUIPMENT PERFORMANCE CHECK/ CALIBRATION

Report No.

BA030006

Date of Issue

01 March 2021

Page No.

2 of 2

#### PART D - CALIBRATION RESULTS (Cont'd)

#### (3) Dissolved Oxygen

Expected Reading (mg/L)	Displayed Reading (mg/L)	Tolerance (mg/L)	Results
0.21	0.01	-0.20	Satisfactory
4.55	6.21	1.66	Satisfactory
6.42	4.56	-1.86	Satisfactory
8.78	8.49	-0.29	Satisfactory

Tolerance limit of dissolved oxygen should be less than  $\pm 0.50$  (mg/L)

#### (4) Conductivity at 25°C

Conc. of KCl (M)	Expected Reading (µS/cm)	Displayed Reading (μS/cm)	Tolerance (%)	Results
0.001	146.9	146.7	-0.14	Satisfactory
0.01	1412	1436	1.70	Satisfactory
0.1	12890	12699	-1.48	Satisfactory
0.5	58670	58421	-0.42	Satisfactory
1.0	111900	111486	-0.37	Satisfactory

Tolerance limit of conductivity should be less than  $\pm 10.0$  (%)

#### (5) Salinity

Expected Reading (g/L)	Displayed Reading (g/L)	Tolerance (%)	Results
10	9.88	-1.20	Satisfactory
20	19.84	-0.80	Satisfactory
30	30.52	1.73	Satisfactory

Tolerance limit of salinity should be less than ±10.0 (%)

#### (6) Turbidity

Expected Reading (NTU)	Displayed Reading <sup>(f)</sup> (NTU)	Tolerance <sup>(g)</sup> (%)	Results
0	0.11		Satisfactory
10	10.23	2.3	Satisfactory
20	20.45	2.3	Satisfactory
100	102.38	2.4	Satisfactory
800	798.46	-0.2	Satisfactory

Tolerance limit of turbidity should be less than ±10.0 (%)

Remark(s): -

<sup>~</sup> END OF REPORT ~

<sup>&</sup>quot;Displayed Reading" presents the figures shown on item under calibration/ checking regardless of equipment precision or significant figures.

The "Tolerance Limit" mentioned is the acceptance criteria applicable for similar equipment used by Quality Pro Test-Consult Ltd. or quoted form relevant international standards.

Tel: (852) 3956 8717; Fax: (852) 3956 3928

### REPORT OF EQUIPMENT PERFORMANCE CHECK/ CALIBRATION

Report No.

BA020020

Date of Issue

03 February 2021

Page No.

1 of 2

#### PART A - CUSTOMER INFORMATION

Enovative Environmental Service Ltd. Flat 2207, Yu Fun House, Yu Chui Court, Shatin

New Territories, Hong Kong Attn: Mr. Thomas WONG

#### PART B - DESCRIPTION

Name of Equipment

YSI 6920V2 (Multi-Parameters)

Manufacturer

YSI (a xylem brand)

Serial Number

0001C6A7

Date of Received

Feb 03, 2021

Date of Calibration

Feb 03, 2021

Date of Next Calibration(a)

May 02, 2021

#### PART C - REFERENCE METHODS/ DOCUMENTS FOR THE CALIBRATION

**Parameter** 

Reference Method

pH at 25°C

APHA 21e 4500-H<sup>+</sup> B APHA 21e 4500-O G

Dissolved Oxygen Conductivity at 25°C

APHA 21e 2510 B

Salinity

APHA 21e 2520 B

Turbidity

APHA 21e 2130 B

Temperature

Section 6 of international Accreditation New Zealand Technical

Guide no. 3 Second edition March 2008: Working Thermometer Calibration Procedure.

#### PART D - CALIBRATION RESULTS(b,c)

#### (1) pH at 25°C

Target (pH unit)	Displayed Reading(d) (pH Unit)	Tolerance <sup>(e)</sup> (pH Unit)	Results
4.00	4.03	0.03	Satisfactory
7.42	7.45	0.03	Satisfactory
10.01	10.01	0.00	Satisfactory

Tolerance of pH should be less than ±0.20 (pH unit)

#### (2) Temperature

Reading of Ref. thermometer (°C)	Displayed Reading (°C)	Tolerance (°C)	Results
10	10.03	0.03	Satisfactory
20	20.08	0.08	Satisfactory
40	39.89	-0.11	Satisfactory

Tolerance limit of temperature should be less than ±2.0 (°C)

#### ~ CONTINUED ON NEXT PAGE ~

#### Remark(s): -

The "Date of Next Calibration" is recommended according to best practice principals as practiced by QPT or quoted form relevant international standards.

The results relate only to the calibrated equipment as received

The performance of the equipment stated in this report is checked with independent reference material and results compared against a calibrated secondary source.

"Displayed Reading" denotes the figure shown on item under calibration/checking regardless of equipment precision or significant figures.

The "Tolerance Limit" mentioned is the acceptance criteria applicable for similar equipment used by Quality Pro Test-Consult Ltd. or quoted form relevant international standards.

> LEE Chun-ning, Desmond Senior Chemist



Tel: (852) 3956 8717; Fax: (852) 3956 3928

REPORT OF EQUIPMENT PERFORMANCE CHECK/ CALIBRATION

Report No. : BA020020

Date of Issue : 03 February 2021

Page No. : 2 of 2

#### PART D - CALIBRATION RESULTS (Cont'd)

#### (3) Dissolved Oxygen

Expected Reading (mg/L)	Displayed Reading (mg/L)	Tolerance (mg/L)	Results
0.65	0.40	-0.25	Satisfactory
2.38	2.71	0.33	Satisfactory
4.04	4.20	0.16	Satisfactory
7.28	7.52	0.24	Satisfactory

Tolerance limit of dissolved oxygen should be less than ±0.50 (mg/L)

#### (4) Conductivity at 25°C

Conc. of KCl (M)	Expected Reading (µS/cm)	Displayed Reading (μS/cm)	Tolerance (%)	Results
0.001	146.9	153.1	4.22	Satisfactory
0.01	1412	1324	-6.23	Satisfactory
0.1	12890	12836	-0.42	Satisfactory
0.5	58670	58301	-0.63	Satisfactory
1.0	111900	111527	-0.33	Satisfactory

Tolerance limit of conductivity should be less than  $\pm 10.0$  (%)

#### (5) Salinity

Expected Reading (g/L)	Displayed Reading (g/L)	Tolerance (%)	Results
10	9.94	-0.60	Satisfactory
20	20.16	0.80	Satisfactory
30	30.28	0.93	Satisfactory

Tolerance limit of salinity should be less than ±10.0 (%)

#### (6) Turbidity

Results	Tolerance <sup>(g)</sup> (%)	Displayed Reading <sup>(f)</sup> (NTU)	Expected Reading (NTU)
Satisfactory	7.0	0.0	0
Satisfactory	-1.0	9.9	10
Satisfactory	-1.0	19.8	20
Satisfactory	-1.3	98.7	100
Satisfactory	-0.3	797.2	800

Tolerance limit of turbidity should be less than  $\pm 10.0$  (%)

~ END OF REPORT ~

Remark(s): -

<sup>&</sup>quot;Displayed Reading" presents the figures shown on item under calibration/ checking regardless of equipment precision or significant figures.

<sup>(8)</sup> The "Tolerance Limit" mentioned is the acceptance criteria applicable for similar equipment used by Quality Pro Test-Consult Ltd. or quoted form relevant international standards.

#### Annex G2

# Monitoring Schedule for Water Quality

## Tung Chung New Town Extension (East) Impact Marine Water Quality Monitoring (WQM) Schedule (March 2021)

Sunday														
Sunday	1-Mar			Thursday 4-Mar		6-Mar								
	ebb tide 12:47 - 16:17 flood tide 7:06 - 10:36		ebb tide 14:07 - 17:37 flood tide 8:02 - 11:32		ebb tide 15:56 - 19:26 flood tide 9:09 - 12:39									
7-Mar	8-Mar	9-Mar	10-Mar	11-Mar	12-Mar	13-Mar								
	ebb tide 20:06 - 22:40 flood tide 7:26 - 10:56		ebb tide 10:40 - 13:39 flood tide 15:01 - 18:00		ebb tide 11:18 - 14:48 flood tide 6:00 - 9:13									
14-Mar	15-Mar	16-Mar	17-Mar	18-Mar	19-Mar	20-Mar								
	ebb tide 12:40 - 16:10 flood tide 6:47 - 10:17		ebb tide 13:36 - 17:06 flood tide 7:20 - 10:50		ebb tide 14:46 - 18:16 flood tide 7:59 - 11:29									
21-Mar	22-Mar	23-Mar	24-Mar	25-Mar	26-Mar	27-Mar								
	ebb tide 17:53 - 20:45 flood tide 5:03 - 8:33		ebb tide 20:29 - 22:59 flood tide 8:45 - 11:36		ebb tide 10:59 - 13:33 flood tide 15:23 - 18:53									
28-Mar	29-Mar	30-Mar	31-Mar											
	ebb tide 11:45 - 15:15 flood tide 5:50 - 9:20		ebb tide 13:03 - 16:33 flood tide 6:47 - 10:17											
Domark														

Remark:

Pickup time and place of 1st tide: 15 min before tidal window at Sham Tseng pier Pickup time and place of 2nd tide: 15 min before tidal window at Tung Chung pier

#### Annex G3

# Monitoring Results for Water Quality

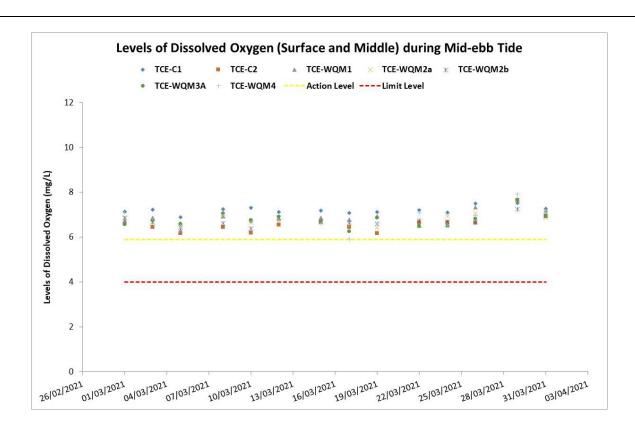


Figure 1: Levels of Dissolved Oxygen (Surface and Middle) (mg/L) recorded at Mid-ebb Tide during the Water Quality Monitoring between 1 to 31 March 2021

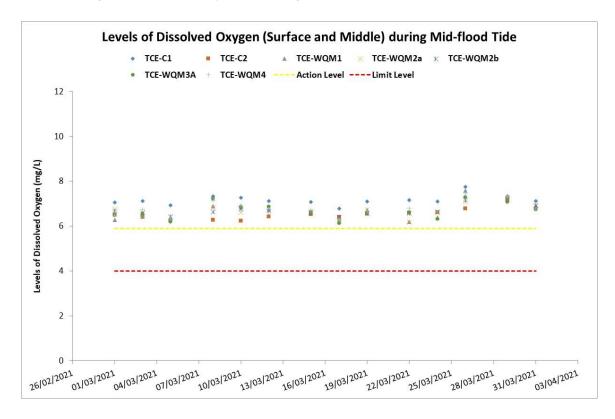


Figure 2: Levels of Dissolved Oxygen (Surface and Middle) (mg/L) recorded at Mid-flood Tide during the Water Quality Monitoring between 1 to 31 March 2021

Source: P:\Projects\0445700 CEDD ET for Tung Chung.JT\02\_Deliverable\10 Monthly EM&A
Report\

Date: March 2021

Environmental
Resources
Management

ERM

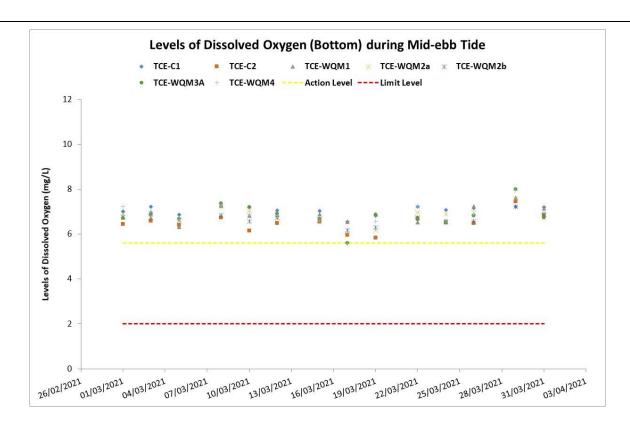


Figure 3: Levels of Dissolved Oxygen (Bottom) (mg/L) recorded at Mid-ebb Tide during the Water Quality Monitoring between 1 to 31 March 2021

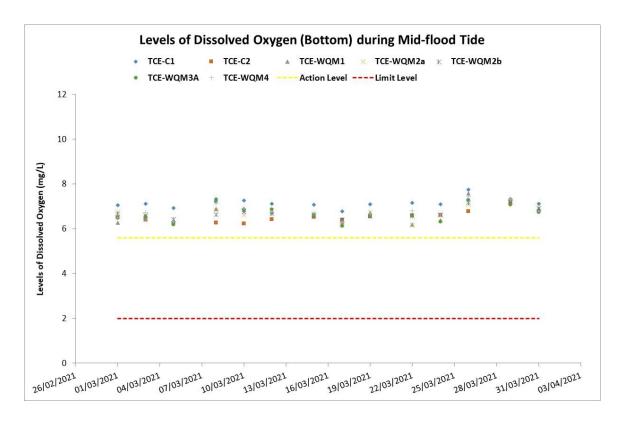


Figure 4: Levels of Dissolved Oxygen (Bottom) (mg/L) recorded at Mid-flood Tide during the Water Quality Monitoring between 1 to 31 March 2021

Source: P:\Projects\0445700 CEDD ET for Tung Chung.JT\02\_Deliverable\10 Monthly EM&A Report\

Date: March 2021

Environmental Resources Management



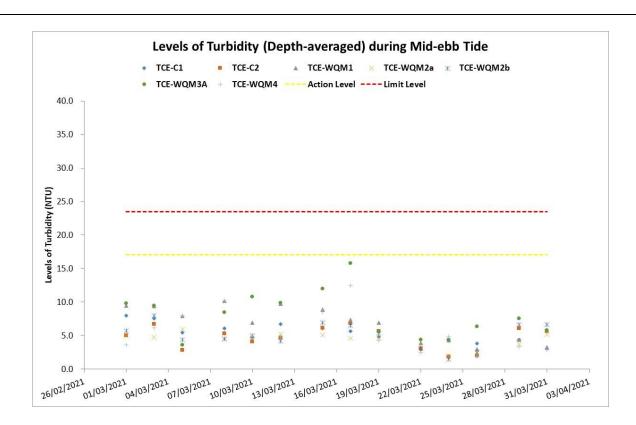


Figure 5: Levels of Turbidity (Depth-averaged) (NTU) recorded at Mid-ebb Tide during the Water Quality Monitoring between 1 to 31 March 2021

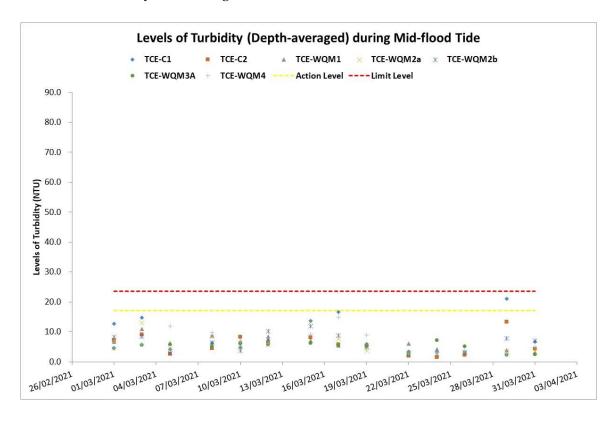


Figure 6: Levels of Turbidity (Depth-averaged) (NTU) recorded at Mid-flood Tide during the Water Quality Monitoring between 1 to 31 March 2021

Source: P:\Projects\0445700 CEDD ET for Tung Chung.JT\02\_Deliverable\10 Monthly EM&A Report\

Date: March 2021 **Environmental** Resources Management



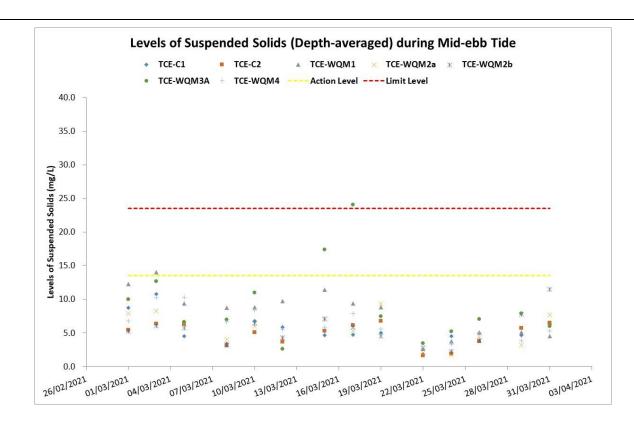


Figure 7: Levels of Suspended Solids (Depth-averaged) (mg/L) recorded at Mid-ebb Tide during the Water Quality Monitoring between 1 to 31 March 2021

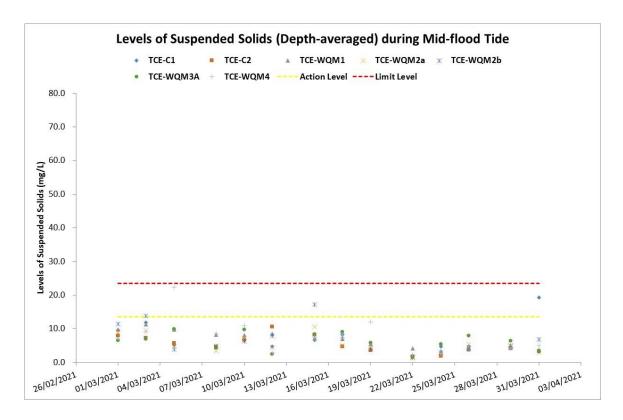


Figure 8: Levels of Suspended Solids (Depth-averaged) (mg/L) recorded at Mid-flood Tide during the Water Quality Monitoring between 1 to 31 March 2021

Source:	P:\Projects\0445700 CEDD ET for Tung Chung.JT\02_Deliverable\10 Monthly	Environmental	
	EM&A Report\	Resources	()
Date:	March 2021	Management	ERM

Date	Tide	Station	Weather Condition	Sea Condition	Sampling Time	Water Depth (m)	Water Level	Sampling depth (m)	Replicate	Water Temperature (°C)	pH	Salinity (ppt)	Dissolved Oxygen (DO) (mg/L)	DO Saturation	Turbidity (NTU)	Suspended Solids (SS) (mg/L)	DO (mg/L)	Depth-averaged Turbidity (NTU)	SS (mg/L)
01-03-21	Mid-Ebb	TCE-C1	Cloudy	Moderate	12:48	8.1	Surface	1.0	1	20.6	8.1	31.3	7.3	97.1	5.0	9.6	(mg/L)	(1410)	(mg/L)
							Middle	4.1	2	20.6	8.1 8.1	31.3 32.8	7.3 7.0	97.1 94.3	5.0 8.9	9.4 8.8	7.1		
							Middle	4.1	2	20.3	8.1	32.8	7.0	94.3	9.0	8.9		8.0	8.8
							Bottom	7.1	1	20.2	8.1	33.1	7.0	94.2	10.0	8.2	7.0		
									2	20.2	8.1	33.1	7.0	94.1	10.0	8.0	7.0		
		TCE-C2	Cloudy	Moderate	14:49	15.2	Surface	1.0	2	20.8 20.8	8.1 8.1	31.0	6.8	90.9 90.7	3.8 3.9	5.5			
							Middle	7.6	1	20.8	8.1	31.0 31.6	6.8	90.7 85.5	5.3	5.4 5.5	6.6		
									2	20.4	8.1	31.6	6.4	85.5	5.3	4.9		5.1	5.5
							Bottom	14.2	1	20.4	8.1	31.8	6.5	86.2	6.0	5.7	6.5		
		TCE-WQM1	Cloudy	Calm	13:33	9.0	Surface	1.0	1	20.4	8.1 8.1	31.8	6.5	86.1 90.2	6.1 8.4	5.8 12.8			
		TCE-WQWII	Cloudy	Cann	13.33	9.0	Surface	1.0	2	20.6	8.1	31.4	6.7	90.1	8.5	12.7			
							Middle	4.5	1	20.5	8.1	31.5	6.7	90.1	9.1	12.6	6.7	9.5	12.3
									2	20.5	8.1	31.5	6.7	90.1	9.2	12.0		9.3	12.5
							Bottom	8.0	2	20.5 20.5	8.1 8.1	31.5	6.7	90.1 90.1	10.7	11.6	6.7		
		TCE-WQM2a	Cloudy	Moderate	14:13	7.6	Surface	1.0	1	20.8	8.1	31.5 30.7	6.9	92.7	10.8 4.2	12.1 6.7			
		102 1101120	Cloudy	Moderate	11.10	7.0	Surface	1.0	2	20.8	8.1	30.7	6.9	92.7	4.2	7.6	6.9		
							Middle	3.8	1	20.6	8.1	30.9	6.8	91.1	5.6	7.6	6.9	5.0	7.9
							Bottom	6.6	1	20.6	8.1 8.1	30.9 31.0	6.9	91.4 91.9	5.6 5.0	7.5 8.8		-	
							Bottom	6.6	2	20.5	8.1 8.1	31.0	6.9	92.1	5.0	9.2	6.9		
		TCE-WQM2b	Cloudy	Moderate	14:26	12.0	Surface	1.0	1	20.9	8.1	30.4	6.9	91.7	4.2	4.5			
			,						2	20.9	8.1	30.4	6.9	91.6	4.3	4.0	6.9		
							Middle	6.0	1	20.7	8.1	30.6	6.9	91.4	5.5	5.0	0.5	5.8	5.2
							Bottom	11.0	2	20.7	8.1 8.1	30.6 30.7	6.9	91.5 90.5	5.5 7.5	5.4 6.0		-	
							Dottoni	11.0	2	20.7	8.1	30.7	6.8	90.5	7.5	6.7	6.8		
		TCE-WQM3A	Cloudy	Calm	13:55	4.2	Surface	1.0	1	20.6	8.1	30.7	6.6	87.5	9.0	9.6	6.6		
									2	20.6	8.1	30.7	6.6	87.6	9.1	9.2	0.0	9.8	10.0
							Bottom	3.2	2	20.6	8.1 8.1	30.7 30.7	6.7	89.6 89.7	10.5 10.6	10.9 10.5	6.7		
		TCE-WQM4	Cloudy	Calm	13:46	3.5	Surface	1.0	1	20.9	8.1	30.5	7.1	94.8	3.7	7.7			
			,						2	20.9	8.1	30.5	7.1	94.6	3.7	8.2	7.1	3.7	6.8
							Bottom	2.5	1	20.8	8.1	30.6	7.2	96.6	3.6	5.9	7.2	3.7	0.0
01-03-21	Mid-Flood	TCE-C1	Cloudy	Moderate	10:31	7.8	Surface	1.0	1	20.8	8.1 8.1	30.6 32.2	7.2 7.1	96.5 95.2	3.6 11.2	5.5 10.5			
01-03-21	Wild-Flood	TCE-CI	Cloudy	Woderate	10.51	7.0	Surface	1.0	2	20.3	8.1	32.2	7.1	95.2	11.1	10.8			
							Middle	3.9	1	20.2	8.1	32.8	7.0	93.7	12.4	9.4	7.1	12.6	9.6
									2	20.2	8.1	32.9	7.0	93.7	12.5	9.3		12.0	9.0
							Bottom	6.8	2	20.2	8.1 8.1	33.3 33.3	6.9	92.1 91.9	14.3 14.2	9.3 8.5	6.9		
		TCE-C2	Cloudy	Moderate	8:24	14.9	Surface	1.0	1	20.2	8.1	31.1	6.6	87.3	5.8	8.9			
									2	20.4	8.1	31.1	6.6	87.3	5.8	9.3	6.5		
							Middle	7.5	1	20.4	8.1	31.4	6.5	85.9	7.1	8.3	0.5	7.1	8.0
							Bottom	13.9	1	20.4 20.4	8.1	31.4	6.5	85.9 85.4	7.1	7.5		4	
							bottom	15.9	2	20.4	8.1 8.1	31.5 31.5	6.4	85.4	8.3 8.5	6.7 7.2	6.4		
		TCE-WQM1	Cloudy	Calm	9:38	8.7	Surface	1.0	1	20.5	8.1	30.6	6.3	83.9	6.1	11.1			
									2	20.5	8.1	30.6	6.3	83.8	6.1	11.1	6.3		
							Middle	4.4	1	20.5	8.1	30.6	6.3	83.1 83.1	6.7	9.5 9.5		6.8	9.8
	1						Bottom	7.7	1	20.5	8.1 8.1	30.6 30.6	6.2	83.1 82.5	6.7 7.4	9.5 8.8		1	1
	1				<u> </u>				2	20.5	8.1	30.6	6.2	82.4	7.5	8.8	6.2		
	1	TCE-WQM2a	Cloudy	Moderate	9:02	7.4	Surface	1.0	1	20.4	8.1	31.0	6.8	90.3	6.5	8.9	1		1
							Middle	3.7	2	20.4 20.4	8.1 8.1	31.0 31.0	6.8	90.3 89.3	6.5 7.2	8.8 9.4	6.8		
	1						winddie	5.7	2	20.4	8.1	31.0	6.7	89.2	7.2	8.5	†	7.3	8.8
							Bottom	6.4	1	20.4	8.1	30.9	6.6	87.9	8.0	9.1	6.6	1	
	1								2	20.4	8.1	30.9	6.6	87.9	8.1	8.5	0.0		
	1	TCE-WQM2b	Cloudy	Moderate	8:49	11.8	Surface	1.0	2	20.4	8.1 8.1	30.9 30.9	6.7	89.3 89.3	7.9 7.9	10.5 10.4	4		1
	1						Middle	5.9	1	20.4	8.1 8.1	30.9	6.7	89.3 88.2	7.9 8.4	10.4	6.7		1
	1								2	20.4	8.1	30.9	6.6	88.2	8.4	11.6	1	8.2	11.5
	1						Bottom	10.8	1	20.4	8.1	30.9	6.5	86.6	8.4	12.0	6.5		1
	1	TCF WOME	Classifica	6.1	0.14	4.1	Confere	1.0	2	20.4	8.1 8.1	30.9 30.8	6.5	86.6	8.4 4.4	12.6			1
	1	TCE-WQM3A	Cloudy	Calm	9:14	4.1	Surface	1.0	2	20.5 20.5	8.1 8.1	30.8	6.5 6.5	86.1 86.1	4.4	6.5 5.7	6.5		1
	1						Bottom	3.1	1	20.4	8.0	30.8	6.3	83.4	4.7	6.9	6.2	4.6	6.6
	1								2	20.4	8.0	30.8	6.3	83.2	4.7	7.2	6.3		
	1	TCE-WQM4	Cloudy	Calm	9:25	3.2	Surface	1.0	1	20.5	8.1	30.6	6.5	86.2	4.5	7.0	6.5		1
							Bottom	2.2	1	20.5	8.1 8.1	30.6 30.7	6.5	86.0 84.3	4.5 4.6	6.6 7.3		4.6	6.9
	1								2	20.5	8.1	30.7	6.3	84.3	4.6	6.8	6.3		
			1					1					1				1	1	

			TAT			Mater Death		Complian doub		Water		Salinity	Dissolved	DO Saturation	Turbidity	Suspended Solids		Depth-averaged	
Date	Tide	Station	Weather Condition	Sea Condition	Sampling Time	Water Depth (m)	Water Level	Sampling depth (m)	Replicate	Temperature	pH	(ppt)	Oxygen (DO)	(%)	(NTU)	(SS)	DO	Turbidity (NTU)	SS (mg/f)
03-03-21	Mid-Ebb	TCE-C1	Cloudy	Calm	14:08	7.6	Surface	1.0	1	(°C) 20.5	8.1	33.7	(mg/L) 7.2	97.8	7.0	(mg/L) 12.4	(mg/L)	(N1U)	(mg/L)
									2	20.5	8.1	33.7	7.2	98.0	6.6	11.6	7.2		
							Middle	3.8	1	20.5	8.1	33.8	7.2	97.9	7.2	10.5	/	7.6	10.8
							Bottom	6.6	2	20.5	8.1 8.1	33.8 33.9	7.2 7.2	98.0 97.9	7.4 8.6	11.0 9.9		-	
							Dottom	0.0	2	20.5	8.1	33.9	7.2	97.7	8.5	9.3	7.2		
		TCE-C2	Cloudy	Calm	16:10	12.2	Surface	1.0	1	20.7	8.1	31.2	6.5	87.5	4.2	5.7			
							Middle		2	20.7	8.1	31.2	6.5	87.5	4.2	6.0	6.4		
							Middle	6.1	2	20.6	8.0 8.0	31.9 31.9	6.4	85.3 85.2	7.1 7.2	6.5 5.6	-	6.7	6.4
							Bottom	11.2	1	20.6	8.0	32.0	6.6	88.3	8.8	7.0		1	
									2	20.6	8.0	32.0	6.6	88.4	8.8	7.4	6.6		
		TCE-WQM1	Cloudy	Calm	15:00	9.2	Surface	1.0	1	20.6	8.1	31.6	6.8	91.6	8.3	14.4			
							Middle	4.6	2	20.6	8.1 8.1	31.6 31.6	6.8	91.6 92.2	8.3 9.2	14.7 14.7	6.9		
							Middle	4.0	2	20.6	8.1	31.6	6.9	92.2	9.3	13.5	-	9.4	14.1
							Bottom	8.2	1	20.6	8.1	31.6	6.9	93.0	10.6	13.1			l
									2	20.6	8.1	31.6	7.0	93.9	10.6	13.9	7.0		
		TCE-WQM2a	Cloudy	Calm	15:46	7.8	Surface	1.0	1	20.7	8.1	31.1	6.7	89.6	5.0	7.6			
							Middle	3.9	2	20.7	8.1 8.1	31.1 31.2	6.7	89.6 89.1	5.0 4.6	8.6 8.6	6.7		
							Wildelle	3.7	2	20.7	8.1	31.2	6.7	89.1	4.6	7.5		4.8	8.3
							Bottom	6.8	1	20.7	8.0	31.3	6.7	89.9	4.6	8.0	6.7		
									2	20.7	8.0	31.4	6.8	90.8	4.7	9.3	0.7		
		TCE-WQM2b	Cloudy	Calm	15:59	10.4	Surface	1.0	1	20.8	8.0	30.5	6.7	90.1	4.9	4.9			
							Middle	5.2	2	20.8	8.0 8.0	30.5 31.3	6.7	90.0 87.8	5.0 9.2	4.3 5.8	6.7		
							Wildelle	5.2	2	20.7	8.0	31.3	6.6	87.8	9.3	6.5		8.0	6.1
							Bottom	9.4	1	20.7	8.0	31.4	6.7	90.3	9.7	7.2	6.7		
									2	20.7	8.0	31.4	6.8	90.4	9.7	7.8	0.7		
		TCE-WQM3A	Cloudy	Calm	15:31	4.0	Surface	1.0	2	20.7	8.1 8.1	30.9 30.9	6.7	90.0	8.6	11.4 10.9	6.7		
							Bottom	3.0	1	20.7 20.7	8.1	30.9	6.8	90.4 92.0	9.0 10.1	14.4		9.5	12.7
									2	20.7	8.1	30.9	6.9	92.2	10.2	14.0	6.9		
		TCE-WQM4	Cloudy	Calm	15:20	3.6	Surface	1.0	1	20.8	8.1	31.0	6.8	91.2	5.7	12.3	6.8		
									2	20.8	8.1	31.0	6.8	91.2	5.7	13.0	0.0	6.2	10.2
							Bottom	2.6	1 2	20.8	8.1 8.1	31.0 31.0	7.0 7.1	93.2 94.5	6.5	8.0 7.5	7.0		
03-03-21	Mid-Flood	TCE-C1	Cloudy	Calm	11:26	7.6	Surface	1.0	1	20.4	8.1	33.4	7.1	96.2	8.4	12.6			
				Caim					2	20.4	8.1	33.4	7.1	96.1	8.9	13.5	7.1		
							Middle	3.8	1	20.4	8.1	33.5	7.1	95.9	14.3	11.8	7.1	14.8	11.9
							P-11		2	20.4	8.1	33.5 33.8	7.1	95.6 96.0	15.5 20.8	11.2		- 14.8	11.9
							Bottom	6.6	2	20.5	8.1 8.1	33.8	7.1 7.1	95.9	20.8	11.8	7.1		
		TCE-C2	Cloudy	Calm	9:30	12.2	Surface	1.0	1	20.6	8.0	31.4	6.5	86.3	7.4	8.1			
			•						2	20.6	8.0	31.4	6.4	86.2	7.6	8.0	6.4		
							Middle	6.1	1	20.6	8.0	31.7	6.3	85.0	8.8	7.2	0.4	9.1	7.2
							Bottom	11.2	2	20.6 20.6	8.0 8.0	31.7 32.0	6.4	85.1 84.7	8.9 11.0	6.7			
							Dottom	11.2	2	20.6	8.0	32.0	6.4	85.2	10.9	6.8	6.3		
		TCE-WQM1	Cloudy	Calm	10:50	10.2	Surface	1.0	1	20.6	8.0	31.0	6.4	86.1	8.8	13.2			
									2	20.6	8.0	31.1	6.4	86.1	9.4	12.4	6.4		
							Middle	5.1	2	20.6	8.0 8.0	31.1 31.1	6.4	85.9 86.0	11.0 11.0	10.2		10.9	11.3
							Bottom	9.2	1	20.6	8.0	31.1	6.5	86.7	12.7	10.9		1	
				1			. 300		2	20.6	8.0	31.1	6.6	87.5	12.6	10.2	6.5		
		TCE-WQM2a	Cloudy	Calm	10:16	8.2	Surface	1.0	1	20.7	8.0	30.9	6.6	88.1	7.9	8.6			
							Middle	41	2	20.7	8.0 8.0	30.9 30.9	6.6	88.1 88.5	7.9	8.9 10.0	6.6		
							Middle	4.1	2	20.7	8.0	30.9	6.6	88.5 88.5	12.2 12.4	9.2	1	13.0	9.4
							Bottom	7.2	1	20.7	8.0	30.9	6.6	88.6	18.8	10.4		1	
									2	20.7	8.0	30.9	6.7	88.9	18.5	9.4	6.6		
1		TCE-WQM2b	Cloudy	Calm	10:00	10.0	Surface	1.0	1	20.7	8.0	31.1	6.6	87.9	8.1	12.7	-		
							Middle	5.0	2	20.7	8.0 8.0	31.1 31.1	6.6	87.9 87.9	8.1 8.3	12.1 14.7	6.6		
1							Middle	5.0	2	20.6	8.0	31.1	6.6	88.2	8.4	14.7	1	8.4	13.8
							Bottom	9.0	1	20.6	8.0	31.1	6.6	88.6	8.8	14.3	6.6	1	
									2	20.6	8.0	31.1	6.6	88.6	8.8	15.0	0.0		
1		TCE-WQM3A	Cloudy	Calm	10:27	4.0	Surface	1.0	2	20.6	8.0	31.0	6.5	87.2	5.0	7.4	6.5		
							Bottom	3.0	1	20.6	8.0 8.0	31.0 31.1	6.6	87.5 89.3	5.2 5.8	6.3		5.6	7.0
									2	20.6	8.0	31.0	6.8	90.8	6.4	7.5	6.7		
		TCE-WQM4	Cloudy	Calm	10:38	3.8	Surface	1.0	1	20.6	8.0	31.1	6.7	89.9	6.0	9.4	6.7		
							D. II	2.8	2	20.6	8.0	31.1	6.7	90.0	5.9 5.9	8.4	****	5.9	9.1
							Bottom	2.8	2	20.6	8.0 8.0	31.1 31.1	6.8	91.3 91.2	5.9	9.6 8.8	6.8		
				1	1		1	1		20.0	0.0	31.1	0.0	71.4	J.7	0.0	1	1	1

			Weather			Water Depth		Sampling depth		Water		Salinity	Dissolved	DO Saturation	Turbidity	Suspended Solids		Depth-averaged	
Date	Tide	Station	Condition	Sea Condition	Sampling Time	(m)	Water Level	(m)	Replicate	Temperature (°C)	pH	(ppt)	Oxygen (DO) (mg/L)	(%)	(NTU)	(SS) (mg/L)	DO (mg/L)	Turbidity (NTU)	SS (mg/L)
05-03-21	Mid-Ebb	TCE-C1	Rainy	Rough	15:57	7.9	Surface	1.0	1	20.4	8.2	31.2	6.9	92.2	4.9	5.0	(mgz)	(1110)	()
							Middle	4.0	2	20.4	8.2 8.2	31.2 31.5	6.9	92.1 91.7	5.0 5.2	5.2 4.6	6.9		
							wiiddie	4.0	2	20.4	8.2	31.5	6.9	91.7	5.2	4.7		5.5	4.6
							Bottom	6.9	1	20.4	8.2	31.5	6.9	91.6	6.2	3.4	6.9		
		TCE-C2	Rainy	Moderate	17:48	11.6	Surface	1.0	2	20.4	8.2 8.1	31.5 30.6	6.9	91.6 81.8	6.2 2.7	6.3	0.5		+
		TCE-C2	Kainy	woderate	17:48	11.6	Surface	1.0	2	20.5	8.1	30.6	6.2	81.7	2.8	5.7			
							Middle	5.8	1	20.5	8.1	30.8	6.2	82.1	2.9	6.0	6.2	2.9	6.3
							Bottom	10.6	2	20.5 20.5	8.1 8.1	30.8 30.9	6.2	82.3 84.7	3.0 2.9	6.5 6.4			
							Dottom	10.0	2	20.5	8.1	30.9	6.4	85.7	3.0	6.7	6.4		
		TCE-WQM1	Rainy	Moderate	16:34	8.2	Surface	1.0	1	20.3	8.1	30.1	6.3	83.4	6.6	9.4			
							Middle	4.1	2	20.3	8.1 8.1	30.1 30.1	6.3	83.4 83.2	6.8 7.9	10.0 9.6	6.3		
							whate	4.1	2	20.3	8.1	30.1	6.3	83.2	8.0	9.0		7.9	9.4
							Bottom	7.2	1	20.3	8.2	30.2	6.3	83.4	9.0	8.8	6.3		
		TCE-WQM2a	Rainy	Calm	17:06	6.6	Confere	1.0	2	20.3	8.2 8.1	30.1 29.3	6.3	83.5 85.6	9.0 5.2	9.6			
		TCE-WQM2a	Kainy	Caim	17:06	6.6	Surface	1.0	2	20.5	8.1	29.3	6.5	85.6	5.2	6.1 7.2			
							Middle	3.3	1	20.5	8.1	29.3	6.5	85.8	5.8	7.1	6.5	5.9	6.5
							Bottom	5.6	2	20.5	8.1 8.1	29.3 29.4	6.5	85.9 87.4	5.9 6.7	6.6 5.2		3.3	0.5
							Dottom	5.6	2	20.5	8.1	29.4	6.7	88.2	6.8	6.5	6.7		
		TCE-WQM2b	Rainy	Moderate	17:20	10.0	Surface	1.0	1	20.5	8.1	29.3	6.4	85.0	3.3	5.1			
							Middle	5.0	2	20.5 20.5	8.1 8.1	29.4 29.7	6.4	84.9 84.9	3.5 4.7	5.6 6.2	6.4		
							Middle	5.0	2	20.5	8.1	29.7	6.4	84.9 85.1	4.7	5.7		4.4	5.7
							Bottom	9.0	1	20.5	8.1	29.8	6.6	87.4	5.1	5.5	6.6		
		TOTE THON 10 A		6.1	44.55	4.0	0. (	4.0	2	20.5	8.1	29.8	6.6	87.8	5.1	6.2	0.0		
		TCE-WQM3A	Rainy	Calm	16:55	4.0	Surface	1.0	2	20.6 20.6	8.1 8.1	29.3 29.3	6.6	87.0 87.0	3.0 3.2	5.2 5.8	6.6		
							Bottom	3.0	1	20.6	8.1	29.4	6.7	88.1	4.2	8.3	6.7	3.6	6.6
									2	20.6	8.1	29.4	6.7	88.3	4.2	7.2	6.7		
		TCE-WQM4	Rainy	Calm	16:45	3.2	Surface	1.0	2	20.5	8.1 8.1	29.5 29.5	6.5 6.5	85.6 86.0	7.9 7.9	10.7 10.1	6.5		
							Bottom	2.2	1	20.5	8.1	29.5	6.6	87.8	8.1	10.3	6.7	8.0	10.3
									2	20.5	8.1	29.5	6.7	88.3	8.0	10.0	6.7		
05-03-21	Mid-Flood	TCE-C1	Cloudy	Moderate	11:48	7.6	Surface	1.0	1 2	20.4	8.2 8.2	31.2 31.2	7.0	92.8 92.7	2.8	6.0 5.2			
							Middle	3.8	1	20.4	8.2	31.4	6.9	91.9	4.0	5.2	6.9	4.2	5.2
							D		2	20.4	8.2	31.4	6.9	91.8	4.0	4.6		4.2	3.2
							Bottom	6.6	2	20.4	8.2 8.2	31.5 31.5	6.9	91.8 91.8	5.9 5.9	5.1 4.8	6.9		
		TCE-C2	Cloudy	Calm	9:38	11.4	Surface	1.0	1	20.5	8.1	29.6	6.3	83.5	2.4	5.0			
							Middle	5.7	2	20.4	8.1 8.1	29.7 29.8	6.3	82.6 82.2	2.6	4.8 5.3	6.3		
							Middle	5.7	2	20.4	8.1	29.8	6.2	82.2	2.8	5.6		2.6	5.7
							Bottom	10.4	1	20.4	8.1	30.0	6.2	82.5	2.6	6.5	6.2		
		TCE-WQM1	Cloudy	Calm	10:50	8.0		1.0	2	20.4	8.1 8.1	29.9 29.7	6.3	82.7 83.8	2.5 6.3	6.8 9.7	0.2		
		ICE-WQMI	Cloudy	Caim	10:50	8.0	Surface	1.0	2	20.3	8.1	29.7	6.4	83.9	6.3	10.3			
							Middle	4.0	1	20.3	8.1	30.3	6.4	84.3	6.3	9.8	6.4	6.2	9.7
							Bottom	7.0	2	20.3	8.1 8.1	30.3 30.4	6.4	84.3 84.7	6.2	9.9 9.1			
		1					Dottom	7.0	2	20.3	8.1	30.4	6.4	84.7 84.8	6.0	9.1	6.4		
		TCE-WQM2a	Cloudy	Moderate	10:15	7.1	Surface	1.0	1	20.5	8.1	29.2	6.5	85.0	2.6	4.5			
		1					Middle	3.6	2	20.5 20.4	8.1 8.1	29.2 29.3	6.5 6.4	85.0 84.4	2.6 3.9	5.6 4.2	6.4		
							Middle	3.0	2	20.4	8.1	29.3	6.4	84.3	4.4	5.0		4.4	4.6
							Bottom	6.1	1	20.4	8.1	29.6	6.4	84.6	6.4	4.0	6.4		
		TCE-WQM2b	Cloudy	Calm	10:03	10.2	Surface	1.0	2	20.4 20.6	8.1 8.1	29.6 29.0	6.4	84.7 85.3	6.4 2.2	4.5 4.1			+
		i CE-WQM2b	Cloudy	Caim	10:03	10.2	Surrace	1.0	2	20.6	8.1	29.0	6.5	85.3 85.2	2.2	4.1			
							Middle	5.1	1	20.5	8.1	29.1	6.4	84.0	3.0	3.4	6.4	2.9	3.8
							Bottom	9.2	2	20.5	8.1 8.1	29.1 29.2	6.4	84.0 83.9	3.1	3.9			
		1					Dottom	9.2	2	20.5	8.1	29.2	6.4	83.9 84.0	3.5	3.3	6.4		
		TCE-WQM3A	Cloudy	Calm	10:26	4.1	Surface	1.0	1	20.4	8.1	29.5	6.2	81.4	5.4	8.4	6.2		1
		1					Bottom	3.1	2	20.4	8.1 8.1	29.5 29.5	6.2	81.4 82.4	5.7 6.0	9.6 10.7		5.8	9.9
		1					pottom	3.1	2	20.4	8.1	29.5	6.3	82.4 82.6	6.0	10.7	6.3		
		TCE-WQM4	Cloudy	Calm	10:37	3.4	Surface	1.0	1	20.4	8.1	29.6	6.3	83.5	10.1	22.6	6.3		
		1					Bottom	2.4	2	20.4	8.1 8.1	29.6 29.6	6.3	83.6 85.0	10.1 13.8	24.8 20.3		11.9	22.4
							DOTTOIN	2.4	2	20.4	8.1	29.6	6.5	85.0 85.1	13.8	20.3	6.4		
		1	1	1	1		1	1					0.0		-5.0		·	1	.1

			Weather			Water Depth		Sampling depth		Water		Salinity	Dissolved	DO Saturation	Turbidity	Suspended Solids		Depth-averaged	
Date	Tide	Station	Condition	Sea Condition	Sampling Time	(m)	Water Level	(m)	Replicate	Temperature (°C)	pH	(ppt)	Oxygen (DO) (mg/L)	(%)	(NTU)	(SS) (mg/L)	DO (mg/L)	Turbidity (NTU)	SS (mg/L)
08-03-21	Mid-Ebb	TCE-C1	Cloudy	Moderate	20:07	8.5	Surface	1.0	1	17.9	8.0	34.3	7.3	94.0	4.9	3.7	(mg/L)	(1110)	(mg/L)
									2	17.9	8.0	34.3	7.3	93.9	5.0	4.1	7.2		
							Middle	4.3	2	17.8 17.8	8.0 8.0	34.9 34.9	7.2 7.2	93.7 93.7	6.5 6.5	3.5 3.1	1	6.1	3.4
							Bottom	7.5	1	17.8	7.9	35.4	7.2	94.1	7.1	3.0	7.2	1	
									2	17.8	7.9	35.4	7.3	94.2	6.7	3.0	7.2		
		TCE-C2	Cloudy	Moderate	22:08	13.1	Surface	1.0	1 2	18.0 18.0	8.1 8.1	34.5 34.5	6.4	83.2 83.1	4.1 4.1	3.1 2.9	-		
							Middle	6.6	1	17.9	8.0	34.6	6.5	84.1	5.1	3.2	6.4		
									2	17.9	8.0	34.6	6.5	84.2	5.3	3.2		5.3	3.1
							Bottom	12.1	1	17.9	8.0	34.7	6.7	87.5	6.7	3.2	6.7		
		TCE-WQM1	Cloudy	Moderate	20:50	8.3	Surface	1.0	2	17.9 18.2	8.0 8.1	34.7 33.3	6.8	87.6 87.6	6.6 8.6	3.2 9.2			
									2	18.2	8.1	33.3	6.8	87.7	8.7	8.9	6.9		
							Middle	4.2	1	18.2	8.1	33.5	7.1	91.4	10.2	8.7	0.9	10.2	8.8
							Bottom	7.3	2	18.2 18.2	8.1 8.1	33.5 33.6	7.1 7.3	91.4 93.9	10.3 11.6	8.6 8.6		-	
							Dotton	7.5	2	18.2	8.1	33.6	7.3	94.0	11.6	8.7	7.3		
		TCE-WQM2a	Cloudy	Moderate	21:25	7.1	Surface	1.0	1	18.1	8.0	33.0	6.9	89.3	4.2	4.8			
							Middle	3.6	2	18.1 18.1	8.0 8.0	33.0 33.1	6.9 7.0	89.3 90.6	4.2 4.5	4.7 4.2	7.0		
							whate	3.0	2	18.1	8.0	33.1	7.0	90.8	4.5	4.5	-	4.5	4.1
							Bottom	6.1	1	18.1	7.9	33.4	7.2	93.2	4.8	3.2	7.2		
		TCE-WQM2b	Cloudy	Moderate	21:38	11.2	Confess	1.0	2	18.1 18.1	7.9 8.1	33.4 33.4	7.2 6.6	93.3 85.6	4.8 4.8	2.9 3.8			
		TCE-WQMI2B	Cloudy	Moderate	21:38	11.2	Surface	1.0	2	18.1	8.1	33.4	6.6	85.5	4.8	4.0	-		
							Middle	5.6	1	18.0	8.0	33.9	6.6	85.5	4.6	3.2	6.6	4.5	3.3
									2	18.0	8.0	33.9	6.6	85.5	4.6	3.1		4.5	3.3
							Bottom	10.2	2	18.0 18.0	8.0 8.0	34.4 34.4	6.8	88.8 89.0	4.2 4.2	2.7	6.9		
		TCE-WQM3A	Cloudy	Calm	21:14	4.0	Surface	1.0	1	18.1	8.0	32.8	7.0	90.8	8.1	6.8	7.0		
									2	18.1	8.0	32.8	7.1	90.9	8.1	6.5	7.0	8.5	7.0
							Bottom	3.0	2	18.1 18.1	8.0 8.0	32.8 32.8	7.4 7.4	94.8 94.9	9.0 8.8	7.2 7.4	7.4		
		TCE-WQM4	Cloudy	Calm	21:02	3.7	Surface	1.0	1	18.1	8.0	33.1	7.0	89.8	8.6	7.0			
									2	18.1	8.0	33.1	7.0	89.9	8.6	6.8	7.0	10.2	6.7
							Bottom	2.7	2	18.1 18.1	8.0 8.0	33.1 33.1	7.3 7.3	94.1 94.2	11.7 11.9	6.3	7.3	10.2	0.7
08-03-21	Mid-Flood	TCE-C1	Cloudy	Moderate	10:23	8.3	Surface	1.0	1	17.9	7.9	34.3	7.3	94.2 95.2	4.8	4.8			
									2	17.9	7.9	34.3	7.4	95.2	4.8	4.6	7.3		
							Middle	4.2	1	17.8	7.9	34.9	7.3	94.8	6.3	4.6	7.3	6.3	4.5
							Bottom	7.3	2	17.8 17.8	7.9 7.9	34.9 35.4	7.3 7.4	94.9 96.2	6.4 7.7	4.4 4.3		-	
							Dotton	7.5	2	17.8	7.9	35.4	7.4	96.2	7.7	4.4	7.4		
		TCE-C2	Cloudy	Moderate	8:11	13.2	Surface	1.0	1	18.0	8.0	33.9	6.3	81.5	3.8	5.4			
							Middle	6.6	2	18.0 17.9	8.0 7.9	33.9 34.6	6.3	81.4 81.0	3.9 5.0	5.2 4.1	6.3		
							madic	0.0	2	17.9	7.9	34.6	6.2	81.0	5.0	4.3	•	4.5	4.5
							Bottom	12.2	1	18.0	7.9	34.6	6.2	80.9	4.5	4.0	6.2		
		TCE-WQM1	Cloudy	Moderate	9:39	8.2	Surface	1.0	2	18.0 18.3	7.9 7.9	34.6 33.2	6.2	81.0 87.1	4.5 8.5	4.0 8.8	-		
		TCE-WQWII	Cloudy	Moderate	9.39	6.2	Surface	1.0	2	18.3	7.9	33.2	6.7	87.2	8.7	8.3			
							Middle	4.1	1	18.3	7.8	33.2	7.0	90.7	9.2	8.0	6.9	8.7	8.2
							Bottom	7.2	2	18.3 18.3	7.8 7.8	33.2 33.2	7.0 7.4	90.9 95.7	9.2 8.3	8.1 7.9		-	
							DOROIII	1.4	2	18.3	7.8	33.2	7.4	95.9	8.3	7.9	7.4		
		TCE-WQM2a	Cloudy	Moderate	8:54	7.0	Surface	1.0	1	18.1	7.9	32.9	6.7	86.9	5.5	3.7			
							Middle	3.5	2	18.1 18.2	7.9 7.9	32.9 33.1	6.7	86.9 89.1	5.5 7.3	4.0 3.5	6.8		
							ivilddie	3.3	2	18.2	7.9	33.1	6.9	89.1 89.6	7.3	3.5	1	8.3	3.4
							Bottom	6.0	1	18.1	7.8	33.4	7.3	94.2	11.7	3.0	7.3	1	
		TOT WOLKS	Cl. 1	M. 1 .	0.44	40.0	C 1	4.0	2	18.1	7.8	33.4	7.4	95.6	11.9	3.0	7.3		
		TCE-WQM2b	Cloudy	Moderate	8:41	10.9	Surface	1.0	2	18.1 18.1	8.0 8.0	33.2 33.2	6.6	85.0 84.8	5.5 5.4	5.7 5.2	1		
							Middle	5.5	1	18.1	7.9	33.7	6.7	86.6	6.3	4.9	6.6	6.4	4.9
								1	2	18.1	7.9	33.7	6.7	86.8	6.3	4.8		0.4	4.9
							Bottom	9.9	2	18.0 18.0	7.9 7.9	34.3 34.3	6.9	89.5 89.7	7.5 7.5	4.2 4.4	6.9		
		TCE-WQM3A	Cloudy	Moderate	9:15	4.2	Surface	1.0	1	18.1	7.9	32.8	7.2	92.9	4.9	4.2	7.2		
									2	18.1	7.9	32.8	7.2	92.9	4.9	4.5	7.2	5.1	4.2
							Bottom	3.2	2	18.1 18.1	7.8 7.8	32.8 32.8	7.4 7.4	95.5 95.7	5.3 5.4	4.1 4.1	7.4	5.1	
		TCE-WQM4	Cloudy	Moderate	9:26	3.6	Surface	1.0	1	18.1 18.1	7.8 8.0	32.8 33.0	7.4	95.7	9.4	4.1 9.5			
									2	18.1	8.0	33.0	7.2	92.1	9.5	9.4	7.1	9.7	8.6
							Bottom	2.6	1	18.1	8.0	33.1	7.6	98.4	10.0	7.6	7.6	3.7	3.0
			1						2	18.1	8.0	33.1	7.7	98.7	9.9	8.0		1	1

10-03-21	Tide Mid-Ebb	Station	Weather Condition	Sea Condition	Sampling Time	Water Depth	Water Level	Sampling depth	Replicate	T	T.T	Salinity	Oxygen (DO)	DO Saturation	Turbidity	(SS)	DO	Depth-averaged Turbidity	SS
10-03-21	Mid-Ebb					(m)		(m)	Kepitcate	Temperature (°C)	pH	(ppt)	(mg/L)	(%)	(NTU)	(55) (mg/L)	(mg/L)	(NTU)	(mg/L)
		TCE-C1	Cloudy	Moderate	13:01	8.4	Surface	1.0	1	20.9	8.1	31.7	7.4	99.5	4.2	6.1	(Hig/L)	(110)	(mg/L)
									2	20.9	8.1	31.7	7.4	99.5	4.2	5.9	7.3		
							Middle	4.2	2	20.7	8.1 8.1	31.9 31.9	7.3 7.3	97.5 97.5	4.6 4.6	6.8		4.7	6.8
							Bottom	7.4	1	20.5	8.1	32.6	7.2	96.7	5.4	7.4	7.2		
'									2	20.5	8.1	32.6	7.2	96.7	5.4	8.0	7.2		
		TCE-C2	Cloudy	Moderate	10:50	13.8	Surface	1.0	1 2	20.5	8.0	32.8	6.2	83.5	3.6	6.5			
1							Middle	6.9	1	20.5	8.0 8.0	32.8 32.8	6.2	83.5 83.3	3.6 3.5	5.8 4.3	6.2		
1									2	20.5	8.0	32.8	6.2	83.3	3.5	5.4		4.1	5.1
1							Bottom	12.8	1	20.5	7.9	32.9	6.1	82.7	5.3	4.0	6.1		
1		TCE-WQM1	Cloudy	Moderate	12:13	8.8	Surface	1.0	2	20.5	7.9 8.0	32.9 32.2	6.1	82.7 90.4	5.3 6.4	4.6 8.2			+
ı		ICE-WQMI	Cloudy	Moderate	12:13	8.8	Surrace	1.0	2	20.9	8.0	32.2	6.7	90.4	6.4	8.6	-		
ı							Middle	4.4	1	20.8	8.0	32.2	6.8	91.5	6.9	9.4	6.7	6.9	0.0
1									2	20.8	8.0	32.2	6.8	91.5	6.9	8.6		6.9	8.8
ı							Bottom	7.8	1	20.8	8.0	32.2	6.8	92.1	7.5	8.5	6.8		
ı		TCE-WQM2a	Cloudy	Moderate	11:33	7.0	Surface	1.0	1	20.8 20.7	8.0 8.0	32.2 31.6	6.8	92.2 89.2	7.3 4.5	9.5 5.2			+
ı		TCL WQ.MZ	Cloudy	Moderate	11.00	7.0	Surface	2.0	2	20.7	8.0	31.6	6.7	89.2	4.5	5.9	6.6		
ı							Middle	3.5	1	20.7	8.0	31.7	6.6	89.1	4.5	5.8	6.6	4.8	6.0
ı							Bottom	6.0	2	20.7	8.0 8.0	31.7 32.0	6.6 7.0	89.1 94.5	4.5 5.5	6.2			
ı							bottom	6.0	2	20.6	8.0	32.0	7.0	94.5	5.5	6.8	7.0		
ı		TCE-WQM2b	Cloudy	Moderate	11:18	10.8	Surface	1.0	1	20.6	8.0	31.9	6.5	87.1	4.5	5.6			+
ı									2	20.6	8.0	31.9	6.5	87.0	4.5	5.3	6.4		
ı							Middle	5.4	2	20.6	8.0	32.6	6.3	84.5	4.9	5.2	.1	5.0	6.4
1							Bottom	9.8	1	20.6	8.0 8.0	32.6 32.8	6.3	84.5 88.2	4.9 5.7	8.4	1		
1							Dottom	7.0	2	20.5	8.0	32.8	6.6	88.4	5.7	7.8	6.6		
1		TCE-WQM3A	Cloudy	Moderate	11:48	4.0	Surface	1.0	1	20.9	8.0	31.6	6.8	91.1	7.5	11.6	6.8		
1									2	20.9	8.0	31.6	6.8	91.1	7.5	10.8	0.0	10.8	11.0
ı							Bottom	3.0	2	20.8	8.0 8.0	31.6 31.6	7.2 7.2	96.7 96.7	14.1 14.1	10.2 11.3	7.2		
ı		TCE-WQM4	Cloudy	Moderate	11:59	3.7	Surface	1.0	1	20.8	8.0	32.0	6.7	89.7	4.4	8.3			+
1			,						2	20.8	8.0	32.0	6.7	89.7	4.4	7.2	6.7	4.9	8.4
1							Bottom	2.7	1	20.8	8.0	32.0	6.9	92.9	5.4	8.9	6.9	4.9	0.4
10-03-21	Mid-Flood	TCE-C1	Cloudy	Moderate	15:02	8.4	Surface	1.0	2	20.8 21.0	8.0 8.1	32.0 32.1	6.9 7.3	92.9 99.0	5.4 4.5	9.1 4.9			+
10-03-21	Wild-Flood	TCE-CI	Cloudy	Wioderate	13.02	0.4	Surrace	1.0	2	21.0	8.1	32.1	7.3	99.0	4.5	4.9	-		
ı							Middle	4.2	1	20.9	8.1	32.2	7.2	97.8	4.8	7.4	7.3	4.8	6.8
ı									2	20.9	8.1	32.2	7.2	97.8	4.8	7.8		4.0	0.0
ı							Bottom	7.4	2	20.5	8.1 8.1	32.7 32.7	7.1 7.1	95.9 95.9	5.2 5.2	8.3 7.4	7.1		
1		TCE-C2	Cloudy	Moderate	17:31	12.9	Surface	1.0	1	20.5	8.0	32.7	6.3	95.9 84.6	5.2	6.7			+
ı									2	20.5	8.0	32.9	6.3	84.6	5.9	7.5	6.2		
ı							Middle	6.5	1	20.5	8.0	33.0	6.2	83.5	8.4	6.2	6.2	8.3	6.7
1							Bottom	11.9	2	20.5 20.5	8.0 8.0	33.0 33.0	6.2	83.5 84.4	8.4 10.7	6.7			
ı							Dottom	11.9	2	20.5	8.0	33.0	6.3	84.4	10.7	6.8	6.3		
ı		TCE-WQM1	Cloudy	Moderate	16:01	8.8	Surface	1.0	1	21.1	8.0	31.9	6.9	93.3	6.1	7.4			
,							30.44		2	21.1	8.0	31.9	6.9	93.3	6.1	8.3	6.9		
				1			Middle	4.4	2	21.1 21.1	8.0 8.0	32.0 32.0	6.8	92.3 92.3	7.6 7.6	7.1 8.5	-	6.9	8.1
,							Bottom	7.8	1	21.0	8.0	32.1	6.9	93.1	7.0	8.1		1	
,									2	21.0	8.0	32.1	6.9	93.1	7.1	9.0	6.9		
		TCE-WQM2a	Cloudy	Moderate	16:41	7.3	Surface	1.0	1	20.7	8.0	31.9	6.6	88.9	4.4	7.6	-		
,							Middle	3.7	2	20.7 20.7	8.0 8.0	31.9 31.9	6.6	88.9 89.1	4.4	8.3 7.7	6.6		
,							made		2	20.7	8.0	31.9	6.6	89.1	4.7	7.0	1	4.8	7.2
							Bottom	6.3	1	20.7	8.0	31.9	6.7	90.6	5.4	6.0	6.7		
,		TOT WOLES	CI- 1	16.5	14.55	11.2	6	1.0	2	20.7	8.0	31.9	6.7	90.6	5.4	6.6		1	+
		TCE-WQM2b	Cloudy	Moderate	16:55	11.2	Surface	1.0	2	20.8	8.0 8.0	31.8 31.8	6.8	91.7 91.7	3.3	5.1 5.9	1		
							Middle	5.6	1	20.8	8.0	31.9	6.7	90.4	3.6	6.0	6.8		
				1					2	20.8	8.0	31.9	6.7	90.4	3.6	6.7		3.7	6.2
,							Bottom	10.2	1	20.8	8.0	32.2	6.7	90.8	4.1	6.3	6.7		
,		TCE-WQM3A	Cloudy	Moderate	16:29	4.7	Surface	1.0	2	20.8	8.0 8.0	32.2 31.7	6.7	90.8 92.5	4.1 5.8	7.1 9.4			+
,		1 CL-WQWISH	Cloudy	wioderate	10.27	7./	Juriace		2	20.9	8.0	31.7	6.9	92.5	5.8	10.2	6.9		
,							Bottom	3.7	1	20.9	8.0	31.7	7.0	94.7	6.2	10.0	7.0	6.0	9.7
		TOT WOLF	G 1	10.1	4645	2.6	C (	4.0	2	20.9	8.0	31.7	7.0	94.7	6.2	9.3			
,		TCE-WQM4	Cloudy	Moderate	16:17	3.6	Surface	1.0	1 2	20.8 20.8	8.0 8.0	31.7 31.7	6.9	92.9 92.9	6.6	9.1 8.6	6.9		
				1			Bottom	2.6	1	20.8	8.0	31.7	6.9	93.5	7.2	12.4		6.9	10.9
									2	20.8	8.0	31.7	6.9	93.5	7.2	13.4	6.9		

			Weather			Water Depth		Sampling depth		Water		Salinity	Dissolved	DO Saturation	Turbidity	Suspended Solids		Depth-averaged	
Date	Tide	Station	Condition	Sea Condition	Sampling Time	(m)	Water Level	(m)	Replicate	Temperature (°C)	pH	(ppt)	Oxygen (DO) (mg/L)	(%)	(NTU)	(SS) (mg/L)	DO (mg/L)	Turbidity (NTU)	SS (mg/L)
12-03-21	Mid-Ebb	TCE-C1	Fine	Moderate	11:19	7.9	Surface	1.0	1	21.4	8.0	29.9	7.2	96.5	6.1	5.2	(11.6/ 2.)	(1110)	(mg L)
							Middle	4.0	2	21.3 21.0	8.0 8.0	29.9 31.5	7.2 7.1	96.3 95.2	6.1	4.8 6.2	7.1		
							wiiddie	4.0	2	21.0	8.0	31.5	7.1	95.3	6.7	5.9		6.7	5.9
							Bottom	6.9	1	20.8	8.0	32.2	7.1	95.1	7.3	6.8	7.1		
							- 1		2	20.8	8.0	32.1	7.1	95.1	7.4	6.5	7.1		
		TCE-C2	Fine	Calm	13:09	12.8	Surface	1.0	2	21.5 21.4	8.0 8.0	31.5 31.6	6.6	90.3 90.2	4.3 4.3	4.3 4.4			
							Middle	6.4	1	20.9	8.0	32.0	6.5	87.5	5.1	3.4	6.6	4.7	3.7
									2	20.9	8.0	32.1	6.5	87.1	5.0	3.6		4.7	3.7
							Bottom	11.8	2	20.7 20.7	8.0 8.0	32.6 32.6	6.5	87.3 87.4	4.6 4.6	3.0	6.5		
		TCE-WQM1	Fine	Calm	11:57	8.0	Surface	1.0	1	21.2	8.0	31.8	6.8	92.7	8.6	10.2			
									2	21.2	8.0	31.8	6.8	92.8	8.8	10.0	6.8		
							Middle	4.0	1	21.2	8.0	31.8	6.8	92.3	10.0	10.3	0.0	9.8	9.7
							Bottom	7.0	2	21.2 21.2	8.0 8.0	31.8 31.9	6.8	92.4 92.5	10.1 10.6	9.5 9.4		-	
							Dotton	7.0	2	21.2	8.0	31.9	6.8	92.8	10.5	9.0	6.8		
		TCE-WQM2a	Fine	Calm	12:35	7.1	Surface	1.0	1	21.5	8.0	31.2	6.8	91.7	4.6	4.8			
							Middle	3.6	2	21.5 21.0	8.0 8.0	31.2 31.4	6.8	91.7 90.2	4.6 5.4	4.4	6.7		
							whate	3.0	2	21.0	8.0	31.4	6.7	90.1	5.4	4.2	-	5.3	4.2
							Bottom	6.1	1	20.9	8.0	31.6	6.7	90.3	5.8	4.0	6.7		
		TCT IVONOL	F:	Madamia	12.47	10.0	Confess	1.0	2	20.9	8.0	31.6	6.7	90.2	5.8	3.8			
		TCE-WQM2b	Fine	Moderate	12:47	10.0	Surface	1.0	2	21.8 21.8	7.9 7.9	28.9 28.9	6.9	93.5 93.4	4.1 4.1	3.8 4.1	-		
							Middle	5.0	1	21.7	8.0	30.2	6.8	92.1	4.2	4.4	6.9	4.2	4.3
									2	21.7	8.0	30.3	6.8	92.1	4.1	4.4		4.2	4.3
							Bottom	9.0	2	21.0 21.0	8.0 8.0	31.5 31.5	6.7	91.0 91.0	4.4	4.7	6.7		
		TCE-WQM3A	Fine	Calm	12:25	3.3	Surface	1.0	1	21.0	8.0	31.5	6.9	94.3	9.2	2.7			
									2	21.8	8.0	31.0	6.9	94.2	9.3	2.8	6.9	9.9	2.6
							Bottom	2.3	1	21.3	8.0	31.2	6.9	93.4	10.8	2.6	6.9	9.9	2.0
		TCE-WQM4	Fine	Calm	12:16	3.2	Surface	1.0	2	21.4 21.4	8.0 8.0	31.2 31.7	6.9	93.7 91.7	10.3 4.7	2.4 4.8			
		ICE-WQM4	rine	Caim	12:16	3.2	Surface	1.0	2	21.4	8.0	31.7	6.7	91.5	4.7	4.8	6.7		
							Bottom	2.2	1	21.3	8.0	31.8	6.8	92.6	4.9	6.4	6.8	4.8	5.5
							- 1		2	21.3	8.0	31.7	6.9	93.0	4.7	6.0	0.0		
12-03-21	Mid-Flood	TCE-C1	Fine	Moderate	8:34	7.6	Surface	1.0	1 2	21.4 21.4	8.0 8.0	29.7 29.7	7.2 7.2	96.7 96.7	6.1	4.4 4.5			
							Middle	3.8	1	20.8	8.0	31.5	7.1	95.0	7.1	4.6	7.1	7.3	4.7
									2	20.8	8.0	31.6	7.1	95.0	7.2	4.7		7.3	4.7
							Bottom	6.6	2	20.7	8.0 8.0	32.2 32.1	7.0	94.5 94.8	8.4 8.5	5.2 4.8	7.0		
		TCE-C2	Fine	Calm	6:16	11.8	Surface	1.0	1	20.7	7.9	32.1	6.4	86.8	6.2	10.9			
									2	20.8	7.9	32.1	6.4	86.6	6.1	11.1	6.4		
							Middle	5.9	1	20.7	7.9	32.3	6.4	86.3	5.8	11.1	0.4	6.2	10.6
							Bottom	10.8	2	20.7 20.7	7.9 7.9	32.3 32.4	6.4	86.4 86.6	5.9 6.5	10.8 9.7		1	
							Dottoni	10.0	2	20.7	7.9	32.4	6.4	86.7	6.8	10.2	6.4		
		TCE-WQM1	Fine	Calm	7:24	8.3	Surface	1.0	1	21.1	8.0	32.0	6.7	91.0	8.1	9.5			
							Middle	4.2	2	21.1	8.0 8.0	32.0 32.0	6.7	91.0	8.1	9.8	6.7		
							ivildale	4.2	2	21.1 21.1	8.0	32.0	6.8	91.5 91.2	8.4 8.5	8.1 7.8	1	8.5	8.5
							Bottom	7.3	1	21.1	8.0	32.0	6.8	91.7	9.0	7.7	6.8	1	1
		mon version		16.5			0.1		2	21.1	8.0 7.9	32.0	6.8	91.4	8.8	7.8	0.0		1
		TCE-WQM2a	Fine	Moderate	6:53	6.6	Surface	1.0	2	21.1 21.1	7.9 7.9	31.0 31.0	6.8	91.8 91.8	5.5 5.5	4.9 5.2	1		
							Middle	3.3	1	21.1	7.9	31.1	6.8	91.9	5.6	4.5	6.8	5.0	
									2	21.1	7.9	31.1	6.8	91.9	5.7	4.4		5.6	4.5
							Bottom	5.6	2	21.1 21.1	7.9 7.9	31.1 31.1	6.8	92.2 92.4	5.5 5.6	4.2 3.7	6.9		1
		TCE-WQM2b	Fine	Moderate	6:40	11.2	Surface	1.0	1	21.0	7.9	31.3	6.7	90.2	9.0	6.8			+
									2	21.0	7.9	31.3	6.7	90.1	9.2	7.0	6.7		
							Middle	5.6	1	20.9	7.9	31.4	6.7	89.6	10.4	8.1	0.7	10.2	8.0
							Bottom	10.2	2	20.9	7.9 7.9	31.4 31.5	6.7	89.6 89.4	10.5 11.2	8.3 8.7		+	
							DOMOIN	10.2	2	20.9	7.9	31.5	6.7	89.6	10.9	9.0	6.6		
		TCE-WQM3A	Fine	Calm	7:03	3.8	Surface	1.0	1	21.1	7.9	30.9	6.9	92.4	5.0	2.0	6.9		
							Bottom	2.8	2	21.1 21.0	7.9 7.9	30.9 31.1	6.9	92.6 93.1	5.1 6.4	2.4		5.8	2.4
							pottom	2.8	2	21.0	7.9 8.0	31.1	6.9	93.1 93.4	6.4	2.5	6.9		
		TCE-WQM4	Fine	Calm	7:12	3.2	Surface	1.0	1	20.9	8.0	31.6	6.7	90.9	5.9	3.0	6.8		
									2	21.0	8.0	31.6	6.8	91.3	5.9	3.0	0.0	6.1	2.9
1	Ì						Bottom	2.2	1	21.0 21.0	8.0 8.0	31.7 31.7	6.9	92.8 93.0	6.2	3.0 2.6	6.9	1	1

Date	Tide	Station	Weather	Sea Condition	Sampling Time	Water Depth	Water Level	Sampling depth	Replicate	Water Temperature	рН	Salinity	Dissolved Oxygen (DO)	DO Saturation	Turbidity	Suspended Solids (SS)	DO	Depth-averaged Turbidity	SS
			Condition			(m)		(m)		(°C)		(ppt)	(mg/L)	(%)	(NTU)	(mg/L)	(mg/L)	(NTU)	(mg/L)
15-03-21	Mid-Ebb	TCE-C1	Cloudy	Moderate	12:41	8.1	Surface	1.0	2	21.6 21.6	8.0 8.0	31.5 31.5	7.2 7.3	98.7 98.8	4.3 4.3	5.0 5.3			
							Middle	4.1	1	21.2	8.0	32.4	7.1	96.8	5.7	5.0	7.2	6.1	4.7
							D	7.4	2	21.2	8.0	32.4 33.4	7.1	97.1	5.8	4.7		0.1	4.7
							Bottom	7.1	2	21.1 21.1	8.1 8.1	33.4	7.0 7.0	96.2 96.2	8.3 8.2	4.2 3.9	7.0		
		TCE-C2	Cloudy	Moderate	14:37	12.7	Surface	1.0	1	22.7	8.0	30.6	6.8	93.6	4.0	7.1			
							Middle	6.4	2	22.6 22.0	8.0 8.0	30.6 30.8	6.7	93.2 90.0	4.1 5.7	7.0 4.5	6.7		
							wiiddie	0.4	2	22.0	8.0	30.8	6.6	90.0	5.7	4.6		6.1	5.3
							Bottom	11.7	1	21.5	8.0	31.4	6.5	88.6	8.7	4.1	6.5	1	
		TCE-WQM1	Cloudy	Calm	13:18	8.2	Surface	1.0	2	21.5 21.9	8.0 8.0	31.3 31.4	6.6	89.3 94.2	8.6 7.9	4.4 12.4		-	
		TCL-WQWII	Cloudy	Cami	13.10	0.2			2	21.9	8.0	31.4	6.9	94.0	8.2	11.9	6.0		
							Middle	4.1	1	21.8	8.0	31.5	6.9	94.1	8.9	11.7	6.9	8.9	11.4
							Bottom	7.2	1	21.8 21.7	8.0 8.0	31.5 31.5	6.9	94.0 94.0	9.2 9.7	11.2 10.8		-	
							Dottom		2	21.7	8.0	31.5	6.9	94.0	9.6	10.4	6.9		
		TCE-WQM2a	Cloudy	Moderate	14:01	7.7	Surface	1.0	1	22.0	8.0	30.5	6.7	91.0	5.0	6.2			
							Middle	3.9	2	22.0 21.8	8.0 8.0	30.5 30.6	6.7	91.0 90.4	5.0 5.5	5.8 7.5	6.7		
									2	21.8	8.0	30.6	6.6	90.4	5.3	7.3		5.1	7.2
							Bottom	6.7	1 2	21.8	8.0	30.7 30.7	6.6	90.3	4.9	8.0	6.6		
		TCE-WQM2b	Cloudy	Moderate	14:13	10.6	Surface	1.0	1	21.8 21.9	8.0 8.0	29.8	6.6	90.3 90.4	4.9 5.6	8.5 6.1			
			,						2	21.9	8.0	29.8	6.7	90.4	5.6	6.2	6.7		
							Middle	5.3	2	21.8 21.8	8.0 8.0	30.0 30.0	6.7	90.6 90.5	6.8	6.9 7.2		6.9	7.1
							Bottom	9.6	1	21.8	8.0	30.1	6.7	90.4	8.5	8.2		1	
									2	21.8	8.0	30.1	6.7	90.5	8.2	7.9	6.7		
		TCE-WQM3A	Cloudy	Calm	13:46	4.0	Surface	1.0	2	22.3 22.3	8.1 8.1	30.6 30.6	6.6	91.2 91.3	12.0 12.1	16.7 17.0	6.6		
							Bottom	3.0	1	22.3	8.1	30.6	6.7	91.5	12.1	17.8		12.0	17.4
									2	22.3	8.1	30.6	6.7	91.9	11.9	18.0	6.7		
		TCE-WQM4	Cloudy	Calm	13:34	4.2	Surface	1.0	2	22.2	8.0 8.0	30.6 30.6	6.6	90.8 90.8	7.4 7.5	5.2 5.3	6.6		
							Bottom	3.2	1	22.0	7.9	30.6	6.6	90.3	9.6	6.8		8.6	5.9
									2	22.0	7.9	30.6	6.6	90.3	9.7	6.2	6.6		
15-03-21	Mid-Flood	TCE-C1	Cloudy	Moderate	10:10	8.4	Surface	1.0	2	21.2 21.2	8.0 8.0	32.1 32.1	7.1 7.1	96.3 96.4	10.8 11.0	7.1 7.4			
							Middle	4.2	1	21.2	8.0	32.5	7.0	95.8	14.3	7.1	7.1	13.7	6.7
									2	21.2	8.0	32.5	7.0	95.8	14.0	6.5		15.7	6.7
							Bottom	7.4	2	21.1 21.1	8.1 8.1	33.3 33.2	7.0 7.0	95.7 95.8	15.9 16.0	5.9 6.3	7.0		
		TCE-C2	Cloudy	Moderate	8:08	12.9	Surface	1.0	1	21.5	7.9	31.1	6.6	89.0	5.0	8.9			
							10111		2	21.5	7.9	31.1	6.6	88.9	5.0	8.8	6.5		
							Middle	6.5	1 2	21.5 21.5	7.9 7.9	31.1 31.1	6.5 6.5	88.2 88.1	5.7 5.8	8.3 8.4		8.1	8.3
							Bottom	11.9	1	21.4	7.9	31.4	6.5	87.8	13.5	7.7	6.5		
							- 1		2	21.4	7.9	31.4	6.5	88.3	13.7	7.4	0.5		
		TCE-WQM1	Cloudy	Calm	9:17	8.5	Surface	1.0	2	22.0 22.0	8.0 8.0	30.9 30.9	6.7	91.2 91.2	5.7 5.7	7.0 7.2			
							Middle	4.3	1	22.0	8.0	30.9	6.6	90.7	6.9	7.2	6.6	7.1	7.3
							Davis	7.5	2	22.0 21.9	8.0 8.0	30.9 31.0	6.6	90.6 90.8	7.1 8.3	7.2		- '	7.3
							Bottom	7.5	2	21.9	8.0	31.0	6.6	91.5	8.7	7.4 7.6	6.7	1	
		TCE-WQM2a	Cloudy	Moderate	8:44	7.9	Surface	1.0	1	21.7	7.9	30.3	6.7	90.9	10.1	10.4			
							Middle	4.0	1	21.7 21.7	7.9 7.9	30.3 30.3	6.7	90.9 90.2	10.1 13.2	10.3 10.6	6.7		
							Middle	4.0	2	21.7	7.9	30.3	6.6	90.2	13.2	10.5		13.2	10.6
							Bottom	6.9	1	21.7	7.9	30.3	6.7	90.2	16.3	10.7	6.7	1	
		TCE-WQM2b	Cloudy	Moderate	8:30	10.9	Surface	1.0	2	21.7 21.6	7.9 7.9	30.3 30.6	6.7	90.3 89.5	16.4 11.5	10.8 17.7	***	1	-
		TCE-WQWIZD	Cloudy	woderate	6:30	10.9	Surrace	1.0	2	21.6	7.9	30.6	6.6	89.5 89.6	11.5	17.7		1	
							Middle	5.5	1	21.6	7.9	30.6	6.6	89.3	11.7	17.4	6.6	12.0	17.2
							Bottom	9.9	2	21.6 21.6	7.9 7.9	30.6 30.6	6.6	89.3 89.6	12.2 12.4	17.1 16.5		-	
							DOLLOIN	7.7	2	21.6	7.9	30.6	6.6	89.5	12.4	16.8	6.6	1	
		TCE-WQM3A	Cloudy	Calm	8:55	4.0	Surface	1.0	1	21.7	7.9	30.5	6.6	89.9	6.3	8.0	6.6		
							Bottom	3.0	2	21.7 21.6	7.9 7.9	30.5 30.6	6.6	90.1 90.6	6.3	7.6 8.9		6.2	8.4
							DOTTOIN	3.0	2	21.6	7.9	30.6	6.8	90.6	6.1	9.0	6.7	1	
		TCE-WQM4	Cloudy	Calm	9:05	4.3	Surface	1.0	1	21.7	8.0	30.5	6.7	90.9	6.9	6.8	6.7		
							Bottom	3.3	2	21.7 21.6	8.0 8.0	30.5 30.5	6.7 7.0	90.9 94.8	7.0 11.4	6.8 8.0		9.2	7.4
							DOLLOIN	3.3	2	21.6	8.0	30.5	7.0	95.0	11.4	8.0	7.0	1	
				*	•														

CS-N-2  Mal-She	Ī			Weather			Water Doub		Campling doub		Water		Salinity	Dissolved	DO Saturation	Turbidity	Suspended Solids		Depth-averaged	
17-03-1   Mod Rich   FCT CI   Mod   Calm   15.77   40   South   15.77   40   South   15.77   40   South   15.77   40   South   15.77		Tide	Station	Condition	Sea Condition	Sampling Time	Water Depth (m)	Water Level	Sampling depth (m)	Replicate		pH		Oxygen (DO)		(NTU)	(SS) (mg/L)	DO (mg/L)	Turbidity (NTU)	SS (mg/L)
TCE-C2	t	Mid-Ebb	TCE-C1	Misty	Calm	13:37	8.0	Surface	1.0	1		8.0	30.3	7.4	100.8	4.2	6.5	(mg/L)	(NTU)	(mg/L)
TCL-WORLD   May   Calm   154				,							22.4			7.4		4.2	6.2	7.1		
Times								Middle	4.0								6.0 5.0		5.7	4.8
TCH NQMB   May   Calm   1150   126   Select   13   12   12   12   12   12   12   12								Bottom	7.0								2.1			
Statistic   Stat										2	21.8	8.0	32.7		90.1	7.4	2.8	6.6		
Made			TCE-C2	Misty	Calm	15:43	12.6	Surface	1.0								5.9			
Political   Poli								Middle	6.2			7.9			91.3	5.6	5.5 5.6	6.5		
TCA-WQMD   Masy   Calm   14-20   6.2   5.5   5.0   5								Middle	6.3								6.2		6.9	6.1
TCE-WQM3								Bottom	11.6	1							7.0			
TCE-WQMD   Misty   Calm   15:05   For   Misty   Calm   15:07   Mis																	6.6	6.0		
Middle   1   1   228   79   303   67   527   73   73   73   73   73   73   73			TCE-WQM1	Misty	Calm	14:29	8.2	Surface	1.0	_				0.10			9.4			
Bulsin   72   2   23   79   303   67   20   75   72   72   73   73   68   69   77   72   72   73   73   68   69   75   72   73   73   68   69   75   73   73   73   73   73   73   73								Middle	4.1								10.4 9.5	6.8		
Robin   P.2   1   229   78   303   6.5   807   72   72   72   72   72   73   73   7								madic	2.2	-						7.5	10.3	1	7.3	9.4
TCH-WQMD  Moley   Color   1515   76								Bottom	7.2	1	22.9		30.3	6.6		7.2	8.0	6.5		
TCE-WQMD																	8.9	0.5		
Middle   Sa			TCE-WQM2a	Misty	Calm	15:05	7.6	Surface	1.0		23.1	7.9					4.6 5.1			
TCE-WQM14								Middle	3.8								4.7	6.5		
TCE-WQM2D												7.9					5.6		4.6	5.3
TC-WQXADb   Money   Color   15:17   10:6   Surface   1.0   1   21:4   7.9   28:3   7.0   96.1   48   48   49.6   5.0   6.0								Bottom	6.6								6.3	6.0		
Middle			TOT WOLKS	30.	6.1	45.45	40.6	6 (	4.0								5.4			
Middle			TCE-WQM2b	Misty	Calm	15:17	10.6	Surface	1.0								4.7 5.7			
TCI-WQMIA   Misty   Calm   1452   4.0   Surface   1.0   1   225   79   224   6.2   6.4   76   70   70   70   70   70   70   70								Middle	5.3								5.9	6.6		
TCE-WQMIA   Misty   Calm   1452   40   Surface   1.0   1   216   8.0   28.5   6.3   88.1   15.6										2				6.4	87.0		6.2		6.5	5.9
TCE-WQMAA   Misy   Calm   1452   40   Surface   1.0   1   2.16   8.0   29.8   6.2   88.7   15.4								Bottom	9.6								6.5	6.2		
Petton   No.   Petton   Petton   No.   Petton   Petton   Petton   No.   Petton			TCE WOM2 A	Minter	Colm	14.50	4.0	Cumfoco	1.0	_							6.1 25.0			
Restrict			TCE-WQM5A	Misty	Caim	14:52	4.0	Surrace	1.0								25.6	6.3		
TCE-WQM1								Bottom	3.0		23.5	7.8	29.8		78.3	16.1	22.4	5.6	15.8	24.1
Part																	23.4	5.6		
Bottom   3.2			TCE-WQM4	Misty	Calm	14:40	4.2	Surface	1.0			7.8					8.3 9.4	5.9		
TGE-CI								Bottom	3.2								7.3		12.5	7.9
Middle   42   1   218   8.0   33.0   6.8   93.8   11.4								Dottom	0.2								6.5	5.6		
Middle   42		Mid-Flood	TCE-C1	Misty	Calm	10:14	8.4	Surface	1.0								7.1			
Rottom																	8.0	6.8		
Rottom   74								Middle	4.2								8.3 8.4	-	16.7	8.4
TCE-WQM2a Misty Calm 8:08 128								Bottom	7.4				32.5		87.7		8.9		-	
Middle										2							9.7	6.4		
Middle			TCE-C2	Misty	Calm	8:08	12.8	Surface	1.0								4.2			
TCE-WQM1								Middle	6.4			7.9				5.0	4.1 4.6	6.4		
TCE-WQM1 Misty Calm 9.20 8.6 Surface 1.0 1 22.0 7.9 30.7 6.3 85.5 6.6 6.6 6.6 6.6 6.6 6.6 6.6 6.6 6.6								Middle	0.4	-							4.6	-	5.8	4.7
TCE-WQM1 Misty Calm 920 8.6 Surface 1.0 1 22.5 7.9 30.2 6.3 87.1 4.5								Bottom	11.8			7.9	30.7		85.5		5.1	6.2		
Middle																	5.5	6.2		
Middle   4.3   1   22.5   7.9   30.2   6.3   86.2   5.4	l		TCE-WQM1	Misty	Calm	9:20	8.6	Surface	1.0								7.6 7.4	1		
TCE-WQM2a	l							Middle	4.3								6.7	6.3		
Bottom	l									-	22.5	7.9	30.2	6.3	86.1	5.4	7.1	1	5.4	6.9
TCE-WQM2a Misty Calm 8:48 7.8 Surface 1.0 1 22.4 7.9 29.3 6.4 86.7 5.6 86.7 5.6 Middle 3.9 1 22.4 7.9 29.3 6.4 86.7 5.6 86.7 5.6 Middle 3.9 1 22.4 7.9 29.3 6.4 86.7 5.6 86.7 5.6 Middle 3.9 1 22.4 7.9 29.5 6.1 83.4 8.0 80.0 80.0 80.0 80.0 80.0 80.0 80.	l							Bottom	7.6	1		7.9	30.4	6.0	82.6	6.3	6.4	6.0	1	
TCE-WQM2b Misty Calm 8:32 11.4 Surface 1.0 1 22.2 7.9 29.8 6.3 86.1 9.3 10.4 1 22.2 7.8 29.9 6.0 82.3 10.4 10.4 1 22.2 7.8 29.9 6.0 82.3 10.4 10.5 10.5 10.5 10.5 10.5 10.5 10.5 10.5	l		TCE MONES	Minter	Color	0.40	7.0	Confess	1.0								6.2		1	
Middle   3.9   1   22.4   7.9   29.5   6.1   83.4   8.0	l		TCE-WQM2a	Misty	Caim	8:48	7.8	Surface	1.0				29.3			5.6	4.1 4.6	1		
TCE-WQM3A   Misty   Calm   8.57   4.0   Surface   1.0   1   22.4   7.9   29.7   6.0   82.2   8.3	l							Middle	3.9								4.4	6.2	7.7	F 0
TCE-WQM2b Misty Calm 8.32 11.4 Surface 1.0 1 22.3 7.9 29.4 6.5 88.8 6.3      Middle 57 1 22.2 7.9 29.7 6.3 86.2 9.3     Middle 57 1 22.2 7.9 29.7 6.3 86.2 9.3     Middle 57 1 22.2 7.9 29.7 6.3 86.2 9.3     Middle 57 1 22.2 7.9 29.7 6.3 86.2 9.3     Middle 57 1 22.2 7.9 29.7 6.3 86.2 9.3     Middle 57 1 22.2 7.9 29.8 6.3 86.1 9.3     Middle 57 1 22.2 7.8 29.9 6.1 83.7 10.9     Middle 57 1 22.2 7.8 29.9 6.1 83.7 10.9     Middle 57 1 22.2 7.8 29.9 6.0 82.3 10.4     Middle 57 1 22.2 7.8 29.9 6.0 82.3 10.4     Middle 57 1 22.2 7.8 29.9 6.0 82.3 10.4     Middle 57 1 22.2 7.8 29.9 6.0 82.3 10.4     Middle 57 1 22.2 7.8 29.9 6.0 82.3 10.4     Middle 57 1 22.2 7.8 29.9 6.0 82.3 10.4     Middle 57 1 22.4 7.9 29.8 6.1 84.1 5.0     Middle 57 1 22.4 7.9 29.8 6.1 84.1 5.0     Middle 57 1 22.2 7.8 29.9 6.1 84.1 5.0     Middle 57 1 22.4 7.9 29.8 6.1 84.1 5.0     Middle 57 1 22.2 7.8 29.9	l										22.4	7.9	29.7	6.0	82.2		5.3		1.1	5.0
TCE-WQM2b Misty Calm 832 11.4 Surface 1.0 1 22.3 7.9 29.4 6.5 88.8 6.3    Column	l							Bottom	6.8								5.9	5.6		
Middle   5.7   1   22.2   7.9   29.4   6.5   87.9   6.8	l		TCE-MOM2L	Mieto	Calm	8-27	11.4	Surface	1.0								5.8 8.6			
Middle   5.7   1   22.2   7.9   29.7   6.3   86.2   9.3	l		TCL-WQIVI2D	iviisty	Cann	0.32	11.4	Juliace	1.0						87.9		9.7	1		
Bottom   10.4   1   22.2   7.8   29.9   6.1   83.7   10.9   10.4   1   22.2   7.8   29.9   6.1   83.7   10.9   10.4   1   22.2   7.8   29.9   6.0   82.3   10.4	l							Middle	5.7	1	22.2	7.9	29.7	6.3	86.2	9.3	10.2	6.4	8.8	7.7
Calm   Surface   Calm   Calm	l																5.3		0.0	/./
TCE-WQM3A Misty Calm 8:57 4.0 Surface 1.0 1 22:4 7.9 29:8 6.1 84:1 5.0	l							Bottom	10.4								6.3	6.1		
	l		TCE-WOM3A	Mistv	Calm	8:57	4.0	Surface	1.0								6.2 8.9		<del>                                     </del>	
	l		remon					- Indee		2	22.4	7.9	29.8	6.1	83.9	5.0	9.6	6.1	E 4	0.0
Bottom 3.0 1 22.4 7.8 29.9 5.6 76.9 5.9	l							Bottom	3.0	1	22.4	7.8	29.9	5.6	76.9	5.9	8.5	5.6	5.4	9.0
2 224 7.8 299 5.6 76.8 5.8 TOWN Mrs. Col. 200 200 200 200 200 200 200 200 200 20	l		TOT WOLK	NC :	61	0.00	4.2	61	4.0								9.0		1	1
TCE-WQM4 Misty Calm 9:08 4.2 Surface 1.0 1 22.4 7.9 29.8 6.3 86.4 11.8 2 22.4 7.9 29.8 6.3 86.2 11.6	l		ICE-WQM4	Misty	Calm	9:08	4.2	Surface	1.0	-							7.6 8.6	6.3		
Bottom 3.2 1 22.4 7.9 29.8 6.2 84.2 18.3	l							Bottom	3.2		22.4	7.9					8.3		15.0	8.4
2 224 7.8 29.8 6.1 83.7 18.2	L									2	22.4	7.8	29.8	6.1	83.7	18.2	9.0	6.1		

			Weather			Water Depth		Sampling depth		Water		Salinity	Dissolved	DO Saturation	Turbidity	Suspended Solids		Depth-averaged	
Date	Tide	Station	Condition	Sea Condition	Sampling Time	(m)	Water Level	(m)	Replicate	Temperature (°C)	pH	(ppt)	Oxygen (DO) (mg/L)	(%)	(NTU)	(SS) (mg/L)	DO (mg/L)	Turbidity (NTU)	SS (mg/L)
19-03-21	Mid-Ebb	TCE-C1	Fine	Moderate	14:47	8.3	Surface	1.0	1	24.1	8.1	28.8	7.3	101.9	3.4	5.0	(mg/L)	(1410)	(mg/L)
is							Middle	4.2	2	24.1 22.6	8.1 8.1	28.8 32.1	7.3 7.0	101.8 96.8	3.5 4.6	6.0 5.1	7.1		
							Middle	4.2	2	22.6	8.1	32.0	7.0	96.8	4.6	5.8	-	4.8	5.0
							Bottom	7.3	1	22.4	8.1	32.6	6.8	95.0	6.3	4.4	6.8		
		TCE-C2	Fine	Moderate	16:48	14.4	Surface	1.0	2	22.4	8.1 7.9	32.6 29.7	6.8	94.9 87.4	6.4 4.7	3.9 5.7			
		TCE-C2	rine	Moderate	10:46	14.4	Surface	1.0	2	23.1	7.9	29.7	6.3	87.3	4.7	6.1			
							Middle	7.2	1	22.4	7.9	31.2	6.0	83.2	5.6	6.4	6.2	5.7	6.8
							Bottom	13.4	2	22.4 22.2	7.9 7.9	31.2 31.8	6.0 5.8	82.9 80.3	5.6 6.7	6.7 7.6		-	
							Dottom	13.4	2	22.2	7.9	31.8	5.8	80.4	6.7	8.3	5.8		
		TCE-WQM1	Fine	Calm	15:27	8.8	Surface	1.0	1	23.2	8.0	30.5	6.9	96.7	6.1	9.1			
							Middle	4.4	2	23.2 23.2	8.0 8.0	30.5 30.6	6.9	96.7 96.4	6.1	8.6 8.8	6.9		
							Middle	4.4	2	23.2	8.0	30.6	6.9	96.3	6.9	9.5	-	7.0	8.8
							Bottom	7.8	1	23.1	8.1	30.7	6.9	96.0	7.8	8.8	6.9		
		TOT WOLD		26.1	16:10			4.0	2	23.1	8.1	30.7	6.9	95.9	7.9	8.1	0.5		
		TCE-WQM2a	Fine	Moderate	16:10	7.6	Surface	1.0	2	23.6 23.6	8.0 8.0	29.4 29.4	6.6	91.8 91.8	4.8 4.8	8.9 8.7	-		
							Middle	3.8	1	23.1	7.9	29.7	6.3	87.0	4.7	9.2	6.4	4.7	9.3
							Bottom		2	23.1 22.5	7.9 7.9	29.7 30.4	6.3	86.8 84.8	4.7	9.7 9.2		-	3.3
							Bottom	6.6	2	22.5	7.9	30.4	6.2	84.8 84.9	4.6 4.6	10.1	6.2		
		TCE-WQM2b	Fine	Moderate	16:23	12.8	Surface	1.0	1	23.6	8.0	28.7	6.8	94.1	3.5	6.0			
							Middle		2	23.6	8.0	28.7	6.8	94.1	3.5	5.4	6.6		
							Middle	6.4	2	23.0 23.0	7.9 7.9	29.4 29.4	6.4	88.7 88.7	5.1 5.1	4.5 4.0	-	5.4	4.5
							Bottom	11.8	1	22.9	7.9	29.5	6.3	87.1	7.5	3.3	3.3 6.3 3.8 6.9 6.9 5.6 6.9 6.9		
		TOTAL THOMAS	***	6.1	45.55		6. (	4.0	2	22.9	7.9	29.5	6.3	86.9	7.5	3.8			
		TCE-WQM3A	Fine	Calm	15:55	4.5	Surface	1.0	2	23.6 23.6	8.1 8.1	29.0 29.0	6.9	95.6 95.6	5.5 5.3	7.4			
							Bottom	3.5	1	23.6	8.2	29.0	6.9	95.6	5.8	6.8		7.5	
									2	23.6	8.2	29.0	6.9	95.6	5.8	7.9			
		TCE-WQM4	Fine	Calm	15:41	3.7	Surface	1.0	1 2	23.6	8.0 8.0	29.3 29.3	6.6	92.5 92.6	4.1 4.1	4.6 5.4	6.6		
							Bottom	2.7	1	23.4	8.0	29.4	6.6	91.4	4.4	5.8	6.6	4.2	5.6
									2	23.4	8.0	29.4	6.6	91.4	4.3	6.6	0.0		
19-03-21	Mid-Flood	TCE-C1	Fine	Moderate	10:26	8.1	Surface	1.0	2	22.7 22.7	8.1 8.1	30.8 30.8	7.2 7.2	99.7 99.7	4.5 4.5	3.3 2.9	1		
							Middle	4.1	1	22.4	8.1	32.6	7.0	97.3	6.0	4.1	7.1	5.9	3.9
									2	22.4	8.1	32.6	7.0	97.2	6.1	3.6		5.9	3.9
							Bottom	7.1	2	22.4 22.4	8.1	32.7 32.7	7.0	97.4 97.6	7.1 7.1	4.9	7.0		
		TCE-C2	Fine	Moderate	8:09	15.0	Surface	1.0	1	22.8	7.9	28.9	6.6	91.1	3.6	5.1			
									2	22.8	7.9	28.9	6.6	91.2	3.6	5.2	6.5		
							Middle	7.5	2	22.7 22.7	7.9 7.9	29.5 29.5	6.5 6.5	88.6 88.6	5.1 5.1	3.0 3.4		5.4	3.6
							Bottom	14.0	1	22.1	7.9	31.7	6.1	84.3	7.3	3.0	6.1	1	
									2	22.1	7.9	31.7	6.1	84.4	7.4	2.1	6.1		
		TCE-WQM1	Fine	Calm	9:27	8.6	Surface	1.0	1 2	23.2 23.2	8.0 8.0	29.8 29.8	6.7	93.5 93.5	4.3 4.1	5.3 6.1	1		
							Middle	4.3	1	23.2	8.0	29.9	6.7	93.4	5.3	5.4	6.7	5.4	5.4
				1					2	23.2	8.0	29.9	6.7	93.3	5.4	5.9		5.4	5.4
				1			Bottom	7.6	2	23.1 23.1	8.0 8.0	30.0 30.0	6.7	93.3 93.2	6.7 6.6	4.3 5.1	6.7		
		TCE-WQM2a	Fine	Moderate	8:50	7.3	Surface	1.0	1	22.9	7.9	28.6	6.8	93.1	3.1	4.2			
				1			Middle	2.7	2	22.9 22.9	7.9 8.0	28.6	6.8	93.1	3.1	4.6 4.8	6.7		
				1			Middle	3.7	2	22.9	8.0	29.1 29.1	6.7	92.1 92.1	3.4 3.5	4.8	1	3.7	4.5
				1			Bottom	6.3	1	23.0	8.0	29.6	6.6	90.7	4.4	5.0			
		TOT WOLF	***		0.07	44.6		4.0	2	23.0	8.0	29.6	6.6	90.8	4.4	4.0	6.6		
		TCE-WQM2b	Fine	Moderate	8:37	11.6	Surface	1.0	2	22.8 22.8	7.9 7.9	29.0 29.0	6.6	90.7 90.7	3.6 3.7	3.9	1		
				1			Middle	5.8	1	22.7	7.9	29.6	6.5	89.7	4.8	3.3	6.6	4.9	4.0
				1			D. C.	10.5	2	22.7	7.9	29.6	6.5	89.6	4.9	4.0		4.5	4.0
				1			Bottom	10.6	2	22.6 22.6	7.9 7.9	29.8 29.8	6.6	91.2 91.3	6.0	5.1 4.0	6.6		
		TCE-WQM3A	Fine	Calm	9:04	4.2	Surface	1.0	1	22.9	8.0	29.1	6.6	90.7	4.3	5.2	6.6		
				1			- n		2	22.9	8.0	29.1	6.6	90.8 93.8	4.4	5.1	0.0	5.2	5.8
				1			Bottom	3.2	1 2	22.8 22.8	8.0 8.0	29.2 29.2	6.8	93.8 93.9	6.0	6.0 7.0	6.8		
		TCE-WQM4	Fine	Calm	9:14	3.5	Surface	1.0	1	23.0	8.0	29.4	6.7	91.8	8.0	11.8	6.7		
				1			Bottom	2.5	2	23.0 23.0	8.0 8.0	29.4 29.4	6.7	91.8 93.7	8.1 9.6	12.8 11.3	8 6.7	8.9	12.0
				1			Bottom	2.5	2	23.0	8.0	29.4	6.8	93.7	9.6	11.3	6.8		
L		1	1	- I		1	I .						0.0					1	1

			X4711			Mater Death		Complian doub		Water		Salinity	Dissolved	DO Saturation	Turbidity	Suspended Solids		Depth-averaged	
Date	Tide	Station	Weather Condition	Sea Condition	Sampling Time	Water Depth (m)	Water Level	Sampling depth (m)	Replicate	Temperature	pН	(ppt)	Oxygen (DO)	(%)	(NTU)	(SS)	DO (mg/L)	Turbidity (NTU)	SS (mg/L)
22-03-21	Mid-Ebb	TCE-C1	Cloudy	Rough	18:08	8.1	Surface	1.0	1	(°C) 22.0	8.1	32.0	(mg/L) 7.3	100.0	2.0	(mg/L) 2.2	(Hig/L)	(N10)	(mg/L)
			,						2	22.0	8.1	32.0	7.3	99.9	2.0	1.6	7.2		
							Middle	4.1	2	22.7 22.7	8.1 8.1	34.1 34.1	7.1 7.2	100.6 100.8	2.8 2.9	2.0 1.4	-	2.9	1.9
							Bottom	7.1	1	22.9	8.1	34.5	7.2	102.4	3.9	1.9	7.2	1	
									2	22.9	8.1	34.5	7.2	102.4	3.9	2.1	7.2		
		TCE-C2	Cloudy	Rough	20:27	14.8	Surface	1.0	2	22.3 22.3	8.1 8.1	33.8 33.8	6.7	93.1 93.2	2.2	1.0			
							Middle	7.4	1	22.3	8.1	34.1	6.7	93.4	2.6	1.8	6.7		
									2	22.3	8.1	34.1	6.7	93.4	2.7	1.7		3.1	1.7
							Bottom	13.8	1	22.3	8.1	34.2	6.7	93.8	4.3	1.8	6.7		
		TCE-WQM1	Cloudy	Calm	19:06	8.9	Surface	1.0	2	22.3 22.3	8.1 8.0	34.2 28.5	6.7	93.9 89.7	4.4 3.4	2.0			
		TCL-WQMI	Cloudy	Cann	15.00	0.7	Surface	1.0	2	22.3	8.0	28.5	6.6	89.7	3.4	3.1			
							Middle	4.5	1	22.8	8.0	30.9	6.4	88.3	3.8	3.2	6.5	3.9	2.6
							Bottom	7.9	2	22.8 22.8	8.0 8.1	30.8 33.0	6.4	88.4 91.5	3.9 4.5	2.4		-	
							Dottom	7.9	2	22.8	8.1	33.0	6.5	91.7	4.4	2.1	6.5		
		TCE-WQM2a	Cloudy	Moderate	19:44	7.7	Surface	1.0	1	22.5	8.0	32.3	6.4	89.6	3.0	1.7			
									2	22.5	8.0	32.3	6.4	89.6	3.0	1.6	6.5		
							Middle	3.9	1 2	22.3 22.3	8.1 8.1	33.5 33.5	6.6	92.4 92.3	2.7	2.2	-	3.5	2.1
							Bottom	6.7	1	22.3	8.1	33.7	7.0	97.5	4.7	2.4			
									2	22.3	8.1	33.7	7.0	97.6	4.7	2.6	7.0		
		TCE-WQM2b	Cloudy	Rough	19:58	12.4	Surface	1.0	2	21.8	8.0	31.8	6.9	94.0 93.9	2.1	1.9			
							Middle	6.2	1	21.8 22.2	8.0 8.0	31.8 33.6	6.9	93.9	2.1 4.0	2.5	6.7		
							Middle	0.2	2	22.2	8.0	33.6	6.6	92.1	4.1	2.6	•	3.2	2.8
							Bottom	11.4	1	22.2	8.1	33.7	6.7	93.9	3.3	3.1	3.1 4.2 4.0		
		TCE-WQM3A	Cloudy	Calm	19:31	4.3	Surface	1.0	2	22.2 22.2	8.1 8.0	33.7 28.2	6.7 6.5	94.0 88.1	3.3 4.3	4.2			
		TCE-WQM5A	Cloudy	Caim	19:31	4.5	Surrace	1.0	2	22.2	8.0	28.3	6.5	88.1	4.3	3.7	6.5		
							Bottom	3.3	1	22.5	8.0	29.8	6.7	91.2	4.6	2.9	9 6.7	3.5	
									2	22.5	8.0	29.8	6.7	91.4	4.6	3.2	6.7		
		TCE-WQM4	Cloudy	Calm	19:20	3.7	Surface	1.0	1 2	22.1 22.1	8.0 8.0	28.4 28.4	7.1 7.1	95.6 95.6	2.2	2.8	7.1		
							Bottom	2.7	1	22.1	8.0	28.8	7.1	98.0	2.8	3.1		2.5	2.9
									2	22.1	8.0	28.8	7.2	97.9	2.8	2.7	7.2		
22-03-21	Mid-Flood	TCE-C1	Cloudy	Rough	8:27	8.0	Surface	1.0	1	22.1	8.1	31.9	7.2	99.0	2.2	2.4			
							Middle	4.0	2	22.1 22.5	8.1 8.1	31.9 32.6	7.2 7.1	99.0 99.3	2.2 3.3	1.8 2.1	7.2		
							Middle	4.0	2	22.5	8.1	32.6	7.1	99.3	3.3	1.6		3.5	1.9
							Bottom	7.0	1	22.9	8.1	34.5	7.1	100.4	4.9	1.9	7.1		
							- 4		2	22.9	8.1	34.5	7.1	100.5	4.9	1.6	7.1		
		TCE-C2	Cloudy	Moderate	6:15	14.7	Surface	1.0	2	21.6 21.6	8.0	32.0 32.0	6.7	90.9 91.0	1.7 1.7	1.9 2.2			
							Middle	7.4	1	22.4	8.0	33.8	6.5	91.6	1.8	1.2	6.6	1.9	1.6
									2	22.4	8.0	33.8	6.5	91.6	1.8	2.0		1.9	1.6
							Bottom	13.7	2	22.4 22.4	8.0	33.9 33.9	6.6	92.5 92.7	2.2	1.0	6.6		
		TCE-WQM1	Cloudy	Calm	7:46	8.6	Surface	1.0	1	22.4	7.9	29.2	6.2	92.7 85.5	5.3	5.0			
		TCL WQ.III	Cloudy	Cum	7.10	0.0	ourace	1.0	2	22.8	7.9	29.2	6.2	85.4	5.3	5.8	6.2		
							Middle	4.3	1	22.9	7.9	29.6	6.2	85.1	6.5	4.2	6.2	6.1	4.1
							Bottom	7.6	2	22.9 23.0	7.9 8.0	29.6 30.8	6.2	85.3 89.7	6.5	3.7 2.8		1	
							DOROIII	7.0	2	23.0	8.0	30.8	6.5	89.9	6.6	3.2	6.4		
		TCE-WQM2a	Cloudy	Moderate	7:02	7.4	Surface	1.0	1	22.1	8.0	28.0	6.5	87.9	1.9	1.4			
							10:19	2.7	2	22.1	8.0	28.0	6.5	87.9	1.9	1.1	6.2		1
							Middle	3.7	2	22.5 22.4	8.0 8.0	32.8 32.9	5.8 5.8	81.1 81.0	3.1	1.8	1	3.2	1.5
							Bottom	6.4	1	22.4	8.0	33.3	5.3	74.7	4.4	1.8		1	
									2	22.4	8.0	33.3	5.3	74.2	4.5	1.2	5.3		
		TCE-WQM2b	Cloudy	Moderate	6:48	11.6	Surface	1.0	1 2	22.0	8.0	31.8	6.6	90.7	2.2	1.4	1	6.6	
							Middle	5.8	1	22.0 22.4	8.0 8.1	31.8 33.6	6.6	90.7 91.5	2.2	1.2	6.6		
								2.0	2	22.4	8.1	33.6	6.5	91.5	2.6	1.2	1	2.5	1.4
							Bottom	10.6	1	22.3	8.1	33.8	6.8	94.6	2.8	1.5	6.8		
		TCE-WQM3A	Cl1	Calm	7:19	4.1	Surface	1.0	2	22.3 22.1	8.1 8.0	33.8 27.5	6.8	94.8 89.0	2.8 1.9	1.7			1
		1CE-WQM3A	Cloudy	Calm	7:19	4.1	Surtace	1.0	2	22.1 22.1	8.0	27.5 27.5	6.6	89.0 88.8	1.9	1.9	6.6		1
							Bottom	3.1	1	23.0	7.9	28.2	6.5	89.6	3.3	1.7	4 E	2.6	1.6
									2	23.0	7.9	28.2	6.5	89.7	3.3	1.4	6.5		1
		TCE-WQM4	Cloudy	Calm	7:32	3.5	Surface	1.0	2	22.0 22.0	8.0 8.0	28.1	6.8	91.8 91.7	2.0	2.3	6.8		1
							Bottom	2.5	1	22.2	8.0	28.1 28.2	6.9	92.6	3.4	2.5	2.7	2.7	2.3
		<u> </u>							2	22.2	8.0	28.2	6.9	92.7	3.5	2.4	6.9		<u> </u>
										•									

1				Weather			Water Depth		Campling doub		Water		Salinity	Dissolved	DO Saturation	Turbidity	Suspended Solids		Depth-averaged	
1 日	Date	Tide	Station	Condition	Sea Condition	Sampling Time		Water Level	Sampling depth (m)	Replicate		pH					(SS)	DO	Turbidity	
Part	24-03-21	Mid-Ebb	TCE-C1	Fine	Moderate	20:28	8.2	Surface	1.0	1	22.3	8.1	34.6	7.1			4.5	(mg/L)	(1410)	(mg/L)
Part								10111										7.1		
1								Middle	4.1									-	4.3	4.6
1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1								Bottom	7.2		22.3	8.1	34.6	7.1	99.2	4.6	4.2	7.1		
No.   Part   P								- 4										7.1		
Part			TCE-C2	Fine	Moderate	22:48	13.1	Surface	1.0											
March   Marc								Middle	6.6							1.8		6.7	1.0	4.0
																			1.9	1.9
								Bottom	12.1									6.5		
			TCE-WQM1	Fine	Moderate	21:38	8.1	Surface	1.0											
Part																		6.5		
Paris   Pari								Middle	4.1	_								-	4.3	3.8
1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1								Bottom	7.1								5.0		1	
Paris										2			33.4			5.4	3.8	6.5		
Part			TCE-WQM2a	Fine	Moderate	22:12	7.0	Surface	1.0											
Marie								Middle	3.5									6.9		
Part								Middle	0.0				33.3					•	1.9	1.7
Part								Bottom	6.0									6.9		
			TCE WOM2h	Tino	Madamata	22-24	10.9	Cuntoso	1.0											
1			TCE-WQWI2D	rne	Woderate	22.24	10.6	Surface	1.0											
Part								Middle	5.4			8.1	33.9	6.6	92.7	1.5	2.2	6.7	1.5	22
Televide   Feat																			1.5	2.3
Part								Bottom	9.8									2.8		
Machana   Mach			TCE-WQM3A	Fine	Moderate	22:02	4.2	Surface	1.0	_								5.3		
Part													32.6					1.9 1.9 1.6 1.6	5.3	
TCH-WOMA   Fine   Moderate   Pine   Moderate   Pine   Pi								Bottom	3.2											
Part			TCE-WOM4	Fine	Moderate	21:50	3.5	Surface	1.0											
Part										_	22.0	8.1	32.6	6.5	90.5	4.4	3.9	6.5	4.8	3.3
Mid-lived   Cloudy   Moderate   1047   83   Surface   10   1   22   81   Mode   71   998   31   54   71   71   72   71   73   74   74   74   74   74   74   74								Bottom	2.5									6.6	4.0	3.3
Middle   42   1   223   81   346   71   598   31   56   71   71   72   72   72   72   72   72	24-03-21	Mid-Flood	TCF-C1	Cloudy	Moderate	10:47	8.3	Surface	1.0											
Middle   42   1   233   41   346   71   993   33   42   43   43   44   44   45   45   45   45											22.3	8.1	34.6	7.1	99.8	3.1	5.6	7.1		
Moderate   Moderate								Middle	4.2									7.1	3.5	4.8
TCE-C2 Cloudy Moderate R89 13.2 Surface 1.0 1 22 2.3 8.1 34.6 7.1 99.2 3.9 4.3 7.4 1.2 1.2 1.2 1.2 1.2 1.2 1.2 1.2 1.2 1.2								Rottom	73							3.5				
Middle								Dottom	7.5	2								7.1		
Middle   Reference   Referen			TCE-C2	Cloudy	Moderate	8:49	13.2	Surface	1.0											
TCE-WQMI   Cloudy   Moderate   1002   82   Surface   10   1   21   80   81   66   915   15   16   16								Middle	6.6									6.6		
TCE-WQMI   Cloudy   Moderate   1002   8.2   Surface   10   1   1   21.9   8.0   32.0   6.4   88.2   3.2   3.7   3.7     1.0   1.0   1.0								whate	0.0										1.4	1.9
TCE-WQMI   Cloudy   Moderate   1002   8.2   Surface   1.0   1   210   8.0   8.1   6.6   9.6   1.6   2.4   2.7   4.1   3.3								Bottom	12.2									6.6		
TCE-WQM2a   Cloudy   Moderate   P13   109   Surface   1.0   1   2.19   8.0   32.0   6.4   88.3   3.2   4.0   6.4   4.1   3.1   6.4			TCT MOM	Clt	Madanta	10.02	0.2	Confron	1.0									0.0		
Middle   4.1   1   22.0   8.0   32.3   6.3   87.2   4.4   3.1   5.4   4.1   3.1   3.3   6.4   4.1   3.1   2.2   2.2   8.0   32.3   6.3   87.3   4.4   2.9   4.4   3.1   4.1   3.3   6.4   8.5   4.8   3.4   4.2   4.4   3.1   4.1   4.1   4.2   4.1   4.1   4.1   4.2   4.1			ICE-WQMI	Cloudy	woderate	10:02	8.2	Surrace	1.0									-		
TCE-WQM2a   Cloudy   Moderate   926   7.0   Surface   1.0   1   1218   8.0   32.8   6.4   88.5   4.8   3.4   2.9					1			Middle	4.1	1	22.0	8.0	32.3	6.3	87.2	4.4	3.1	6.4	A 1	3 3
TCE-WQM2b Cloudy Moderate P.13					1			D.H	7.2											3.3
TCE-WQM2a Cloudy Moderate P.26					1			Bottom	7.2									6.4		
Middle   3.5   1   21.9   8.0   33.0   6.6   91.2   2.2   2.5   6.6			TCE-WQM2a	Cloudy	Moderate	9:26	7.0	Surface	1.0	1	21.8	8.0	32.8	6.6	90.6	2.2	2.6			
Moderate   Parameter   Param					1			10:19	2.5									6.6		
TCE-WQM2b   Cloudy   Moderate   9:13   10:9   Surface   1:0   1   21:9   8:0   33:0   6:8   93:3   2:5   2:2   6:8					1			Middle	3.5									1	2.3	2.3
TCE-WQM2b Cloudy Moderate P:13					1			Bottom	6.0		21.9	8.0	33.0	6.8	93.3	2.5	2.2	6.0	1	
TCE-WQM3A   Cloudy   Moderate   P38   A2   Surface   1.0   1   21.6   8.0   32.5   6.5   88.9   8.0   32.5   6.5   88.9   8.0   33.1   6.6   91.5   2.5					1													6.8		
Middle   5.5   1   21.9   8.0   33.1   6.6   91.9   2.6   2.8   6.6   2.8   6.6   2.8   6.6   2.8   6.6   2.8   6.6   2.8   6.6   2.8   6.6   2.8   6.6   2.8   6.7   2.8   2.8   6.7   2.8   2.8   6.7   2.8   2.8   6.7   2.8			TCE-WQM2b	Cloudy	Moderate	9:13	10.9	Surface	1.0							2.5		6.6		
TCE-WQM3 Cloudy Moderate P48 3.6 Surface 1.0 1 21.8 8.0 32.8 6.4 88.3 9.0 6.8 6.1  TCE-WQM4 Cloudy Moderate P48 3.6 Surface 1.0 1 21.6 8.0 32.5 6.3 86.5 5.6 4.2 6.8 6.1  TCE-WQM4 Cloudy Moderate P48 3.6 Surface 1.0 1 21.6 8.0 32.5 6.3 86.5 5.6 4.2 6.3 86.5 5.6 4.4 6.3 7.3 5.4 6.4 8.0 32.5 6.3 86.5 5.6 4.4 6.3 8.0 32.8 6.4 88.3 9.0 6.8 6.1 6.4 8.0 32.5 6.3 86.5 5.6 6.4 4.4 6.3 8.0 32.8 6.4 88.3 9.0 6.8 6.5 6.4 4.4 6.3 8.0 32.8 6.4 88.3 9.0 6.8 6.5 6.4 4.4 6.3 8.0 6.4 6.4 8.0 6.4 6.4 8.0 6.4 6.4 6.4 6.4 6.4 6.4 6.4 6.4 6.4 6.4					1			Middle	5.5	_								6.6		
TCE-WQM3A Cloudy Moderate 9.38 4.2 Surface 1.0 1 21.6 8.0 32.5 6.3 86.5 5.6 4.2 6.5 8.2 8.3 86.5 5.6 4.2 6.3 86.5 5.6 4.2 6.3 86.5 5.6 4.2 6.3 86.5 5.6 4.2 6.3 86.5 5.6 4.2 6.3 86.5 5.6 4.2 6.3 86.5 5.6 4.2 6.3 86.5 5.6 4.2 6.3 86.5 5.6 4.2 6.3 86.5 5.6 4.2 6.3 86.5 5.6 4.2 6.3 86.5 5.6 6.3 8.2 8.2 6.4 8.3 8.3 9.0 6.8 6.3 8.2 8.2 6.6 8.3 8.2 8.2 6.6 8.3 8.2 8.3 8.3 9.0 6.8 6.3 8.2 8.2 6.6 91.0 2.5 8.3 8.3 8.3 8.3 8.3 8.3 8.3 8.3 8.3 8.3					1						21.9	8.0	33.1	6.6	91.9	2.6	2.8		2.7	2.8
TCE-WQM3A Cloudy Moderate 9:38 4.2 Surface 1.0 1 21.6 8.0 32.5 6.3 86.5 5.6 4.2 6.3 6.3 6.3 6.5 5.6 4.2 6.3 6.3 6.3 6.3 6.3 6.3 6.3 6.3 6.3 6.3					1			Bottom	9.9	_								6.7		
Cloudy   Moderate   948   3.6   Surface   1.0   1   21.6   8.0   32.2   6.6   91.0   2.5   2.4   6.6   1.0   1   21.5   8.0   32.2   6.6   91.0   2.5   2.4   6.6   2.5   2.5   2.4   6.6   2.5   2.			TCE-WOM3A	Cloudy	Moderate	9:38	4.2	Surface	10											
Bottom   3.2   1   21.8   8.0   32.8   6.4   88.3   9.0   6.8   6.4   7.3   5.4			ice region	Cloudy	mourate	2.00		Surace			21.6	8.0	32.5		86.5	5.6		6.3	7.9	E 4
TCE-WQM4 Cloudy Moderate 9.48 3.6 Surface 1.0 1 21.6 8.0 32.8 6.5 88.9 8.8 6.1					1			Bottom	3.2							9.0	0.10	6.4	7.3	3.4
2   21.6   8.0   32.2   6.6   91.0   2.6   2.1   0.0     Bottom   2.6   1   21.5   8.0   32.2   6.8   92.3   3.2   2.7   6.8			TCF_WOM4	Cloudy	Modorato	Q-48	3.6	Surface	1.0	2										
Bottom 2.6 1 21.5 8.0 32.2 6.8 92.3 3.2 2.7 6.8			TCL-WQWH	Couuy	woderate	2.40	5.0	Juridee		2			32.2			2.6		6.6	2.0	2.7
2 21.5 8.0 32.2 6.8 93.4 3.1 3.6					1			Bottom	2.6	1	21.5		32.2	6.8		3.2	2.7	2.7 6.8 2.9	2.9	2.7
	L		1		1			I	I	2	21.5	8.0	32.2	6.8	93.4	3.1	3.6	****		

1				Weather			Mator Douth		Campling doub		Water		Salinity	Dissolved	DO Saturation	Turbidity	Suspended Solids		Depth-averaged	
1	Date	Tide	Station	Condition	Sea Condition	Sampling Time	Water Depth (m)	Water Level	Sampling depth (m)	Replicate		pH				(NTU)	(SS)	DO	Turbidity	SS
Part	26-03-21	Mid-Ebb	TCE-C1	Fine	Rough	13:30	8.1	Surface	1.0	1		8.2	33.9	(mg/L) 7.7	108.0	3.2		(mg/L)	(NIU)	(mg/L)
Part											22.7						5.6	7.5		
1   1   1   1   1   1   1   1   1   1								Middle	4.1									-	3.8	5.0
Table   Free								Bottom	7.1										-	
Part										2	22.2	8.1	34.4	7.2	100.2	4.8	5.0	7.2		
Marie   Mari			TCE-C2	Fine	Moderate	11:00	14.4	Surface	1.0											
Part								Middle	7.2					6.7		2.2		6.6		
No.								Middle	7.2								-10		2.0	3.7
Marie   19   19   19   19   19   19   19   1								Bottom	13.4	1								6.5		
No.   Mathematical Property Reserved   Prope																		6.5		
Martin			TCE-WQM1	Fine	Calm	12:23	8.6	Surface	1.0											
March   Marc								Middle	4.3	1								7.3		
Marting   Mart								madic	1.0	2									3.0	5.1
No.   Marion   Fine   No.								Bottom	7.6		22.3	8.1	33.9		101.5			73		
MAPPING   Fire   No.																		7.5		
Model   Mode			TCE-WQM2a	Fine	Moderate	11:46	7.5	Surface	1.0		22.1			7.1						
TCFWQNS   Fine   Modern   133   124   14   14   14   15   15   15   15   1								Middle	3.8									7.1		
TCL-NQMA											22.0	8.1	33.4	7.1	97.9	2.4			2.4	4.4
TCANQUAL   Five   Moderne   11-32   13-2   13-2   13-3								Bottom	6.5									7.0		
Machine   Price   Price   Price   Price   Machine   Price			TCE INO. (2)	F1	Madamia	11.22	12.0	Confere	1.0											
Maille			TCE-WQM2B	rine	woderate	11:55	12.0	Surrace	1.0											
Main   10   2   222   100								Middle	6.0				33.8					6.7		
TCLYONOLO   Fine   Calin   1128										2									2.5	3.9
TCHONGAN   Free   Calm   15-88								Bottom	11.0									6.6		
Part			TCE WOM3A	Eino	Calm	11.58	4.4	Surface	1.0	2										
TCE-VQM   Fire   Colm   12:0   ST   Section   10   1   22:1   81   332   6.8   948   6.6   53   64   6.4			TCE-WQWISA	rne	Cann	11.56	4.4	Surface	1.0	2								6.8		
TCL-WOMA   Five   Calm   1210   27   Section   10   2   221   11   231   13   25   15   16   16   17   18								Bottom	3.4		22.1	8.1	33.2	6.8	94.8	6.6	5.8	6.0	6.4	7.1
Part																		0.0		
Proceedings   Process			TCE-WQM4	Fine	Calm	12:10	3.7	Surface	1.0									7.0		
Mid-Flood   Fine   Moderate   Fine   Moderate   Fine   Fine   Fine   Fine   Fine   Fine   Fine   Moderate   Fine   Fin								Bottom	2.7	_									1.9	5.1
Middle																		6.9		
Middle	26-03-21	Mid-Flood	TCE-C1	Fine	Rough	15:24	8.0	Surface	1.0											
TCE-CQ   Fine   Moderate   1748   143   Surface   10   1   22   25   81   344   72   101.5   177   4.0   72   10.0																		7.7		
TCE-WQML Fine Moderate Fine Fine Fine Moderate Fine Fine Fine Moderate Fine Fine Fine Fine Fine Fine Fine Fin								Middle	4.0										3.2	4.7
TCE-WQML Fine Moderate 17:48								Bottom	7.0					7.2		3.7			1	
Middle										2		8.1	34.4		101.5	3.7	4.0	7.2		
Moderate   Fine   Moderate   1792   73   11   223   81   341   67   913   22   32   38   82   22   38   84   84   67   914   92   92   93   84   85   85   92   94   94   94   94   94   94   94			TCE-C2	Fine	Moderate	17:48	14.5	Surface	1.0											
Rottom   135   1   223   8.1   34.1   6.7   93.4   2.2   3.8   1.2   3.8   1.2   1								Middle	7.0						96.7			6.8		
Fine   Moderate   17:13   11:9   Surface   10   1   22:3   8:1   34:1   6:7   94:0   2:7   4:0   6:7								Middle	7.5										2.2	3.8
TCE-WQM2 Fine Moderate 1732 73 Surface 1.0 1 2229 8.1 33.2 76 107.3 3.3 3.4 7.4 1041 3.6 7.2 10.0 2.4 4.6 1.2 1.2 1.2 1.2 1.2 1.2 1.2 1.2 1.2 1.2								Bottom	13.5		22.3		34.1	6.7	94.0	2.7		6.7		
Middle																		6.7		
Middle			TCE-WQM1	Fine	Calm	16:24	8.8	Surface	1.0											
CE-WQM2a   Fine   Moderate   17:02   7.3   Surface   1.0   1   22.5   8.1   33.5   7.6   106.3   3.0   4.2   7.5   105.1   3.1   4.9   7.5   105.1   3.1   4.9   7.5   105.1   3.1   4.9   7.5   105.1   3.1   4.9   7.5   105.1   3.1   4.9   7.5   105.1   3.1   5.6   7.5   105.1   3.1   5.6   7.5   105.1   3.1   5.6   7.5   105.1   3.1   5.6   7.5   105.1   3.1   5.6   7.5   105.1   3.1   5.6   7.5   105.1   3.1   5.6   7.5   105.1   3.1   5.6   7.5   105.1   3.1   5.6   7.5   105.1   3.1   3.5   7.1   9.0   3.0   7.6								Middle	4.4									7.6		
Bottom   7.8			1								22.7	8.1	33.5	7.6	106.3	3.0	4.2	1	3.2	4.2
TCE-WQM2a Fine Moderate 17:02 7.3 Surface 1.0 1 22.3 8.1 33.5 7.1 99.0 3.0 7.6     Middle 3.7 1 22.2 8.1 33.5 7.1 99.0 3.0 8.2    7.1								Bottom	7.8					7.5				7.5		
Middle			TCE WOM	E1	Moderate	17.00	7.0	Curtore	1.0				33.6					-	1	1
Middle   3.7   1   22.2   8.1   33.5   7.0   98.1   3.1   4.0   7.1			I CE-VV QIVIZA	rine	wioderate	17:02	1.3	Surrace	1.0				33.5					† _		
TCE-WQM2b   Fine   Moderate   17:13   11:9   Surface   1.0   1   22:5   8.1   33.5   7.0   98.2   3.1   4.1   4.0   6.9			1					Middle	3.7				33.5					7.1	2.2	5.3
TCE-WQM2b Fine Moderate 17:13 11.9 Surface 1.0 1 22.5 8.1 33.5 6.9 96.7 3.5 3.7 6.9    Middle			1								22.2	8.1	33.5	7.0	98.2	3.1			3.2	3.3
TCE-WQM2b Fine Moderate 17.13 11.9 Surface 1.0 1 22.5 8.1 33.6 7.2 100.9 2.4 4.6 24 4.0 7.2 Middle 6.0 1 22.5 8.1 33.6 7.2 100.8 2.4 4.0 7.2 Middle 6.0 1 22.5 8.1 33.5 7.1 99.6 2.8 4.1 4.1 4.3 7.2 100.8 1.0 1.0 1 22.5 8.1 33.5 7.1 99.8 2.8 4.8 1.0 1.0 1 22.4 8.1 33.7 7.0 97.7 4.1 4.3 3.5 7.0 1.0 1.0 1.0 1.0 1.0 1.0 1.0 1.0 1.0 1								Bottom	6.3									6.9		
TCE-WQM3A   Fine   Calm   1650   4.2   Surface   1.0   1   22.5   8.1   33.4   7.2   100.8   2.4   4.0   7.2   3.1   4.2   4.2   4.0   7.2   7			TCE-WOM2h	Fine	Moderate	17:13	11.9	Surface	1.0											
Middle					mourate		11.7				22.5		33.6	7.2	100.8	2.4				
Bottom   10.9   1   22.4   8.1   33.5   7.1   99.8   2.8   4.8								Middle	6.0			8.1	33.5			2.8		1.2	3.1	4.2
TCE-WQM3A Fine Calm 16:50 4.2 Surface 1.0 1 22.5 8.1 33.7 7.0 97.7 4.0 3.5 7.0 102.0 5.1 8.4 7.3 102.0									4										-	4.2
$ \begin{array}{ c c c c c c c c c c c c c c c c c c c$								Bottom	10.9									7.0		
TCE-WQM4 Fine Calm 1637 3.6 Surface 1.0 1 22.5 8.1 33.4 7.4 104.2 3.5 4.0 7.4 104.2 3.5 8.1 3.4 7.4 104.2 3.5 8.1 3.1 3.4 7.4 104.2 3.5 8.1 3.1 3.4 7.4 104.2 3.5 8.1 3.1 3.4 7.4 104.2 3.5 8.1 3.1 3.4 7.4 104.2 3.5 8.1 3.1 3.4 7.4 104.2 3.5 8.1 3.1 3.4 7.4 104.2 3.5 8.1 3.1 3.1 3.4 7.4 104.2 3.5 8.1 3.1 3.1 3.4 7.4 104.2 3.5 8.1 3.1 3.1 3.1 3.1 3.1 3.1 3.1 3.1 3.1 3			TCE-WOM3A	Fine	Calm	16:50	4.2	Surface	1.0											
Bottom 3.2 1 225 8.1 33.4 7.2 101.0 5.1 6.9 7.2  TCE-WQM4 Fine Calm 16:37 3.6 Surface 1.0 1 22.5 8.1 33.4 7.4 104.2 3.5 4.0 7.4  Bottom 2.6 1 22.4 8.1 33.4 7.4 104.1 3.6 5.2  Bottom 2.6 1 22.4 8.1 33.4 7.4 104.1 3.6 5.2  3.7 47											22.5	8.1	33.4	7.3	102.1	5.1	9.1	7.3	E 1	8.0
TCE-WQM4 Fine Calm 16:37 3.6 Surface 1.0 1 22.5 8.1 33.4 7.2 100.8 5.1 7.5  TCE-WQM4 Fine Calm 16:37 3.6 Surface 1.0 1 22.5 8.1 33.4 7.4 104.1 3.6 5.2  Bottom 2.6 1 22.4 8.1 33.4 7.4 102.9 3.8 5.1 7.4								Bottom	3.2							5.1		7.2	3.1	0.0
Bottom 2.6 1 22.4 8.1 33.4 7.4 104.1 3.6 5.2 7.4 3.7 4.7			TOT WOLK	F**	61	16.27	2.5	61	4.0										1	1
Bottom 2.6 1 22.4 8.1 33.4 7.4 102.9 3.8 5.1 7.4			ICE-WQM4	Fine	Calm	16:37	3.6	Surface	1.0									7.4		
2 22.4 8.1 33.4 7.4 102.9 3.8 4.4 7.4								Bottom	2.6		22.4							7.4	3.7	4.7
			<u> </u>							2	22.4	8.1	33.4	7.4	102.9	3.8	4.4	7.4		

			Weather			Water Depth		Sampling depth		Water		Salinity	Dissolved	DO Saturation	Turbidity	Suspended Solids		Depth-averaged	
Date	Tide	Station	Condition	Sea Condition	Sampling Time	(m)	Water Level	(m)	Replicate	Temperature (°C)	pH	(ppt)	Oxygen (DO) (mg/L)	(%)	(NTU)	(SS) (mg/L)	DO (mg/L)	Turbidity (NTU)	SS (mg/L)
29-03-21	Mid-Ebb	TCE-C1	Cloudy	Moderate	11:46	8.6	Surface	1.0	1	23.1	8.1	33.0	7.7	109.2	3.5	3.9	(11.6/ 2.)	(1110)	(
							Middle	4.3	2	23.1 22.9	8.1 8.1	33.0 33.9	7.7 7.3	109.2 103.3	3.5 4.8	4.6 5.0	7.5		
							Middle	4.5	2	22.9	8.1	33.9	7.3	103.2	4.8	4.4		4.4	4.7
							Bottom	7.6	1	22.8	8.1	34.1	7.2	101.9	4.9	4.9	7.2		
		TCE-C2	Cloudy	Moderate	14:13	14.5	Surface	1.0	2	22.8 23.8	8.1 8.1	34.1 31.9	7.2 7.8	101.9 111.0	4.9 2.9	5.4 3.9			
		TCE-C2	Cloudy	Moderate	14:15	14.5	Surface	1.0	2	23.8	8.1	31.9	7.8	111.0	2.9	4.6			
							Middle	7.3	1	23.5	8.1	32.0	7.5	105.8	5.5	5.1	7.6	6.1	5.7
							Bottom	13.5	2	23.5 23.5	8.1 8.1	32.0 32.0	7.5 7.5	105.8 105.4	5.6 9.9	5.9 7.4		-	
							Dottoili	13.5	2	23.5	8.1	32.0	7.5	105.4	9.9	7.5	7.5		
		TCE-WQM1	Cloudy	Moderate	12:58	8.0	Surface	1.0	1	23.5	8.1	32.5	7.7	108.9	3.9	4.9			
							Middle	4.0	2	23.5 23.5	8.1 8.1	32.5 32.5	7.7	108.9 108.6	3.9 4.0	4.0 5.2	7.7		
							wiiddie	4.0	2	23.5	8.1	32.5	7.7	108.6	4.0	5.6		4.4	5.1
							Bottom	7.0	1	23.5	8.1	32.5	7.6	108.0	5.4	5.0	7.6		
		TCE-WQM2a	Cloudy	Moderate	13:34	7.5	Confere	1.0	2	23.5 23.9	8.1 8.1	32.5 32.0	7.6 7.7	108.0 108.8	5.4 2.7	5.9 3.5			
		TCE-WQWIZa	Cloudy	Moderate	15:54	7.5	Surface	1.0	2	23.9	8.1	32.0	7.7	108.8	2.7	3.6			
							Middle	3.8	1	23.6	8.1	32.2	7.7	108.4	3.5	3.5	7.7	3.8	3.2
							Bottom	6.5	2	23.6 23.5	8.1 8.1	32.2 32.4	7.7 7.6	108.4 107.4	3.5 5.2	3.3 2.7		3.0	3.2
							bottom	6.5	2	23.5	8.1	32.4	7.6	107.4	5.2	2.7	7.6		
		TCE-WQM2b	Cloudy	Moderate	13:46	11.5	Surface	1.0	1	23.5	8.1	31.5	7.3	102.9	4.0	4.7			
							Middle	5.8	2	23.5 23.4	8.1 8.0	31.5 31.7	7.3 7.2	103.0 101.5	4.0 6.2	5.5 6.8	7.3		
							Middle	5.8	2	23.4	8.0	31.7	7.2	101.5	6.2	7.1	-	6.7	7.8
							Bottom	10.5	1	23.4	8.0	31.7	7.2	101.6	9.8	11.7	7.2		
		TCF MOM 12 A	Classifica	Madanta	12.21	4.2	Confess	1.0	2	23.4	8.0	31.7	7.2	101.6	9.8	11.0	7.2		
		TCE-WQM3A	Cloudy	Moderate	13:21	4.3	Surface	1.0	2	23.9 23.9	8.2 8.2	32.2 32.2	7.7	109.2 109.2	6.0	8.3 7.3	7.7		
							Bottom	3.3	1	23.8	8.2	32.2	8.0	113.9	9.2	8.2	8.0	7.6	7.9
		TOT WOLL	G. I	26.1	42.40	2.0		1.0	2	23.8	8.2	32.2	8.0	113.9	9.2	7.8	8.0		
		TCE-WQM4	Cloudy	Moderate	13:10	3.8	Surface	1.0	2	24.0 24.0	8.1 8.1	32.6 32.6	7.9 7.9	113.2 113.2	3.4	4.0 4.5	7.9		
							Bottom	2.8	1	23.9	8.1	32.6	7.9	113.4	3.3	3.3	7.9	3.4	3.9
20.02.24	Ve tet 1	TOT O	CI I	26.1	0.50	0.6	0.7	4.0	2	23.9	8.1	32.6	7.9	113.4	3.3	3.6	7.5		
29-03-21	Mid-Flood	TCE-C1	Cloudy	Moderate	8:50	8.6	Surface	1.0	2	22.8 22.8	8.1 8.1	32.5 32.5	7.4 7.4	103.4 103.4	16.8 16.8	2.9 3.4	-		
							Middle	4.3	1	22.7	8.1	33.9	7.3	102.6	26.3	3.8	7.3	21.0	4.1
							Bottom	7.6	2	22.7 22.8	8.1 8.1	33.9 34.0	7.3 7.2	102.6	26.3 20.0	4.7 5.0			
							bottom	7.0	2	22.8	8.1	34.0	7.2	101.4 101.4	20.0	4.7	7.2		
		TCE-C2	Cloudy	Moderate	6:51	13.4	Surface	1.0	1	23.2	8.0	31.8	7.2	101.8	5.1	3.2			
							Middle	6.7	2	23.2	8.0	31.8 31.8	7.2 7.2	101.8 101.0	5.1 10.7	3.0 4.9	7.2		
							wiiddie	6.7	2	23.2	8.0	31.8	7.2	101.0	10.7	4.2		13.3	4.3
							Bottom	12.4	1	23.2	8.0	31.8	7.2	100.7	24.2	5.6	7.2		
		TCE-WQM1	Cloudy	Moderate	8:06	8.2	Surface	1.0	2	23.2 23.5	8.0 8.1	31.8 32.6	7.2 7.3	100.7 104.2	24.2 3.9	5.1 5.3			
		TCE-WQWII	Cloudy	Woderate	8.06	6.2	Surface	1.0	2	23.5	8.1	32.6	7.3	104.2	3.9	4.2			
							Middle	4.1	1	23.5	8.1	32.6	7.3	103.8	3.8	4.1	7.3	3.8	4.3
							Bottom	7.2	2	23.5 23.5	8.1 8.1	32.6 32.6	7.3 7.3	103.8 103.1	3.8 3.7	5.0 3.1		1	1
							DOROIII		2	23.5	8.1	32.6	7.3	103.1	3.7	3.8	7.3		1
		TCE-WQM2a	Cloudy	Moderate	7:31	7.2	Surface	1.0	1	23.3	8.0	31.6	7.3	102.5	3.2	5.4			
							Middle	3.6	2	23.3 23.3	8.0 8.0	31.6 31.7	7.3 7.2	102.5 101.7	3.2 3.4	5.3 5.4	7.3		1
							.v.ruute		2	23.3	8.0	31.7	7.3	101.7	3.4	5.0	1	3.3	4.8
							Bottom	6.2	1	23.3	8.0	31.7	7.2	101.6	3.4	3.4	7.2		1
		TCE-WQM2b	Cloudy	Moderate	7:13	10.2	Surface	1.0	2	23.3 23.2	8.0 8.0	31.7 31.8	7.2 7.2	101.8 101.5	3.4 7.0	4.2 5.6			1
		7CL-11QM20	Cloudy	Wiodelate	7.13	10.2			2	23.2	8.0	31.8	7.2	101.5	7.0	5.3	7.3		1
							Middle	5.1	1	23.2	8.0	31.8	7.2	101.1	7.9	5.3	7.2	7.8	5.0
							Bottom	9.2	2	23.2	8.0 8.0	31.8 31.7	7.2 7.2	100.9 100.9	8.1 8.3	4.5 4.2		1	1
									2	23.2	8.0	31.7	7.2	100.8	8.5	5.0	7.2		
		TCE-WQM3A	Cloudy	Moderate	7:43	4.2	Surface	1.0	1	23.2	8.0	32.3	7.1	99.6	2.5	7.0	7.1		1
							Bottom	3.2	2	23.2	8.0 8.0	32.3 32.3	7.1 7.1	99.6 99.9	2.5	6.2		2.3	6.4
									2	23.2	8.0	32.3	7.1	99.9	2.0	5.6	7.1		<u> </u>
		TCE-WQM4	Cloudy	Moderate	7:53	3.4	Surface	1.0	1	23.3	8.1	32.1	7.3	102.9	2.5	3.9	7.3		1
							Bottom	2.4	2	23.3 23.3	8.1 8.1	32.1 32.1	7.3 7.3	102.9 102.1	2.5	4.8 3.8		2.6	4.2
									2	23.3	8.1	32.1	7.3	102.1	2.6	4.3	7.3		1
		•		•			•	•	•			•	•					•	

			Weather			Water Depth		Sampling depth		Water		Salinity	Dissolved	DO Saturation	Turbidity	Suspended Solids		Depth-averaged	
Date	Tide	Station	Condition	Sea Condition	Sampling Time	(m)	Water Level	(m)	Replicate	Temperature (°C)	pH	(ppt)	Oxygen (DO) (mg/L)	(%)	(NTU)	(SS) (mg/L)	DO (mg/L)	Turbidity (NTU)	SS (mg/L)
31-03-21	Mid-Ebb	TCE-C1	Misty	Calm	13:04	8.6	Surface	1.0	1	23.6	8.1	33.8	7.3	104.8	1.4	7.0	(11.6/2.)	(1110)	(g.2)
							Middle	4.3	2	23.6 23.5	8.1 8.1	33.8 33.8	7.3 7.2	104.4 103.0	1.4 2.8	6.3	7.3		
							Middle	4.5	2	23.5	8.1	33.8	7.2	103.5	3.0	6.5	1	3.1	6.3
							Bottom	7.6	1	23.4	8.1	33.8	7.2	102.8	4.9	5.1	7.2		
		TCE-C2		Calm	15:25	12.8	Surface	1.0	2	23.4	8.1 8.0	33.8 31.8	7.2 7.0	102.4 99.8	4.8 4.6	5.8 4.4	7.2		
		TCE-C2	Misty	Calm	15:25	12.8	Surface	1.0	2	24.1	8.0	31.8	7.0	99.8	4.6	4.4	+		
							Middle	6.4	1	24.1	8.0	31.7	6.9	98.4	5.8	7.2	6.9	5.6	6.5
									2	24.1	8.0	31.7	6.9	98.0	5.3	6.6		5.0	6.5
							Bottom	11.8	1 2	24.1 24.1	8.0 8.0	31.7 31.7	6.8	97.5 97.4	6.9 7.0	7.0 8.8	6.8		
		TCE-WQM1	Misty	Calm	13:54	8.0	Surface	1.0	1	24.1	8.1	32.7	7.2	103.8	3.2	4.2			
			,						2	24.1	8.1	32.7	7.2	103.3	3.2	4.9	7.2		
							Middle	4.0	2	24.1 24.1	8.1 8.1	32.7 32.7	7.2 7.2	102.7 102.7	3.3 3.3	4.7 5.0	-	3.3	4.5
							Bottom	7.0	1	24.1	8.0	32.7	7.1	102.7	3.4	4.2			
									2	24.1	8.0	32.7	7.1	102.1	3.4	4.1	7.1		
		TCE-WQM2a	Misty	Calm	14:45	7.0	Surface	1.0	1	24.1	8.0 8.0	31.4	6.9	98.4	3.4	7.5	1		
							Middle	3.5	2	24.1 24.1	8.0	31.4 31.5	6.9	98.4 97.5	3.4 5.5	6.8 7.6	6.9		
									2	24.1	8.0	31.5	6.8	97.1	5.8	7.2		5.2	7.7
							Bottom	6.0	1	24.1	8.0	31.5	6.7	96.0	6.5	8.9	6.7		
		TCE-WQM2b	Misty	Calm	15:00	11.2	Cuntoso	1.0	2	24.1 24.1	7.9 8.0	31.5 31.5	6.7 7.0	95.3 99.1	6.3 3.3	8.2 9.0	-		-
		TCE-WQIVI2B	Misty	Caim	15:00	11.2	Surface	1.0	2	24.1	8.0	31.5	6.9	98.9	3.5	10.6	-		
							Middle	5.6	1	24.1	8.0	31.5	6.9	98.7	7.1	14.8	6.9	6.7	11.5
									2	24.1	8.0	31.5	6.9	98.7	7.1	16.6		6.7	11.5
							Bottom	10.2	2	24.1 24.1	8.0	31.5 31.5	6.9	97.9 97.6	9.4 9.7	9.5 8.4	8.4 6.9 6.9 6.9 5.8 5.2 6.7 5.8		
		TCE-WQM3A	Misty	Calm	14:17	4.0	Surface	1.0	1	24.3	8.1	31.8	7.0	100.0	4.8	6.2			
			,						2	24.3	8.1	31.8	7.0	100.1	5.0	6.9		6.0	
							Bottom	3.0	2	24.3 24.3	8.1 8.1	31.8 31.8	6.8	97.4 95.7	6.7	5.2		-	
		TCE-WQM4	Misty	Calm	14:04	3.6	Surface	1.0	1	24.6	8.0	32.4	7.2	103.7	2.7	3.7		+	
		1 42 11 2 11	,						2	24.6	8.0	32.4	7.2	103.5	2.8	4.2	7.2	2.9	5.3
							Bottom	2.6	1	24.5	8.0	32.4	7.0	101.2	3.0	9.4	7.0	2.9	3.3
31-03-21	Mid-Flood	TCE-C1	Misty	Calm	9:30	8.0	Surface	1.0	2	24.5 23.4	8.0 8.1	32.4 33.5	6.9 7.1	100.1 101.3	3.1 4.6	3.9 18.0			+
31-03-21	Mid-1100d	i ci-ci	iviisty	Cann	5.50	0.0	Surface	1.0	2	23.4	8.1	33.5	7.1	101.2	4.9	18.9			
							Middle	4.0	1	23.4	8.1	33.5	7.1	101.3	6.5	18.7	7.1	6.6	19.3
							P-11	7.0	2	23.4	8.1	33.5 33.5	7.1	101.3	6.4	18.7		-	
							Bottom	7.0	2	23.4	8.1 8.1	33.5	7.0	99.9	8.8 8.6	22.0 19.5	7.0		
		TCE-C2	Misty	Calm	7:15	12.8	Surface	1.0	1	23.8	8.0	31.7	6.8	96.4	4.0	3.0			
							Middle		2	23.8 23.8	8.0	31.7	6.8	96.3 96.3	4.1	3.4	6.8		
							Middle	6.4	2	23.8	8.0	31.8 31.8	6.8	96.3 96.2	4.9 4.9	3.6	+	4.3	3.4
							Bottom	11.8	1	23.8	8.0	31.8	6.8	96.0	4.1	4.0	6.8		
									2	23.8	8.0	31.8	6.8	96.0	3.9	3.2	6.8		
		TCE-WQM1	Misty	Calm	8:40	8.2	Surface	1.0	1 2	24.1 24.1	8.0 8.0	32.1 32.1	6.9	97.8 98.0	2.4 2.4	3.4	-		
							Middle	4.1	1	24.1	8.0	32.2	7.0	99.4	3.0	2.5	6.9	3.0	3.8
									2	24.1	8.0	32.2	7.0	99.6	3.1	3.5		3.0	3.8
							Bottom	7.2	1 2	24.1 24.1	8.0 8.0	32.3 32.3	6.9	98.8 98.5	3.4 3.4	8.2 1.7	6.9		
		TCE-WQM2a	Misty	Calm	8:00	7.0	Surface	1.0	1	24.1	8.0	32.3	7.0	98.5	2.9	2.9	<b> </b>		+
									2	24.0	8.0	31.4	7.0	99.4	2.9	2.0	6.9		
							Middle	3.5	1	24.0	8.0	31.5	6.9	97.9	3.6	2.4	3.5	3.5	2.9
							Bottom	6.0	2	24.0 23.9	8.0 8.0	31.5 31.7	6.9	98.0 97.8	3.6 4.0	3.0	<del> </del>	1	
							Doubli		2	23.9	8.0	31.7	6.9	97.9	4.0	3.2	6.9	6.9	
		TCE-WQM2b	Misty	Calm	7:41	10.6	Surface	1.0	1	23.9	8.0	31.3	7.0	98.7	4.4	4.4			
							Middle	5.3	2	23.9	8.0 8.0	31.3 31.6	7.0 6.9	98.7 97.2	4.5 7.5	4.5 5.0	6.9		
							witture	J.3	2	23.9	8.0	31.6	6.9	97.2	7.6	4.4	1	7.0	6.8
							Bottom	9.6	1	23.9	8.0	31.5	6.8	96.0	9.2	10.2	6.8	1	
		TOTAL MICHAEL	35.	6.1	044	1.0	6. (	1.0	2	23.9	8.0	31.5	6.8	96.0	9.0	12.0	5.0		1
		TCE-WQM3A	Misty	Calm	8:14	4.0	Surface	1.0	1 2	23.8 23.8	8.0 8.0	31.8 31.8	6.8	95.9 95.8	1.9 2.0	2.9 2.5	6.7		
							Bottom	3.0	1	23.8	8.0	31.8	6.7	95.2	2.9	4.1	6.7	2.4	3.2
									2	23.8	8.0	31.8	6.7	95.3	2.9	3.4	6.7		
		TCE-WQM4	Misty	Calm	8:25	3.6	Surface	1.0	1 2	23.9	8.0 8.0	31.8	6.8	96.1	6.3	3.8 4.8	6.8		
							Bottom	2.6	1	23.9	7.9	31.8 31.8	6.8	96.1 92.3	6.1 3.9	4.8 5.8	8 6.8	5.0	5.0
							200000		2	23.9	7.8	31.8	6.4	90.3	3.8	5.7	6.4		
-														1					

#### Annex G4

# Event and Action Plan for Water Quality

Annex G4 Event and Action Plan for Water Quality

Event			Action	_
Event	ET	IEC	ER	Contractor
Action level exceedance for one sampling day	1. Inform IEC, Contractor and ER; 2. Check monitoring data, all plant, equipment and Contractor's working methods; and 3. Discuss remedial measures with IEC and Contractor and ER.	Discuss with ET, ER and     Contractor on the implemented     mitigation measures;     Review proposals on remedial     measures submitted by Contractor     and advise the ER accordingly;     and     Review and advise the ET and ER     on the effectiveness of the     implemented mitigation     measures.	Discuss with IEC, ET and     Contractor on the implemented     mitigation measures;      Make agreement on the remedial     measures to be implemented;      Supervise the implementation of     agreed remedial measures.	<ol> <li>Identify source(s) of impact;</li> <li>Inform the ER and confirm notification of the non-compliance in writing;</li> <li>Rectify unacceptable practice;</li> <li>Check all plant and equipment;</li> <li>Consider changes of working methods;</li> <li>Discuss with ER, ET and IEC and purpose remedial measures to IEC and ER; and</li> <li>Implement the agreed mitigation measures.</li> </ol>
Action level exceedance for more than one consecutive sampling days	<ol> <li>Repeat in-situ measurement on next day of exceedance to confirm findings;</li> <li>Inform IEC, contractor and ER;</li> <li>Check monitoring data, all plant, equipment and Contractor's working methods;</li> <li>Discuss remedial measures with IEC, contractor and ER</li> <li>Ensure remedial measures are implemented</li> </ol>	<ol> <li>Discuss with ET, Contractor and ER on the implemented mitigation measures;</li> <li>Review the proposed remedial measures submitted by Contractor and advise the ER accordingly;</li> </ol>	mitigation measures; 2. Make agreement on the remedial	<ol> <li>Identify source(s) of impact;</li> <li>Inform the ER and confirm notification of the non-compliance in writing;</li> <li>Rectify unacceptable practice;</li> <li>Check all plant and equipment and consider changes of working methods;</li> <li>Discuss with ET, IEC and ER and submit proposal of remedial measures to ER and IEC within 3 working days of notification; and</li> <li>Implement the agreed mitigation measures.</li> </ol>

ENVIRONMENTAL RESOURCES MANAGEMENT

CIVIL ENGINEERING AND DEVELOPMENT DEPARTMENT

Event			Action	
Event	ET	IEC	ER	Contractor
Limit level exceedance for one sampling day	<ol> <li>Repeat measurement on next day of exceedance to confirm findings;</li> <li>Inform IEC, contractor and ER;</li> <li>Rectify unacceptable practice;</li> <li>Check monitoring data, all plant, equipment and Contractor's working methods;</li> <li>Consider changes of working methods;</li> <li>Discuss mitigation measures</li> </ol>	<ol> <li>Discuss with ET, Contractor and ER on the implemented mitigation measures;</li> <li>Review the proposed remedial measures submitted by Contractor and advise the ER accordingly; and</li> <li>Review and advise the ET and ER on the effectiveness of the implemented mitigation measures.</li> </ol>	remedial measures; 2. Request Contractor to critically	<ol> <li>Identify source(s) of impact;</li> <li>Inform the ER and confirm notification of the non-compliance in writing;</li> <li>Rectify unacceptable practice;</li> <li>Check all plant and equipment and consider changes of working methods;</li> <li>Discuss with ET, IEC and ER and submit proposal of additional mitigation measures to ER and IEC within 3 working days of notification; and</li> <li>Implement the agreed remedial measures.</li> </ol>
Limit level exceedance for more than one consecutive sampling days	3. Discuss mitigation measures with IEC, ER and Contractor; and	<ol> <li>Discuss with ET, Contractor and ER on the implemented mitigation measures;</li> <li>Review the proposed remedial measures submitted by Contractor and advise the ER accordingly; and</li> <li>Review and advise the ET and ER on the effectiveness of the implemented mitigation measures.</li> </ol>	remedial measures; 2. Request Contractor to critically	<ol> <li>Identify source(s) of impact;</li> <li>Inform the ER and confirm notification of the non-compliance in writing;</li> <li>Rectify unacceptable practice;</li> <li>Check all plant and equipment and consider changes of working methods;</li> <li>Discuss with ET, IEC and ER and submit proposal of additional mitigation measures to ER and IEC within 3 working days of notification; and</li> <li>Implement the agreed remedial measures.</li> <li>As directed by the ER, to slow down or stop all or part of the dredging activities until no exceedance of Limit level.</li> </ol>

ENVIRONMENTAL RESOURCES MANAGEMENT

CIVIL ENGINEERING AND DEVELOPMENT DEPARTMENT

#### Annex H

## Soft Shore Ecology

#### Annex H1

## Monitoring Schedule for Soft Shore Ecology

## Tung Chung New Town Extension (East) Soft Shore Ecological Monitoring Schedule (March 2021)

Sunday	Monday					Saturday	
	1-Mar	2-Mar	3-Mar	4-Mar	5-Mar	6-Mar	
	Soft Shore Monitoring at Tung Chung Bay	Soft Shore Monitoring at Tung Chung Bay	Soft Shore Monitoring at Tung Chung Bay				
7-Mar	8-Mar	9-Mar	10-Mar	11-Mar	12-Mar	13-Mar	
14-Mar	15-Mar	16-Mar	17-Mar	18-Mar	19-Mar	20-Mar	
	Soft Shore Monitoring at Tung Chung Bay	Soft Shore Monitoring at Tai Ho Bay					
21-Mar	22-Mar	23-Mar	24-Mar	25-Mar	26-Mar	27-Mar	
28-Mar	29-Mar	30-Mar	31-Mar				

#### Annex H2

### Monitoring Results for Soft Shore Ecology

Table H2.1 Results for Horseshoe Crabs during Qualitative Walk-through Surveys in March 2021

Sighting #	Species	Prosomal Width (cm)	Total Length (cm)					
Monitoring Date: 15 March 2021								
Monitoring Station: TCB3								
1	Tachypleus tridentatus	3.6	7.8					
2	Tachypleus tridentatus	5.7	10.4					
3	Tachypleus tridentatus	5.5	7.2					
4	Tachypleus tridentatus	3.7	5.8					
5	Tachypleus tridentatus	1.2	1.9					
	Mean (Range)	3.9 (1.2 - 5.7)	6.6 (1.9 - 10.4)					
Monitoring Date: 16 March 2021								
Monitoring Station: THW								
1	Tachypleus tridentatus	3.0	6.2					
2	Tachypleus tridentatus	2.3	4.5					
3	Tachypleus tridentatus	1.8	3.6					
4	Tachypleus tridentatus	3.2	6.3					
5	Tachypleus tridentatus	2.2	4.3					
6	Tachypleus tridentatus	2.3	4.4					
7	Tachypleus tridentatus	2.2	4.4					
8	Tachypleus tridentatus	3.0	6.2					
9	Tachypleus tridentatus	2.1	4.5					
10	Tachypleus tridentatus	2.2	4.4					
11	Tachypleus tridentatus	2.6	5.0					
12	Tachypleus tridentatus	1.2	3.7					
13	Tachypleus tridentatus	1.6	3.3					
14	Tachypleus tridentatus	2.6	3.8					
15	Tachypleus tridentatus	1.4	2.3					
16	Tachypleus tridentatus	2.8	5.5					
17	Tachypleus tridentatus	2.8	5.5					
18	Tachypleus tridentatus	2.5	5.2					
19	Tachypleus tridentatus	2.9	5.4					
20	Tachypleus tridentatus	2.3	4.5					
	Mean (Range)	2.4 (1.2 - 3.2)	4.7 (2.3 – 6.3)					

Table H2.2 Results for Seagrass during Qualitative Walk-through Surveys in March 2021

Sighting #	‡ Species	Area (m2)	Area Coverage (%)	Seagrass Area (m2)			
Monitoring Date: 15 March 2021 14:30-16:30							
Monitoring Station: TCB3							
1	Halophila ovalis	35	90%	31.5			
2	Halophila ovalis	42	80%	33.6			

Table H2.3 Results for Other Intertidal Soft Shore Communities during Qualitative Walk-through Surveys in March 2021

Monitoring Station	Shore Height *	No. of Species
TCB1	Н	45
	M	40
	L	33
	Overall	51
TCB2	Н	37
	M	31
	L	38
	Overall	52
TCB3	Н	36
	M	35
	L	33
	Overall	45
THW	Н	43
	M	38
	L	34
	Overall	52

<sup>\*</sup> H: +2mCD; M: +1.5mCD; L: +1mCD

Table H2.4 Results for Other Intertidal Soft Shore Communities during Quantitative Transect Surveys in March 2021

Monitoring Station	Shore Height *	Top Three Dominant Species	Density (ind./m²)
TCB1	Н	1 Batillaria multiformis	208.8
		2 Monodonta labio	80.0
		3 Cerithidea diadjariensis	55.2
	M	1 Monodonta labio	89.6
		2 Batillaria multiformis	46.4
		3 Cerithidea diadjariensis	30.4
	L	1 Batillaria zonalis	48.0
		2 Monodonta labio	42.4
		3 Cerithidea diadjariensis	40.0
TCB2	Н	1 Cerithidea diadjariensis	43.2
		2 Oligochaete sp.	4.0
		3 Batillaria multiformis <b>and</b> Batillaria zonalis	3.2
	M	1 Cerithidea diadjariensis	74.4
		2 Batillaria zonalis	9.6
		3 Oligochaete sp.	4.0
	L	1 Cerithidea diadjariensis	55.2
		2 Batillaria zonalis	52.8
		3 Monodonta labio	6.4
TCB3	Н	1 Batillaria multiformis	550.4
		2 Cerithidea diadjariensis	284
		3 Cerithidea cingulata	47.2
	M	1 Batillaria multiformis	302.4
		2 Cerithidea diadjariensis	228.8
		3 Batillaria zonalis	41.6
	L	1 Cerithidea diadjariensis	128.8
		2 Batillaria zonalis	62.4
		3 Batillaria multiformis	41.4
THW	Н	1 Cerithidea diadjariensis	166.4
		2 Geloina erosa	18.4
		3 Cerithidea cingulata	10.4
	M	1 Cerithidea diadjariensis	64.0
		2 Terebralia sulcata	19.2
		3 Cerithidea cingulata	8.0
	L	1 Batillaria zonalis	55.2
		2 Cerithidea diadjariensis	36.0
		3 Anomalocardia squamosa,	3.2
		Cerithidea microptera and	
		Clithon spp.	

<sup>\*</sup> H: +2mCD; M: +1.5mCD; L: +1mCD

			TCB1		1	TCB2			тсв3			THW	
Group	Species	H (Qual)		L (Qual)	H (Qual)	M (Qual)	L (Qual)	H (Qual)	M (Qual)	L (Qual)	H (Qual)	M (Qual)	L (Qual)
Algae	Enteromorpha spp.	++	++	+	+++	++	+++	+++	+++	+++	+++	+++	++
Algae	Ulva sp.	+	+	+		+			+	+			
Anemone	Haliplanella lineata			+									
Barnacle	Balanus amphitrite	++	+	+	+	+	+	+	+	+	+	+	+
Bivalve	Anomalocardia squamosa			+			+			+			+
Bivalve	Anomalocardia flexuosa						+						
Bivalve	Barbatia virescens	+	+	+		+			+	+		+	
Bivalve	Circe sp.	-											+
Bivalve	Coecella chinensis				+					+	+	+	+
Bivalve Bivalve	Cyclina sinensis							+	+	+	+	+	+
Bivalve	Donax sp. Geloina erosa	_	+		_			_	+		++	++	+
Bivalve	Glauconome chinensis	т	т		T			т	т		1	_	_
Bivalve	Laternula anatina										+	т	_
Bivalve	Perna viridis		+	+			+	+			l		
Bivalve	Saccostrea cucullata	++	++	++	+	+	+	+	+	++	++	+	+
Bivalve	Septifer virgatus	+	+	+		+	+	+	+	+		+	
Bivalve	Ruditapes philippinarum			+									
Crab	Clistocoeloma sp.				+						+		
Crab	Hemigrapsus sanguineus	++	++	+	+	+	+	+	+	+	++	+	+
Crab	Macrophthalmus sp.	+	+	+	+	+	+	+	+	+	+	+	+
Crab	Metaplazx longipes										+	+	+
Crab	Metapograpsus frontalis	+	+	+	+	+	+		+	+	+	+	+
Crab	Metapograpsus quadridemtatus	+					+						+
Crab	Parasesarma pictum										+	+	
Crab	Perisesarma bidens	+	+		+	+	+		+		+	+	+
Crab	Scopimera globosa	+	+		+	+	+						
Crab	Thalamita crenata			ļ. —	<del> </del>			<del> </del> .			+	+	<del>                                     </del>
Crab	Uca borealis	++	+	+	+	+	+	+			+	+	+
Crab	Uca lactea	++	+		+	+	+	+	+	+	+	+	+
Crab	Uca crassipes	+	+		l						<del>*</del>		
Crab Fish	Uca splendida				+						+	+	
Fish	Mugilidae sp. Periophthalmus cantonensis	_	+		_	+	+	_	+	+	<u>-</u>	+	+
Fish	Scartelaos histophorus	<u> </u>	т			т	т	<u>-</u>	т	т	T	т	<u> </u>
Gastropod	Batillaria multiformis	+++	++	+	+	+	+	+++	+++	+	+	+	+
Gastropod	Batillaria zonalis	++	++	++	+	+	++	+	++	++	+	+	++
Gastropod	Cellana grata				+		+	+	+	+	+		+
Gastropod	Cellana toreuma						+						
Gastropod	Cerithidea cingulata	+	+	+	+	+	+	++	+	+	+	+	+
Gastropod	Cerithidea diadjariensis	+++	++	++	++	++	++	+++	+++	++	++	++	++
Gastropod	Cerithidea microptera				+	+		+			+	+	+
Gastropod	Cerithidea rhizophorarum				+			+				+	+
Gastropod	Chlorostoma argyrostoma										+		
Gastropod	Clithon spp.	+	+	+	+	+	+	+	+	+	++	++	+
Gastropod	Echinolittorina radiata						+	+					
Gastropod	Echinolittorina malaccana									+			
Gastropod	Littoraria articulata	+	+	+	+	+	+	+	+	+	+		
Gastropod	Littoraria melanostoma				+	+	+	+	+		+		
Gastropod	Lunella coronata	+	+	++	+	+	+	+	+	+			
Gastropod	Monodonta labio	++	++	++	+	+	+	+	+	+	+	+	
Gastropod	Monodonta neritoides				+			ł			l		ļ. —
Gastropod	Nassarius festivus	+	+	+	+	+	+	+	+	+	+	+	+
Gastropod	Natica sp.	+			-		+	-		+	<del> </del>		-
Gastropod	Nerita albicilla Nerita polita	<u>+</u>	+	+		т	+		+	+	,	+	+
Gastropod Gastropod	Nipponacmea concinna	-	+	+	$\vdash$		+	ľ	+	-	-	-	-
Gastropod	Patelloida pygmaea	+	+	<u> </u>	<b>-</b>		'	H			H		<del>                                     </del>
Gastropod	Planaxis sulcatus	+	+		+	+		+	+	+	+		
Gastropod	Strombus sp.						+						
Gastropod	Terebralia palustris				+			i e			++	+	
Gastropod	Terebralia sulcata	+	+	+	+			+	+	+	++	+	
Gastropod	Thais clavigera			+					+	+			
Hermit Crab	Clibanarius sp.	+	+	+	+	+	+	+	+	+	+	+	+
Hermit Crab	Diogenes sp.	+	+	+									
Hermit Crab	Pagrurus sp.	+	+					+	+	+			
Horseshoe Crab	Tachypleus tridentatus							+	++	+	++	+	+
Seagrass	Halophila ovalis							+	+				
Sea Slater	Ligia oceanica	+			++	+					+		+
Seaslug	Onchidium sp.	+	+		+						+	+	
Worm	Ampharetidae sp.	+									+		+
Worm	Ceratonereis sp.						+						
Worm	Harmothoe imbricata			+									
Worm	Ochetostoma erythrogrammon	+	+					+			<u> </u>		
Worm	Oligochaete sp.	+	+	+	+	+	+	+	+	+	L	+	+
Worm	Siphonosoma sp.	+	+					+	+		-		
Worm	Sipunculus sp.	+	+	+	ł. —		+	+	+	+	<b>.</b>		ļ. —
Worm	Ribbon Worm sp.	+	+	+	+	+	+					+	+

											T	CB1							
Group	Species	Н1	H2	НЗ	Н4	Н5	Density (ind. / m <sup>2</sup> or % cover)	М1	M2	МЗ	M4	M5	Density (ind. / m <sup>2</sup> or % cover)	L1	L2	L3	L4	L5	Density (ind. / m <sup>2</sup> or % cover)
Algae	Enteromorpha spp.	<5%	15%	<5%	<5%	<5%	3%	<5%	60%	40%	15%	15%	26%		<5%	<5%	<5%		<5%
Barnacle	Balanus amphitrite						0						0				<5%		<5%
Bivalve	Anomalocardia squamosa						0						0		1				0.8
Bivalve	Barbatia virescens						0	<5%			<5%	<5%	<5%					<5%	<5%
Bivalve	Coecella chinensis						0						0						0
Bivalve	Cyclina sinensis						0						0						0
Bivalve	Geloina erosa						0						0						0
Bivalve	Perna viridis						0						0					<5%	<5%
Bivalve	Saccostrea cucullata	<5%	<5%	<5%	5%	15%	4%	40%	30%	10%	15%	5%	20%	20%	5%	5%	10%	25%	13%
Bivalve	Ruditapes philippinarum						0						0				1		0.8
Crab	Metapograpsus frontalis						0						0						0
Crab	Metapograpsus quadridemtatus						0						0						0
Crab	Uca borealis						0						0						0
Gastropod	Batillaria multiformis	70	26	66	7	92	208.8	4		20	9	25	46.4	1	2	4		4	8.8
Gastropod	Batillaria zonalis	1		3			3.2	6	1				5.6	3	25	30	1	1	48
Gastropod	Cerithidea cingulata	2				2	3.2						0			10	6		12.8
Gastropod	Cerithidea diadjariensis	13	2	41		13	55.2	1	2	31		4	30.4	10		18	15	7	40
Gastropod	Cerithidea microptera						0						0						0
Gastropod	Clithon spp.						0						0						0
Gastropod	Littoraria articulata				4		3.2				3		2.4						0
Gastropod	Lunella coronata				3		2.4	5	3	1	5	4	14.4	1	1	17	15	10	35.2
Gastropod	Monodonta labio	4	25	14	40	17	80	12	32	11	37	20	89.6	2		5	10	36	42.4
Gastropod	Nassarius festivus						0						0	1	1	3			4
Gastropod	Nerita polita						0			1	3	1	4			1	2	3	4.8
Gastropod	Nipponacmea concinna				1		0.8	1					0.8				3	8	8.8
Gastropod	Terebralia sulcata	1					0						0						0
Seaslug	Onchidium sp.						0						0						0
Worm	Oligochaete sp.						0						0						0
Worm	Siphonosoma sp.	7					5.6						0						0
Worm	Sipunculus sp.	7		5		2	11.2	2		1		2	4	1		3			3.2
Worm	Ribbon Worm sp.	1					0						0						0

		Ī									T	CB2							
Group	Species	Н1	H2	НЗ	Н4	Н5	Density (ind. / m <sup>2</sup> or % cover)	М1	M2	мз	M4	M5	Density (ind. / m <sup>2</sup> or % cover)	L1	L2	L3	L4	L5	Density (ind. / m <sup>2</sup> or % cover)
Algae	Enteromorpha spp.	5%	10%	25%	15%	35%	18%	50%	20%	20%	25%	30%	29%	65%	80%	80%	45%	95%	73%
Barnacle	Balanus amphitrite						0						0						0
Bivalve	Anomalocardia squamosa						0						0						0
Bivalve	Barbatia virescens						0						0						0
Bivalve	Coecella chinensis	1					0.8						0						0
Bivalve	Cyclina sinensis						0						0						0
Bivalve	Geloina erosa						0						0						0
Bivalve	Perna viridis						0						0		<5%				<5%
Bivalve	Saccostrea cucullata	<5%	5		<5%		<5%	5%					<5%	10%	10%				4%
Bivalve	Ruditapes philippinarum						0						0						0
Crab	Metapograpsus frontalis						0						0	3	1		1		4
Crab	Metapograpsus quadridemtatus						0						0	1					0.8
Crab	Uca borealis						0			1			0.8						0
Gastropod	Batillaria multiformis			3	1		3.2		1	1			1.6		1			2	2.4
Gastropod	Batillaria zonalis					4	3.2	2	7	1	2		9.6	1	30		3	32	52.8
Gastropod	Cerithidea cingulata						0			1			0.8		5	1		1	5.6
Gastropod	Cerithidea diadjariensis	1	2	3	16	32	43.2	5	24	14	48	2	74.4	4	31	5	22	7	55.2
Gastropod	Cerithidea microptera	1					0.8						0						0
Gastropod	Clithon spp.	Т					0						0						0
Gastropod	Littoraria articulata						0						0						0
Gastropod	Lunella coronata						0						0	2	5				5.6
Gastropod	Monodonta labio				1		0.8						0	2	6				6.4
Gastropod	Nassarius festivus						0			1			0.8	1	2				2.4
Gastropod	Nerita polita						0						0						0
Gastropod	Nipponacmea concinna	1					0				İ		0		1				0.8
Gastropod	Terebralia sulcata	1					0						0						0
Seaslug	Onchidium sp.	1					0						0						0
Worm	Oligochaete sp.	1			5		4	5					4					1	0.8
Worm	Siphonosoma sp.	1					0						0						0
Worm	Sipunculus sp.						0						0	1					0.8
Worm	Ribbon Worm sp.	1					0						0					1	0.8

											TC	СВЗ							
Group	Species	Н1	H2	нз	Н4	Н5	Density (ind. / m <sup>2</sup> or % cover)	М1	M2	М3	M4	M5	Density (ind. / m <sup>2</sup> or % cover)	L1	L2	L3	L4	L5	Density (ind. / m <sup>2</sup> or % cover)
Algae	Enteromorpha spp.		10%	10%	<5%		4%	5%	25%	<5%	5%	5%	8%	15%	5%	30%	5%	5%	12%
Barnacle	Balanus amphitrite						0						0						0
Bivalve	Anomalocardia squamosa						0						0				2	2	3.2
Bivalve	Barbatia virescens						0						0						0
Bivalve	Coecella chinensis						0						0						0
Bivalve	Cyclina sinensis		1	2			2.4			1			0.8				1		0.8
Bivalve	Geloina erosa	2		1			2.4					2	1.6						0
Bivalve	Perna viridis	<5%					<5%						0						0
Bivalve	Saccostrea cucullata	<5%	<5%		<5%		<5%	<5%		10%	10%	5%	5%	5%	<5%	15%	5%	10%	7%
Bivalve	Ruditapes philippinarum						0						0						0
Crab	Metapograpsus frontalis						0						0						0
Crab	Metapograpsus quadridemtatus						0						0						0
Crab	Uca borealis						0						0						0
Gastropod	Batillaria multiformis	126	232	19	149	162	550.4	176	133	33	16	20	302.4	3	28	5	10	6	41.6
Gastropod	Batillaria zonalis			2			1.6	1		33		18	41.6	4	9	12	31	22	62.4
Gastropod	Cerithidea cingulata	6	18	5	10	20	47.2		16	10	2		22.4	1	1	2			3.2
Gastropod	Cerithidea diadjariensis	68	50	40	90	107	284	32	106	36	47	65	228.8	66	72	22	1		128.8
Gastropod	Cerithidea microptera						0						0						0
Gastropod	Clithon spp.			1			0.8		3	1		1	4			2		1	2.4
Gastropod	Littoraria articulata						0						0						0
Gastropod	Lunella coronata					1	0.8				1	3	3.2	2		2	2	4	8
Gastropod	Monodonta labio						0	1	1			1	2.4	1		1	3	2	5.6
Gastropod	Nassarius festivus						0				1		0.8		1		2		2.4
Gastropod	Nerita polita			1			0.8			3			2.4						0
Gastropod	Nipponacmea concinna						0						0						0
Gastropod	Terebralia sulcata						0						0						0
Seaslug	Onchidium sp.						0						0						0
Worm	Oligochaete sp.						0						0						0
Worm	Siphonosoma sp.						0						0						0
Worm	Sipunculus sp.						0			1		1	1.6			1			0.8
Worm	Ribbon Worm sp.						0						0						0

												THW	1						
Group	Species	Н1	H2	нз	Н4	Н5	Density (ind. / m <sup>2</sup> or % cover)	М1	M2	М3	M4	M5	Density (ind. / m <sup>2</sup> or % cover)	L1	L2	L3	L4	L5	Density (ind. / m <sup>2</sup> or % cover)
Algae	Enteromorpha spp.	20%	50%	50%			24%	50%	85%	75%	85%	90%	77%						0%
Barnacle	Balanus amphitrite						0						0			5%			4%
Bivalve	Anomalocardia squamosa						0						0		1	. 1	1	. 1	3.2
Bivalve	Barbatia virescens						0						0						0
Bivalve	Coecella chinensis						0						0						0
Bivalve	Cyclina sinensis						0						0						0
Bivalve	Geloina erosa	6	2	5	8	2	18.4	2				4	4.8						0
Bivalve	Perna viridis						0						0						0
Bivalve	Saccostrea cucullata	1%				2%	1%	2%					<5%			10%			2%
Bivalve	Ruditapes philippinarum						0						0						0
Crab	Metapograpsus frontalis						0						0						0
Crab	Metapograpsus quadridemtatus						0						0						0
Crab	Uca borealis						0						0						0
Gastropod	Batillaria multiformis						0						0		1				0.8
Gastropod	Batillaria zonalis						0						0	21	14	13	8	13	55.2
Gastropod	Cerithidea cinqulata	8	2		1	2	10.4	8		1	1		8				2		1.6
Gastropod	Cerithidea diadjariensis	36	44	14	57	57	166.4	17	14	32	4	13	64	8	2	16	17	2	36
Gastropod	Cerithidea microptera						0						0			4			3.2
Gastropod	Clithon spp.				T		0						0			4			3.2
Gastropod	Littoraria articulata				T		0						0						0
Gastropod	Lunella coronata						0						0						0
Gastropod	Monodonta labio						0						0						0
Gastropod	Nassarius festivus						0						0						0
Gastropod	Nerita polita						0						0						0
Gastropod	Nipponacmea concinna						0						0						0
Gastropod	Terebralia sulcata	1	2	8	Т	1	8.8	1	8	3	11	1	19.2	Ī				1	0
Seaslug	Onchidium sp.	1		1	1	Ē	1.6	Ė	3	Ť			2.4						0
Worm	Oligochaete sp.	1					0						0						0
Worm	Siphonosoma sp.	1					0						0						0
Worm	Sipunculus sp.	1					0						0						0
Worm	Ribbon Worm sp.	1			t		0						0						0

### Annex H3

# Event and Action Plan for Soft Shore Ecology

Annex H3 Event and Action Plan for Soft Shore Ecological Monitoring

Event	Action													
Event	ET	IEC	ER	Contractor										
Density or the distribution pattern of horseshoe crab, seagrass and intertidal soft shore communities recorded in the impact or post-construction monitoring are significantly lower than or different from those recorded in the baseline monitoring.	differences are as a result of natural variation or previously observed seasonal differences;  2. Identify source(s) of impact;  3. Inform the IEC, ER and Contractor;	<ol> <li>Discuss amongst ER, ET, and Contractor on the potential remedial actions;</li> <li>Review proposals for additional monitoring and any other measures submitted by the Contractor and advise the ER accordingly;</li> <li>Supervise the implementation of remedial measures.</li> </ol>	<ol> <li>Discuss with the IEC additional monitoring requirements and any other measures proposed by the ET;</li> <li>Make agreement on the measures to be implemented.</li> </ol>	<ol> <li>Inform the ER and in writing;</li> <li>Discuss with the ET and the IEC and propose measures to the IEC and the ER;</li> <li>Implement the agreed measures;</li> <li>Resubmit proposals of remedial actions if problem still not under control;</li> <li>Stop the relevant portion of works as determined by the ER until the exceedance is abated.</li> </ol>										

#### Annex I

Cumulative Statistics on Exceedances, Environmental Complaints, Notification of Summons and Status of Prosecutions

 Table I1
 Cumulative Statistics on Exceedances

		Total No. recorded in this reporting period	Total No. recorded since project commencement
Air Quality (1-hr TSP)	Action	0	0
	Limit	0	0
Noise	Action	5	48
	Limit	0	0
Water Quality	Action	0	0
	Limit	0	0
Marine Ecology	Action	0	0
	Limit	0	0

#### Remark:

Table I2 Cumulative Statistics on Complaints, Notifications of Summons and Successful Prosecutions

Reporting Period		<b>Cumulative Statistics</b>	
_	Complaints	Notifications of	Prosecutions
		Summons	
This Reporting Period (1 – 31 March 2021)	6	0	0
Total no. received since project commencement	99	0	0

<sup>(1)</sup> Exceedances, which are not project related, are not shown in this table.

### Annex J

# Monitoring Schedule for the Next Reporting Period

Tung Chung New Town Extension (East)

Sunday		Monday	Tuesday	Wednesday	Thursday	Friday	Saturdav
					1-Apr		
					Air Quality and Noise Monitoring		
	4-Apr	5-Apr	6-Apr	7-Apr	8-Apr	9-Apr	10-Apr
				Air Quality and Noise Monitoring			
	11-Apr	12-Apr	13-Apr	14-Apr	15-Apr	16-Apr	17-Apr
			Air Quality and Noise Monitoring				
	18-Apr	<u>19-Apr</u>	20-Apr	21-Apr	22-Apr	23-Apr	24-Apr
		Air Quality and Noise Monitoring					Air Quality and Noise Monitoring
	25-Apr	26-Apr	27-Apr	28-Apr	29-Apr	30-Apr	
						Air Quality and Noise Monitoring	

## Tung Chung New Town Extension (East) Impact Marine Water Quality Monitoring (WQM) Schedule (April 2021)

Sunday		Tuesday				Saturday
				1-Apr	2-Apr	3-Apr
					ebb tide 14:38 - 18:08 flood tide 7:51 - 11:21	
4-Apr	5-Apr	6-Apr	7-Apr	8-Apr	9-Apr	10-Apr
	ebb tide 18:12 - 21:12 flood tide 5:23 - 8:53		ebb tide 9:12 - 12:42 flood tide 13:57 - 17:27		ebb tide 10:25 - 13:55 flood tide 15:46 - 19:16	
11-Apr	12-Apr	13-Apr	14-Apr	15-Apr	16-Apr	17-Apr
	ebb tide 11:44 - 15:14 flood tide 5:37 - 9:07		ebb tide 12:39 - 16:09 flood tide 6:12 - 9:42		ebb tide 13:39 - 17:09 flood tide 6:51 - 10:21	
18-Apr	19-Apr	20-Apr	21-Apr	22-Apr	23-Apr	24-Apr
	ebb tide 15:51 - 18:35 flood tide 3:17 - 6:47		ebb tide 18:26 - 21:15 flood tide 6:35 - 9:22		ebb tide 9:15 - 12:27 flood tide 14:10 - 17:40	
25-Apr	26-Apr	27-Apr	28-Apr	29-Apr	30-Apr	
	ebb tide 10:42 - 14:12 flood tide 4:35 - 8:05		ebb tide 12:02 - 15:32 flood tide 5:36 - 9:06		ebb tide 13:35 - 17:05 flood tide 6:44 - 10:14	

Remark:

Pickup time and place of 1st tide: 15 min before tidal window at Sham Tseng pier Pickup time and place of 2nd tide: 15 min before tidal window at Tung Chung pier